STANDARD OPERATING PROCEDURE OF STITCH TEAR VF-B08

Lab /SOP/ 09




1. Tensile testing machine with chart recorder
2. Clamps
3. Steel scale or calipers



Needle holding jig(SATRA STD176)
Needles, round point 16*1 size 14.



Test three (3) samples in each direction per material.

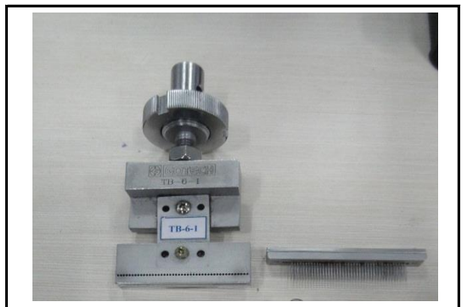

Set Plate C of the needle holding jig, such that the margin is 3.0+/-0.1mm. For Webbings Plate C should be set at 6.0+/-0.1mm.



Insert the test sample in the jig such that the base butts against the end of Plate C, and the sample is aligned centrally between the two end needle holes.
Push the 17 needles through the opening in the holding jig and the test sample
Insert the holding jig in the bottom fixture of the tensile testing machine



Zero and calibrate the tensile testing machine, set the crosshead speed to 100mm/minute.
Insert and clamp the free end of the test material centrally in the top jaw of the tensile testing machine, to a depth of 2.0-2.5cm.



Operate the tensile testing machine at a crosshead speed of 100mm/minute.



Record the maximum load required to tear through the test material to the nearest 0.1kgf.
Stitch tear strength (kgf/cm) = L/2.5cm

Prepared by	Approved by	REVISION		DATE	