STANDARD OPERATING PROCEDURE OF Lace Tip Retention VF-B24

Lab /SOP/ 11




1. Tensile testing machine with chart recorder
2. Clamps
3. Steel scale or calipers




A jig for holding the test shoe lace tag consisting of a flat metal plate of thickness approximately 3mm with a “V” shaped slot cut in it which has:
Vertical edges
A width at the top of the “V” approximately 3mm
A length of approximately 35mm




Test six (6) samples
Clamp the tag of a test shoelace in the jig by sliding the lace into the slot so that the base of the tag is adjacent to the metal plate.

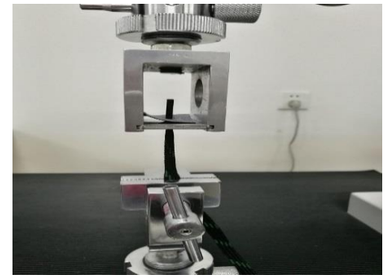


Attach the jig to one of the jaws of the tensile testing machine so that the tag is aligned with the axis of the tensile testing machine.

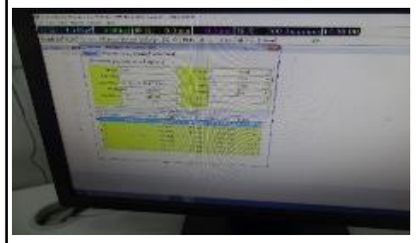

Clamp the main body of the test lace in the other jaw of the tensile testing machine so that the lace is just taut and its longitudinal axis is 90° to the clamping edges.

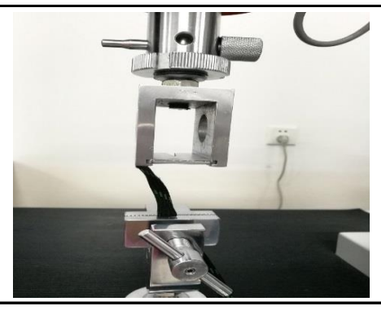

Operate the tensile testing machine with a jaw separation rate of 100 ± 10 mm/min until the specimen fails.

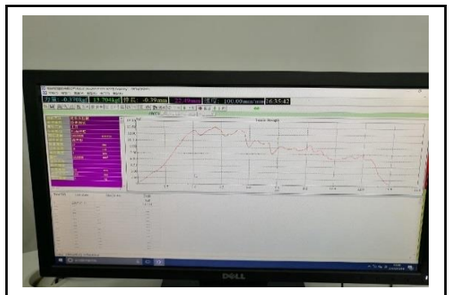

Record the force at break in kgf

Prepared by	Approved by	REVISION		DATE	