STANDARD OPERATING PROCEDURE OF Slide Fasteners to Repeated Opening and Closing VF-B26


Lab /SOP/ 36



Test machine in compliance with SATRA PM 50 or BS 3084-2004.

Protractor or any device for measuring angles of 30 ± 5° and 60 ± 10°


Steel ruler or caliper

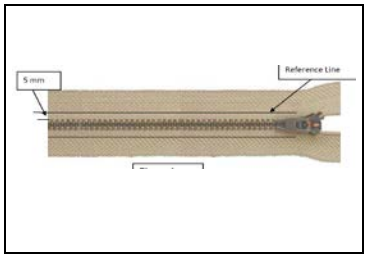

1.Take a specimen of no less than 200mm in length

2. Draw two reference lines 5mm from the ends of the elements on both sides


3.Connect a required power supply to the machine and turn on the power switch.

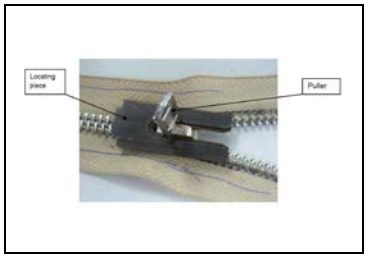

clamping of specimens


i) Adjust the manual knob until the puller clamping device is in the lowest position and then the indicating lamp will light up.

ii) Attach one or two locating pieces of proper thickness to the puller, and then use a hex key to release the setscrew of the clamping device. Fix the puller under the presser and then lock the setscrew.

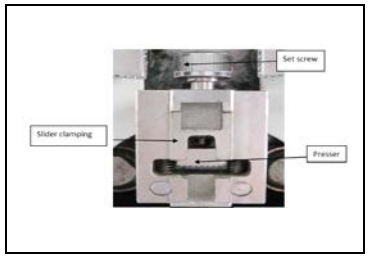

iii) Fix the bottom ends of the zipper (bottom stop) to the upper clamp A in such a way that the central line of the jaws is perpendicular to that of the zipper.


iv). Fix the top ends of the zipper (top stop) to the longitudinal clamps, and then use the 60°angle gauge to measure the angle α when the specimen is closed.

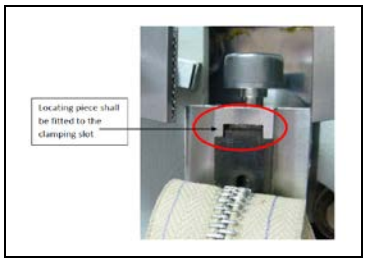


v) Remove the 60°angle gauge and grasp the puller to move the zipper upwards until the stop pin was met. Simultaneously check if the red line marked on the stop pin is parallel with the swivel plate.

vi). Lock the clamp A.

vii) Adjust the spring balances E to apply the appropriate longitudinal forces.

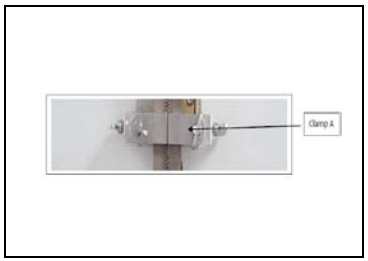


Viii) Fix the fastener tapes to the lateral clamps F, leaving gaps of 5mm between the lateral clamps and the chain at the nearest points (the gaps can be gotten by adjusting the screw H.), namely clamp at the reference lines . Ensure that the center lines of the lateral clamps F coincide with the strings that pass over the pulleys.

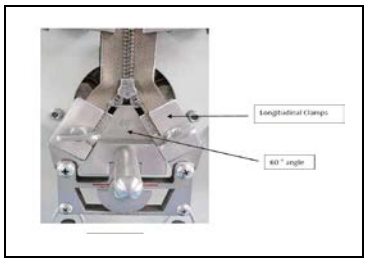

ix) Adjust the spring balances G to apply the appropriate lateral forces. (Please skip this step if a short zip fastener is used)

x) Set a required test value on the control panel (refer to the control panel section for more details), and then start the machine to allow its clamping devices to operate for on cycle to equalize the position of specimen.

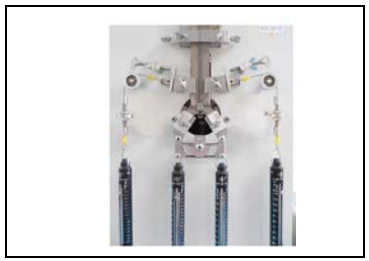

Set the speed at 30 ± 3 cycles per minute

Set the specified number of cycles on the control panel and clear any figure seen on the actual test value.

At the end of the specified number of cycles, remove the specimen and turn off the power switch.

After completion of the test, remove the specimen and check for any damage.

Prepared by	Approved by	REVISION		DATE	