
STANDARD OPERATING PROCEDURE OF CROCKING VF-E02

Lab /SOP/ 23




Crockmeter
Crockmeter test cloth
Immersion dish.
Distilled water
AATCC Chromatic Transference Scale

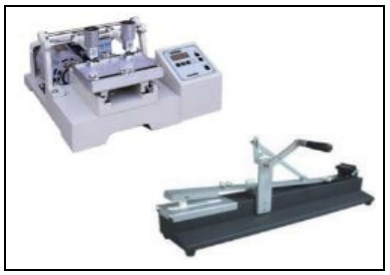


Test one (1) dry sample and one (1) wet sample per material.



crockmeter test cloth approximately 5cm*5cm.

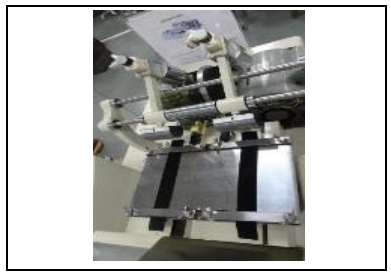


Place the test material on the base of the crockmeter, and secure by positioning the holder over the material and clamping.
Mount the crockmeter test cloth on the end of the 1.5cm diameter finger of the crockmeter and clamp in place.

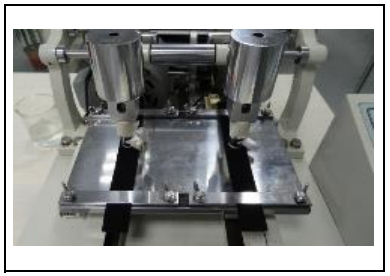

Lower the covered finger onto the test specimen.
Set the timer to 10 cycles. Initiate testing.
At the end of 10 cycles , remove the crockmeter test cloth from the finger and place on a white piece of paper.



Thoroughly wet the crockmeter test fabric by dipping in distilled water, Allow any excess water to drip from the test cloth, position on the finger of the crockmeter and clamp in place.

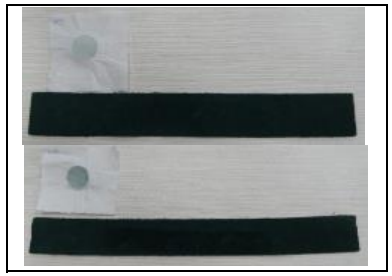

At the end of 10 cycles , remove the crockmeter test cloth from the finger and place on a white piece of paper.



Evaluate the colorfastness to dry crocking by comparing the darkest portion of the test cloth to the AATCC Chromatic Transference Scale .The evaluation must be performed under normal day light.
Chromatic Transference Scales must be replaced at least every 24 months.

Prepared by	Approved by	REVISION		DATE	