
STANDARD OPERATING PROCEDURE OF Strength of Heel Attachment VF-F09

Lab /SOP/ 53



Tensile machine
Jigs for heel attachment
A metal bar of diameter 5.5± 0.5 mm and minimum length of 100 mm
A stirrup, of minimum width 80mm, capable of supporting the bar at both ends
Steel scale, capable of measuring to 0.5mm

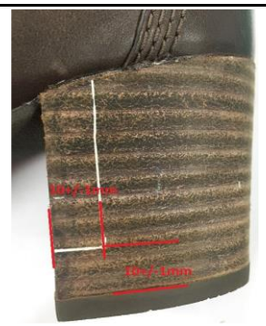


Assembled shoes with high heels
Using the calipers, measure the heel height as the vertical distance between the top rear edge of the heel and the ground, with the top piece or heel base flat on the ground. Record this value as H.




Drill a hole aligned with the pivot axis of diameters just sufficient to allow free rotation of the rod.



Clamp the shoe in the tensile testing machine using a rod inserted in the heel.
The edge of the clamp grips the forepart a short distance forward of the front end of the shank.
Zero force is applied to the shoe.

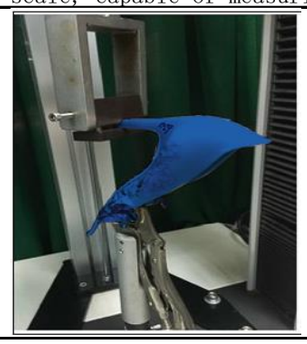

Clamp the shoe in the tensile testing machine usir
an exterior heel clamp

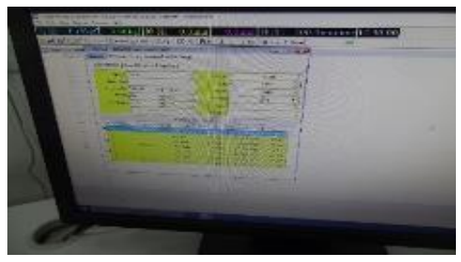

Operate the tensile testing machine at a jaw separation of 100mm/minute.
Stop the machine when a force of 20 kgf has been applied.
Immediately measure the distance between the reference point and the top piece to the nearest 0.5 mm, without releasing the force. Record this distance as
D1.



Restart the tensile machine and continue until the force of 40kgf has been applied.
Stop the machine and reverse the direction of the jaws until zero force is applied to the shoe.
Operate the tensile machine at a jaw separation of 100mm/minute until the heel becomes detached or some either failure occur.



Measure the maximum force applied in kgf.

Prepared by	Approved by	REVISION		DATE	