STANDARD OPERATING PROCEDURE OF WHOLE SHOE FLEX VF-G02

Lab /SOP/ 41



Whole Shoe flexing machine.

Soft PU LAST

Vernier caliper



Foam foot aligned with insole of the shoe



Basis of the edge of insole location inside the shoe on the heel part



Reference for outsole marking



Start of outsole marking

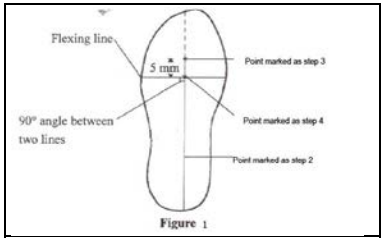


Figure 1

Draw flexing line according fingure 1



O/S marking for flexing point



Place the PU Foam Foot into each shoe to be tested – same size as the shoe sample. Note:If the actual size indicated on the PU Foam Foot is too tight, may use the 1 size lower.



1: angle @ 60 degrees for running shoes

2: angle @ 45 degrees for vulcanize, casual shoes

3: angle @ 30 degrees for thick sole shoes



Position the shoe on the Machine such that the flex area is located at the joint of the machine base and the flexing bar.



Set the speed at 130±10 rev/min.Set the cycle counter to zero.Check the shoes at least every 5,000 cycles over the first 25,000 cycles, after 25,000 cycles,check the shoes at least every 10,000 cycles



Record the number of cycles at which damage to the flex area of the shoe first occurs and the length and depth of delamination at the standard required cycles in mm.

Prepared by	Approved by	REVISION		DATE	