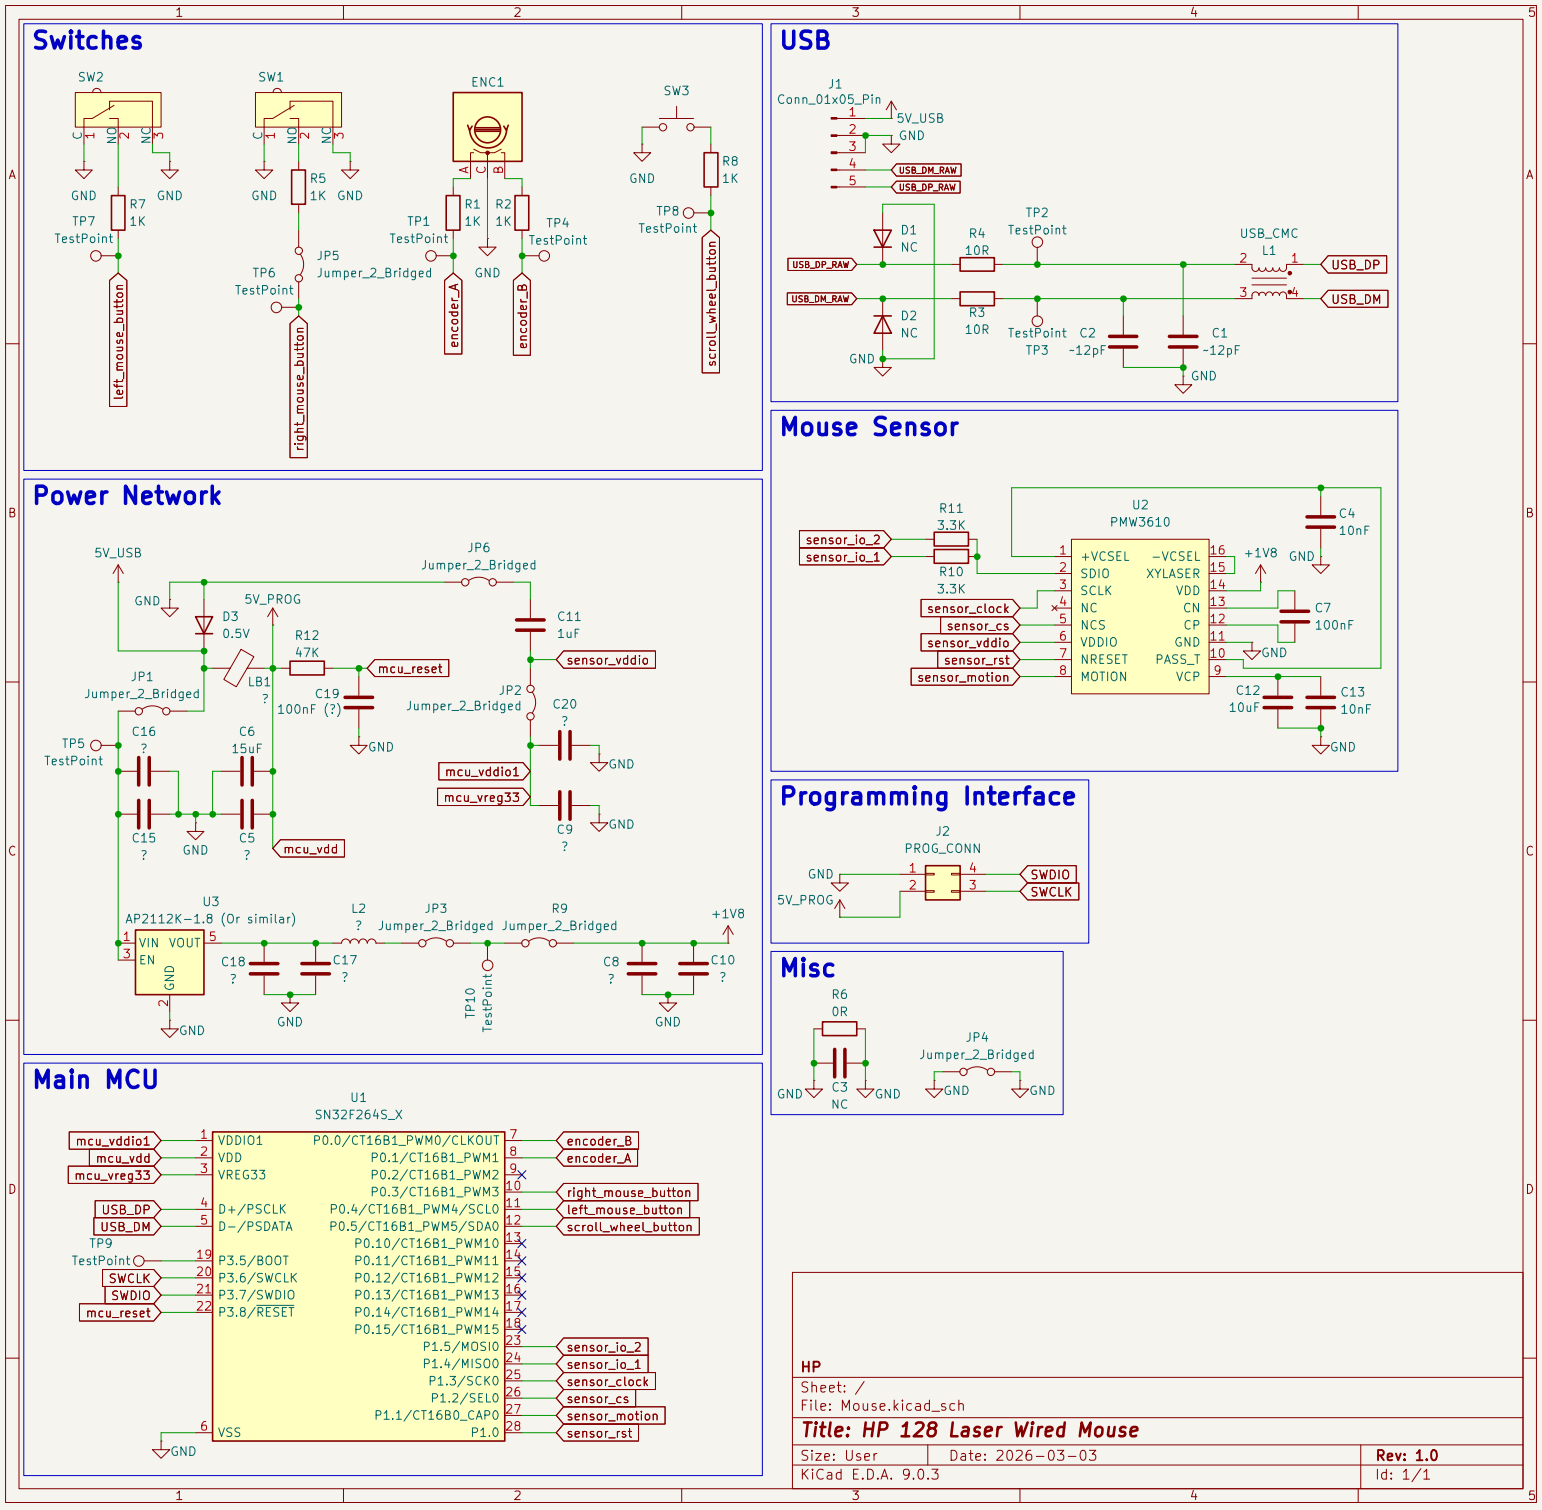
Switches
SW2
SW1
ENC1
SW3
R7 1K
R5 1K
R1 1K
R2 1K
R8 1K
TP7 TestPoint
TP6 TestPoint
TP1 TestPoint
TP4 TestPoint
TP8 TestPoint
JP5 Jumper_2_Bridged
left_mouse_button
right_mouse_button
encoder_A
encoder_B
scroll_wheel_button
USB
J1 Conn_01x05_Pin
5V_USB
USB_DP_RAW
USB_DM_RAW
D1 NC
D2 NC
R4 10R
R3 10R
TP2 TestPoint
TP3 TestPoint
USB_CMC
L1
USB_DP
USB_DM
C2 -12pF
C1 -12pF
Power Network
5V_USB
JP6 Jumper_2_Bridged
5V_PROG
D3 0.5V
LB1
R12 47K
C19 100nF (?)
mcu_reset
C11 1uF
sensor_vddio
JP1 Jumper_2_Bridged
JP2 Jumper_2_Bridged
C16
C6 15uF
C15
C5
C20
mcu_vddio1
mcu_vreg33
C9
mcu_vdd
TP5 TestPoint
U3
AP2112K-1.8 (Or similar)
VIN VOUT EN GND
L2
JP3 Jumper_2_Bridged
R9 Jumper_2_Bridged
+1V8
C18
C17
C8
C10
TP10 TestPoint
Mouse Sensor
U2
PMW3610
R11 3.3K
R10 3.3K
sensor_io_2
sensor_io_1
sensor_clock
sensor_cs
sensor_vddio
sensor_rst
sensor_motion
+VCSEL
SDIO
SCLK
NC
NCS
VDDIO
NRESET
MOTION
-VCSEL
XYLASER
VDD
CN
CP
GND
PASS_T
VCP
+1V8
C4 10nF
C7 100nF
C12 10uF
C13 10nF
Programming Interface
J2
PROG_CONN
SWDIO
SWCLK
Misc
R6 0R
C3 NC
JP4 Jumper_2_Bridged
Main MCU
U1
SN32F264S_X
VDDIO
VDD
VREG33
D+/PSCLK
D-/PSDATA
P3.5/BOOT
P3.6/SWCLK
P3.7/SWDIO
P3.8/RESET
VSS
P0.0/CT16B1_PWM0/CLKOUT
P0.1/CT16B1_PWM1
P0.2/CT16B1_PWM2
P0.3/CT16B1_PWM3
P0.4/CT16B1_PWM4/SCL0
P0.5/CT16B1_PWM5/SDA0
P0.10/CT16B1_PWM10
P0.11/CT16B1_PWM11
P0.12/CT16B1_PWM12
P0.13/CT16B1_PWM13
P0.14/CT16B1_PWM14
P0.15/CT16B1_PWM15
P1.5/MOSI0
P1.4/MISO0
P1.3/SCK0
P1.2/SEL0
P1.1/CT16B0_CAP0
P1.0
TP9 TestPoint
HP
Sheet: /
File: Mouse.kicad_sch
Title: HP 128 Laser Wired Mouse
Size: User
Date: 2026-03-03
Rev: 1.0
KiCad E.D.A. 9.0.3
Id: 1/1