Date, Time (UTC) 2021-07-27, 08:34

Flight ID: HEIGHT LOSS AFTER AN ENGINE FAILURE

from HOVER PIC/SIC:

ROTOR SPEED: 100% or 102%

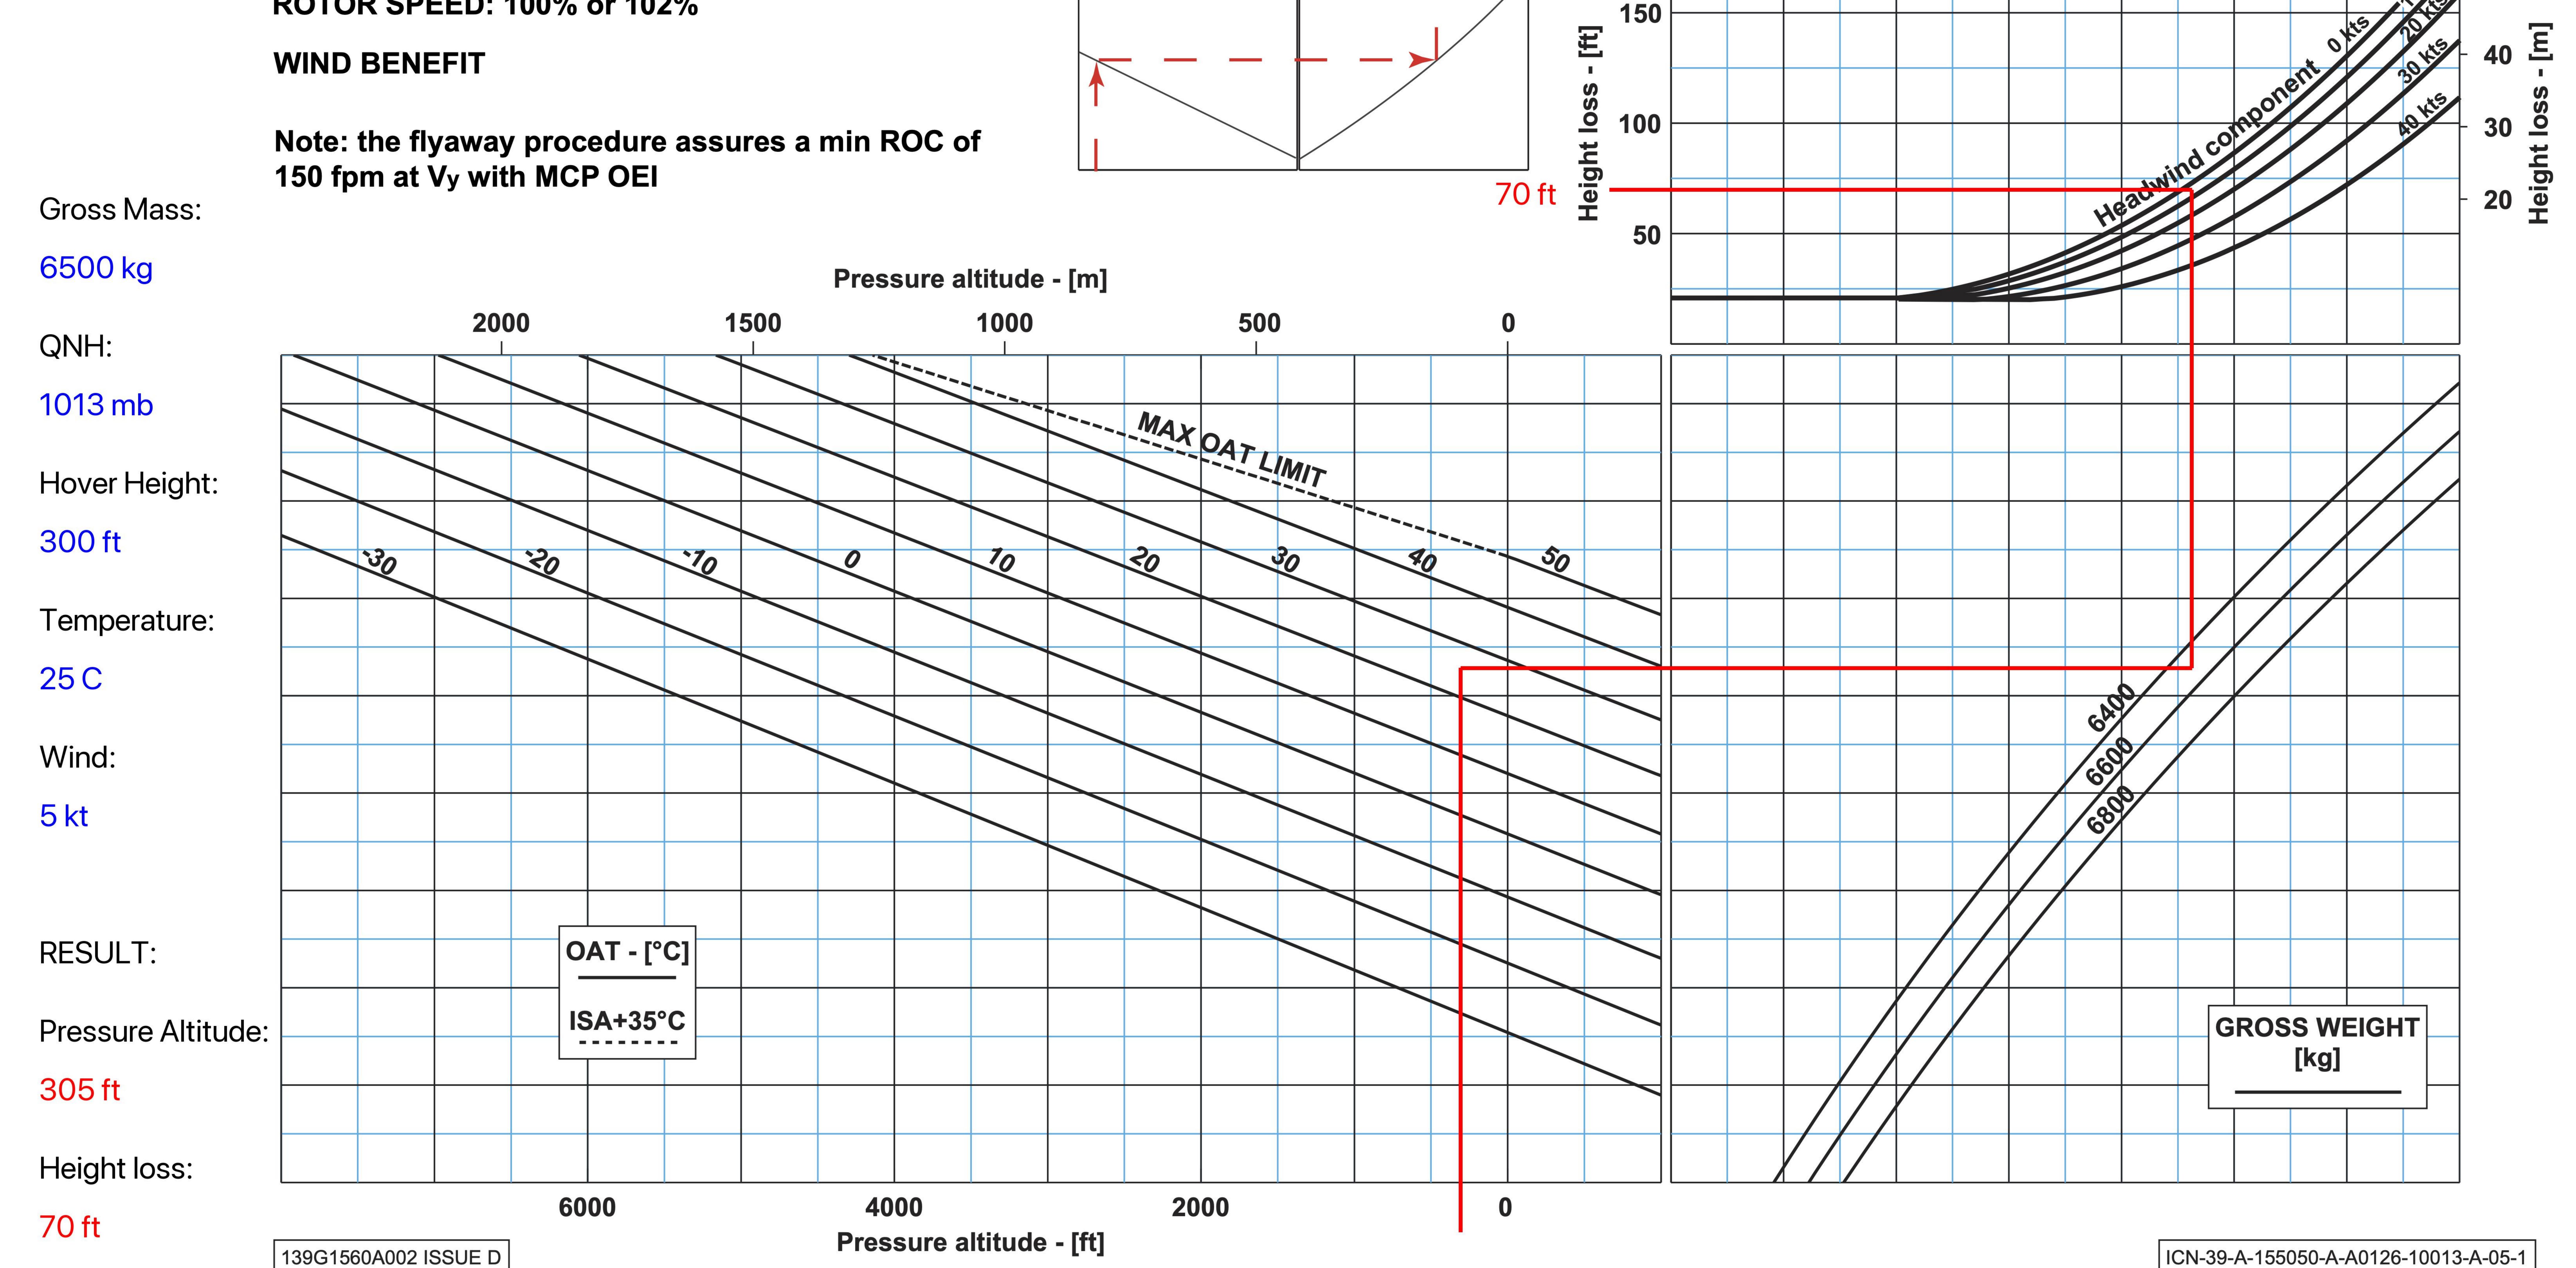


Figure 4-37 Height Loss During Flyaway Weights from 6400 kg to 6800 kg