1 2 3 4 5


Project: DM0260 Current Revision: R2M1E1


DM0260 Revision History:

Date	Revision	Reason for Change	Changes Implemented
12/30/2020	BG0250TG-> R0M0E0	ESD protection FPC connector stronger mechanics Outdated stackup	1) Added protection diodes to MIPI lines 2) Changed FFC with Molex 505278 series 3) Standarized 4L stackup
02/12/2020	R0M0E0 -> R1M1E1	Make PFC connectors type and pinout ArduCam standard so that camera modules will be compatible with DM1090FFC Library and components not common w/ Luxonis Master and some has bigger size footprint than needed	I)Changed IFC connectors to ArduCans standard pinout, updated all connections to the connectors. CBA can be connected with same side 26pin IFC to DM 1900 IFC 3. Updated all componets using LuxoniaMaster libraries 9. Removed unrecessary components from design (10k pull-ups on LDO enable connected directly) made downsizing of footprints for easier layout
02/12/2020	DM0250_R1M1E1 -> DM0260_R0M0E0	Add support for 33-pin standard FPC connector from Arducam Add support for multiple cameras by option to change the core voltage	1) Used 33-pin standard FPC connector for CCM 2) With populating either R4 or R5 you can select 1V05 or 1V2 core voltage respectively.
02/12/2020	DM0260_R0M0E0 -> DM0260_R1M0E0	Correct the error because of unused pads Add GND vias reducing the current loops	1) Corrected added pads on top-bottom layer 2) Added GND vias
11/04/2020	DM0260_R1M0E0-> DM0260_R2M1E1	1) Rotate text for 180 dag for better readability 2) Add holes for M12 camen holder (PV111-577) 3) Change the logo from old one to new one	1) Rotateed text for 180 deg for better readability 2) Added boles for M2 Camers holder (PV111-577) 3) Changed the logo from old one to new one


Title <i>DM026</i>	0		Luxonis Holding 1925 Harmony Park Drive	
Size: Tabloid	Number: D0000999	Revision:R2M1E1	Westminster, CO 80234	Cannot open file C:\Users\BrianLuxonis\
Date: 07/11/2022	Time: 16:51:33	Sheet 1 of 3	United States	

1 2 3 4 5

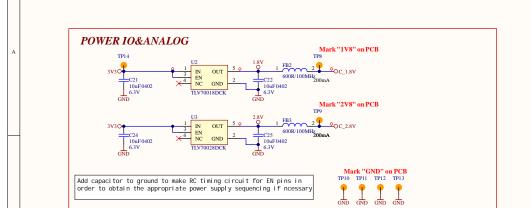

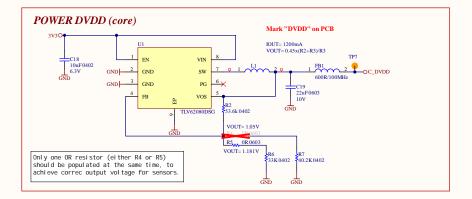

Power Supply Sequence & Requirements

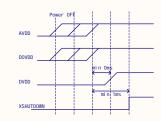

- 1. AVDD rising can occur before or after DOVDD rising as long as they are rising before XSHUTDOWN rising 2. XSHUTDOWN is pulled up after AVDD and DOVDD are stable 3. DVDD rises after DOVDD, but before XSHUTDOWN is pulled high

Title DM0260			Luxonis Holding 1925 Harmony Park Drive	
Size: Tabloid	Number: D0000999	Revision:R2M1E1	Westminster, CO 80234	Cannot open file C:\Users\BrianLuxonis\
D-4 07/11/2022	Times 16.51.22	Chart 2 at 2	Harian J. Canana	

