VISION PROFILE EXTRUSIONS

Sample Approval Form

Customer: Seaway
Attention: Zachary McCartney

Die #: 4683C
Description: 3-1/4" Operable Casement Frame

Rigid Colour: WH-136
Flex Colour: WH-137 (To be added) ok
Capstock Colour: N/A

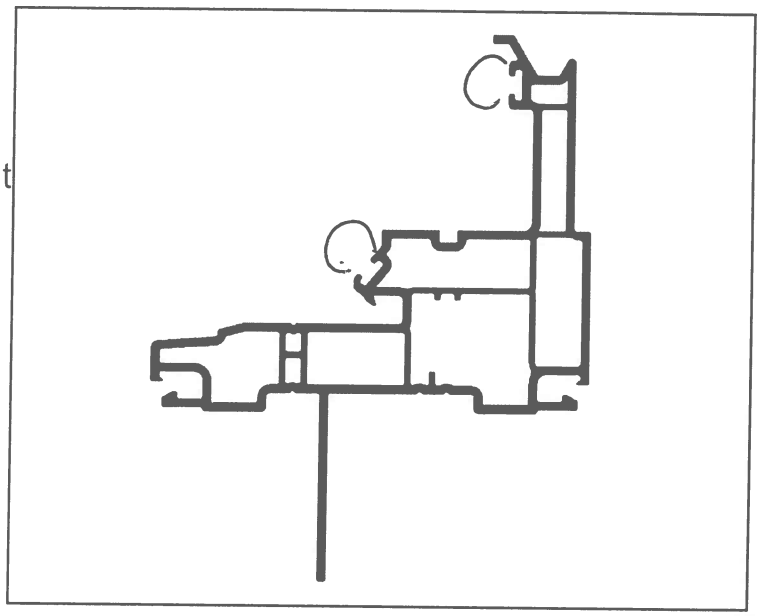

- ☐ Approved
- ☒ Approved with Comments
- ☐ Reject (Please Comment)
- ☐ Re-sample (Please Comment)

Comments: Comments emailed on 11/15/21, with response on 11/23/21. Though the sample did not have capstock, we are presuming this profile can be capstocked as shown on the prints.

Customer Signature:

Customer Name: Seaway Mfg. Corp.
Position: Engineering Mgr.
Signature: Zach McCartney
Date: 12/01/21

Vision Profile:

QC Manager: Tri Thai
Plant Manager: Pino Consolmagno

Notes:

(1) Please sign this form and return to your Customer Service Representative. Keep a copy for your records.
(2) Please sign a one foot sample. Return one (1) to your Customer Service Rep. and retain one (1) for your records.
(3) "Approved" indicated that the samples meet all the specifications required for your proper manufacturing and fabrication purposes. An "Approved" Status indicates Customer consent for Vision Profile to anodize and harden the tooling for production.
(4) "Approved with Comments" indicates that the sample does not meet all the specifications required for your proper manufacturing purposes, however, the issues can be addressed before production begins, without the need for re-sampling. Please consult with Vision Profile for any technical support you may need to address these issues.
(5) If samples are rejected, please explain in the comments section.
(6) If re-sampling is required, please explain in the comments section.

VISION PROFILE
EXTRUSIONS

Sample Approval Form

Customer: Seaway
Attention: Zachary McCartney

Die #: 4685C
Description: 3-1/4" Fixed Casement Frame

Rigid Colour: WH-136
Flex Colour: N/A
Capstock Colour: N/A

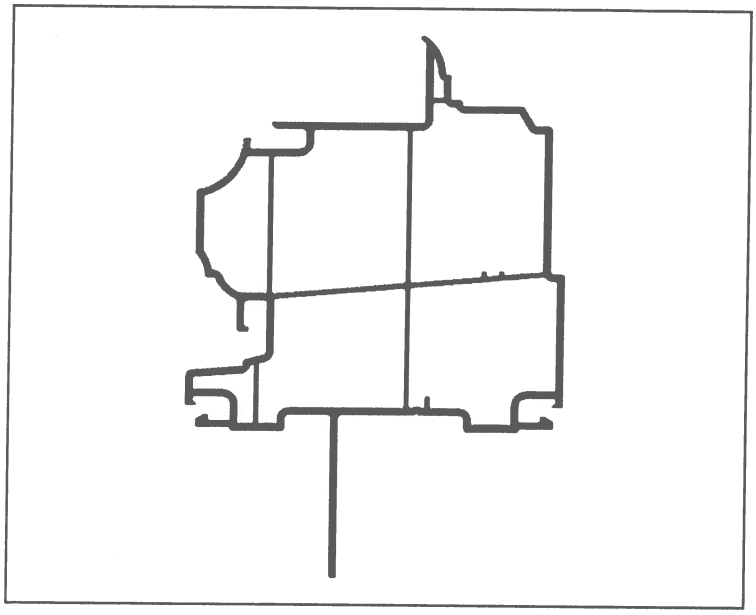

- ☐ Approved
- ☒ Approved with Comments
- ☐ Reject (Please Comment)
- ☐ Re-sample (Please Comment)

Comments: Comments emailed on 11/15/21, with response on 11/23/21. Though the sample did not have capstock, we are presuming this profile can be capstocked as shown on the prints.

Customer Signature:

Customer Name: Seaway Mfg. Corp.
Position: Engineering. Mgr.
Signature: Zach McCartney
Date: 12/01/21

Vision Profile:

QC Manager: Tri Thai
Plant Manager: Pino Consolmagno

Notes:

(1) Please sign this form and return to your Customer Service Representative. Keep a copy for your records.
(2) Please sign a one foot sample. Return one (1) to your Customer Service Rep. and retain one (1) for your records.
(3) "Approved" indicated that the samples meet all the specifications required for your proper manufacturing and fabrication purposes. An "Approved" Status indicates Customer consent for Vision Profile to anodize and harden the tooling for production.
(4) "Approved with Comments" indicates that the sample does not meet all the specifications required for your proper manufacturing purposes, however, the issues can be addressed before production begins, without the need for re-sampling. Please consult with Vision Profile for any technical support you may need to address these issues.
(5) If samples are rejected, please explain in the comments section.
(6) If re-sampling is required, please explain in the comments section.

Zachary Mccartney

From: Raymond Liang <RLiang@vpext.com>
Sent: Wednesday, November 24, 2021 12:11 PM
To: Zachary Mccartney
Cc: Tri Thai; Matthew Gentile; Pino Consolmagno; Jerry Mckay; Patrick Goodrich; 'Bob Gillespie'
Subject: RE: Review Test hits of Lighthouse Csmt with Integral fin

Hi Zach,

The fin varies a lot compared to the solid area and the tolerance is also accounting for punch slot locations.
The higher tolerance is to allow variation from either being too thick, too thin or too wavy.

We mostly see fins on the shorter side and on occasion we have to run it longer if its too thin.
I will add the +0.020 as an upper tolerance for them to monitor during production.

Regards

Raymond Liang
Quality Control
Vision Profile Extrusions Ltd.
300 Zenway Blvd, Woodbridge, ON. L4H 4M7
Cell: 416-837-2310

From: Zachary Mccartney <zmccartney@seawaymfg.com>
Sent: November-24-21 11:59 AM
To: Raymond Liang <RLiang@vpext.com>
Cc: Tri Thai <TThai@vpext.com>; Matthew Gentile <MGentile@vpext.com>; Pino Consolmagno <PConsolmagno@vpext.com>; Jerry Mckay <gmckay@seawaymfg.com>; Patrick Goodrich <pgoodrich@seawaymfg.com>; 'Bob Gillespie' <bob.gillespie@energifenestration.com>
Subject: RE: Review Test hits of Lighthouse Csmt with Integral fin
Importance: High

Raymond & Vision Team,

Good morning. Thank you for your response. Attached is the AutoCAD file for our foam inserts used in the csmt platform, and the screenshot below shows where they go.

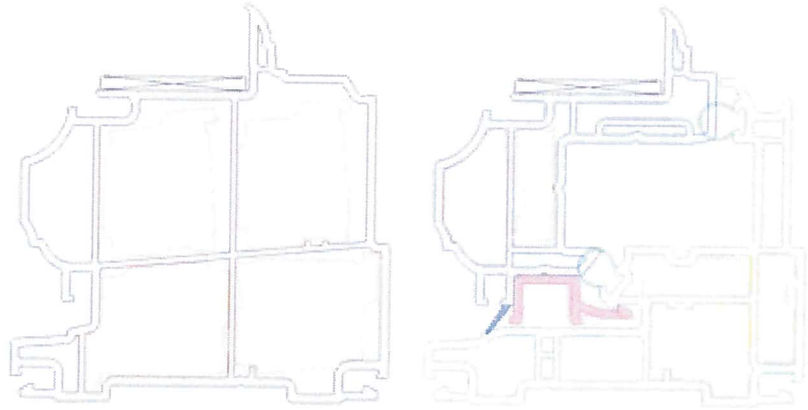

The only follow-up comment that I have concerns the tolerance on the fin. Though this is the first time we have had you extrude a frame for us with an integral fin, I honestly thought that the length tolerance would be your standard ±.010" (or at worse ±.012") since it is an external feature. Could you please explain why the tolerance band is so large? Is there any way to tighten this? My concern is our fixturing. We modified our saw fixturing such that we can run both the Amerivu and Lighthouse Csmt platform through the same saw. However, to be able to cut 4685C, we have max'ed out the blade stroke (as this is the tallest profile we have), and the modification for the fin forced us to cut into the base plate supporting our fixtures. The clearance groove is total of .030" past the nominal fin length, and we cannot make the clearance groove for the fin any deeper without adversely affecting the integrity of the base plate. I would honestly like to keep the fin length tolerance at no more than +.020". Is that possible?

Please advise,
Thank you,

Zachary J. McCartney; EIT
Engineering Dept.
Seaway Manufacturing Corp.
(814) 898-2255 ph.
(814) 899-5556 fx.

STATEMENT OF CONFIDENTIALITY: *The information contained in this electronic message and any attachments to this message are intended for the exclusive use of the addressee(s) and may contain confidential or privileged information. If you are not the intended recipient, please notify sender by replying to this email, or notify Seaway immediately at 814-898-2255, and destroy all copies of this message and any attachments.*

Seaway provides complimentary engineering specifications and design guidelines to its customers in accordance with our manufacturing criteria and internal quality control protocols. Seaway is a manufacturer and is not responsible for the installation of Seaway products nor for the actions, omissions, promises, warranties or representations of a Seaway dealer or vendor. Any deviation from Seaway-recommended specifications and installation guidelines are the sole and absolute responsibility of the dealer or customer and must comply with all applicable state/local building codes.

From: Raymond Liang <RLiang@vpext.com>
Sent: Tuesday, November 23, 2021 1:46 PM
To: Zachary Mccartney <zmccartney@seawaymfg.com>
Cc: Tri Thai <TThai@vpext.com>; Matthew Gentile <MGentile@vpext.com>; Pino Consolmagno <PConsolmagno@vpext.com>; Jerry Mckay <gmckay@seawaymfg.com>; Patrick Goodrich <pgoodrich@seawaymfg.com>; 'Bob Gillespie' <bob.gillespie@energifenestration.com>
Subject: RE: Review Test hits of Lighthouse Csmt with Integral fin

Hi Zach,

Apologies for the late reply as everyone has been a busy and it was not easy to get everyone together. We had to make sure what's needed to be done in cases of internal walls as it might involve re-cut of some internal parts which might delay this even further.

I have also attached sample approval forms for both these parts if they are in acceptable condition for production with the following changes below. Please have them completed and sent back to me.

1. Fixed Casement Frame (PWCMT) 4685
   a. Please note typical fin tolerances are +/- 0.050
   b. The tool was cut using the same program as the older tool, we noticed on the older no fin tool it was also short -0.020. We will try to improve this area and should also increase as we run & tool wears in.
   c. We will look into this during production but at a +/- 1 degree it is currently acceptable
   d. We will maintain internal webs as straight as possible, Can you provide us the foam dimensions so we can cut gauges to check these cavities during production.
   e. We can take a closer look and have them polish this area before anodizing which should correct this issue.

2. Operable casement frame (4683)
   a. Please note typical fin tolerances are +/- 0.050
   b. Ok
   c. I will make note of this area to be no less than 0.840 which is still working in your punch
   d. Matthew explained about the situation, the flex posts are being modified to accommodate the fin.
   e. We will continue to monitor with the foam gauges we made last time we ran into issues.

Regards,

Raymond Liang
Quality Control
Vision Profile Extrusions Ltd.
300 Zenway Blvd, Woodbridge, ON. L4H 4M7
Cell: 416-837-2310

From: Zachary Mccartney <zmccartney@seawaymfg.com>
Sent: November-15-21 2:30 PM
To: Raymond Liang <RLiang@vpext.com>
Cc: Tri Thai <TThai@vpext.com>; Matthew Gentile <MGentile@vpext.com>; Pino Consolmagno <PConsolmagno@vpext.com>; Jerry Mckay <gmckay@seawaymfg.com>; Patrick Goodrich <pgoodrich@seawaymfg.com>
Subject: FW: Review Test hits of Lighthouse Csmt with Integral fin

Raymond and Vision Team,

Good afternoon. Here is my review of the two new casement profiles with fin. Let me know if you have any questions.

1. PWCMT (4685):
   a. Fin is correct length and properly located off the front face of the profile.
   b. The height of the profile (without fin) was -.025" under nominal, and the overall height with fin was -.040" under nominal.
   c. The horizontal wall of the glazing pocket is pitched back towards the glazing tower by a degree.

d. I realize that internal webs & cavities are always difficult. With that said I wanted to comment on what I found. I numbered the five primary cavities, and cavity #1 was undersized, as well as one dimension from cavity #4. With that said, the foam inserts did fit in all cavities. This is simply something to keep an eye on.
e. I noticed that the web btwn cavity 1 & 5 has a defect. The vertical web fractured from the corner to the weep slot when punched. However, even on the unpunched piece I was noticed this web was already cracked. So I think there is an existing hairline fracture from the extruding process.

2. Operable frame (4683):
   a. Fin is correct length and properly located off the front face of the profile.
   b. Overall exterior dims look good.
   c. The cavity in the tower is a little undersized. This is important b/c there is a support horn we slide into the cavity for punching the operator & locks. With that said, this sample did fit on the dies.
   d. I noticed the coex bulb was not extruded on these samples. For production runs we will need to ensure that this coex bulb is applied to both places indicated in the drawing.
   e. Though the vertical webs are a little skewed btwn cavities 1-3, the foam inserts fit, and these are comparable to what we see now.

Matthew,
Do you know when we should expect the sample you and Pat discussed with the capstock? I believe this was simply to see and color match your "bronze".

Thank you,

Zachary J. McCartney; EIT
Engineering Dept.
Seaway Manufacturing Corp.
(814) 898-2255 ph.
(814) 899-5556 fx.

STATEMENT OF CONFIDENTIALITY: *The information contained in this electronic message and any attachments to this message are intended for the exclusive use of the addressee(s) and may contain confidential or privileged information. If you are not the intended recipient, please notify sender by replying to this email, or notify Seaway immediately at 814-898-2255, and destroy all copies of this message and any attachments.*

Seaway provides complimentary engineering specifications and design guidelines to its customers in accordance with our manufacturing criteria and internal quality control protocols. Seaway is a manufacturer and is not responsible for the installation of Seaway products nor for the actions, omissions, promises, warranties or representations of a Seaway dealer or vendor. Any deviation from Seaway-recommended specifications and installation guidelines are the sole and absolute responsibility of the dealer or customer and must comply with all applicable state/local building codes.