

# Property Risk Evaluation Report

Address Surveyed:  
[ADDRESS]

[Site Photo]

**[PROPERTY] Development**

3 July 2025

| <b>[PROPERTY] Development</b>        |                                                                                                                                                                                                                                                                                                                                                                                                                                            |
|--------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Location Surveyed</b>             | [ADDRESS]                                                                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>Surveyed By</b>                   | [NAME], Senior Consultant, Marsh Advisory<br>[NAME], Consultant, Marsh Advisory                                                                                                                                                                                                                                                                                                                                                            |
| <b>Survey Dates</b>                  | <b>24 June 2025</b>                                                                                                                                                                                                                                                                                                                                                                                                                        |
| <b>Date Last Surveyed</b>            | 21 February 2022                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <b>Site Contacts / In Attendance</b> | <u>[PROPERTY]</u><br>Ms. [NAME], Head, Property Management (SBC)<br>Mr. [NAME], Manager, Property Management (SBC)<br>Mr. [NAME], Senior Centre Manager ([MANAGEMENT])<br>Mr. [NAME], Manager, Operations ([MANAGEMENT])<br>Mr. [NAME], Head of Operations ([MANAGEMENT])<br>Mr. [NAME], Head of M&E ([MANAGEMENT])<br>Mr. [NAME], Residence Manager (ETC)<br><br><u>Marsh</u><br>Ms. [NAME], Assistant Client Manager, Corporate Services |
| <b>File Name &amp; Rev.</b>          | <b>[PROPERTY] – PRE Report 2025</b>                                                                                                                                                                                                                                                                                                                                                                                                        |

Marsh is part of the family of Marsh McLennan Companies, including Guy Carpenter, Mercer, and the Oliver Wyman Group (including Lippincott and NERA Economic Consulting)

This document and any recommendations, analysis, or advice provided by Marsh (collectively, the "Marsh Analysis") are intended solely for the entity identified as the recipient herein ("you"). This document contains proprietary, confidential information of Marsh and may not be shared with any third party, including other insurance producers, without Marsh's prior written consent. Any statements concerning actuarial, tax, accounting, or legal matters are based solely on our experience as insurance brokers and risk consultants and are not to be relied upon as actuarial, accounting, tax, or legal advice, for which you should consult your own professional advisors. Any modeling, analytics, or projections are subject to inherent uncertainty, and the Marsh Analysis could be materially affected if any underlying assumptions, conditions, information, or factors are inaccurate or incomplete or should change. The information contained herein is based on sources we believe reliable, but we make no representation or warranty as to its accuracy. Marsh shall have no obligation to update the Marsh Analysis and shall have no liability to you or any other party with regard to the Marsh Analysis or to any services provided by a third party to you or Marsh. Marsh makes no representation or warranty concerning the application of policy wordings or the financial condition or solvency of insurers or reinsurers. Marsh makes no assurances regarding the availability, cost, or terms of insurance coverage. All decisions regarding the amount, type or terms of coverage shall be your ultimate responsibility. While Marsh may provide advice and recommendations, you must decide on the specific coverage that is appropriate for your particular circumstances and financial position. By accepting this report, you acknowledge and agree to the terms, conditions, and disclaimers set forth above.

Copyright © 2025 Marsh LLC. All rights reserved.

# Contents

|                                                 |    |
|-------------------------------------------------|----|
| 1. Purpose and Scope .....                      | 1  |
| 2. Executive Summary.....                       | 2  |
| 3. Opportunities for Improvement .....          | 4  |
| • Risk Assessment Matrix (RAM) .....            | 4  |
| • Management Programs .....                     | 6  |
| • Physical Protection .....                     | 9  |
| • Past Opportunities for Improvement.....       | 12 |
| 4. Risk Quality Ratings and Comments .....      | 14 |
| 5. Management Programs .....                    | 28 |
| • Management Program Comments .....             | 31 |
| 6. Construction .....                           | 32 |
| • Construction Narrative .....                  | 32 |
| • Compartmentalization and Fire Divisions ..... | 33 |
| 7. Occupancy, Hazards, and Utilities .....      | 34 |
| • Occupancy .....                               | 34 |
| • Utilities and Infrastructure .....            | 40 |
| 8. Fire Protection .....                        | 42 |
| • Automatic Sprinkler Protection.....           | 42 |
| • Special Extinguishing Systems .....           | 42 |
| • Water Supply Details .....                    | 43 |
| • Pump Flow Test Data .....                     | 44 |
| • Wet and Dry Risers .....                      | 45 |
| • Manual Firefighting Features .....            | 46 |

|                                           |    |
|-------------------------------------------|----|
| • Other Manual Firefighting Comments..... | 46 |
| • Fire Alarm Monitoring .....             | 46 |
| 9. External Exposures.....                | 47 |
| • Location Details .....                  | 47 |
| • Boundary Exposures .....                | 47 |
| • Natural Catastrophe Exposures .....     | 48 |
| 10. Security .....                        | 51 |
| 11. Business Interruption .....           | 53 |
| Appendix A: Site Photos .....             | 54 |

## Section 1

# Purpose and Scope

The purpose of this PRE report is to assist [PROPERTY] with the implementation of a Risk Management Strategy to prioritize risk improvements and mitigation strategies for their property, [PROPERTY] Development. It is made on request by Marsh Broking Office. The analysis carried out is based on data provided by a physical review of the location. The report will inform existing and/or prospective insurance markets of physical conditions at this location. This report is based upon conditions and practices observed and information made available to Marsh Risk Consulting at the time of our survey. The report should be used for risk management and insurance placement purposes only.

The visit comprised of an inspection of main area of the site including the electrical rooms, fire pump room, common areas etc.

Our visits will use National Fire Protection Association (NFPA), FM Global and local guidelines as technical references. Each site visit included the following activity:

- Physical tours of occupied spaces to observe storage practices, related property hazards and identify areas not in accordance with the above guidelines.
- A review of existing loss prevention programs, procedures, reports and documentation to verify status in accordance with corporate standards and practices.
- Interview relevant staff to gain a perspective on loss prevention programs and implementation to understand issues facing local management.
- An exit meeting with management to achieve agreement with our conclusions and to develop a recommended action plan.

This survey also included a review of administrative controls such as inspection, testing, and maintenance of fire protection systems and equipment; impairments to these systems; and fire emergency planning.

No physical tests were witnessed during the survey.

## Section 2

# Executive Summary

[PROPERTY] is an integrated mixed-use development which features a 35-storey Grade A premium office tower, a 47-storey tower housing a hotel (Level 1 – 22) and luxury residential spaces (Level 23 – 45), four heritage buildings and four low-rise podium blocks incorporating [club], F&B and retail spaces and 3 basement carpark. The site area for the development is 34,959 m<sup>2</sup> and the total Gross Floor Area (GFA) is 153,067.15 m<sup>2</sup>

The 2 towers, 4 podium blocks, 4 heritage blocks are generally constructed of non-combustible materials. For the 35-storey office tower, the building is generally constructed with reinforced concrete structures (floor plate, beams, columns) with concrete flat roof. The exterior walls of the tower is made of full glazed glass curtain wall with thickness of 33.52mm and aluminum cladding. The surface of the glass curtain is coated with low emissivity coating silver and metal-oxide film, giving the building a blue colour. The interior walls are of masonry construction and internal partition walls in the office spaces are made of mainly drywall gypsum boards. The 47-storey hotel and residences tower is constructed of similar materials to the office tower. The building is generally constructed with reinforced concrete structures (floor plate, beams, columns) with concrete flat roof. The external walls are similarly glass curtain walls while the internal partitions are of masonry walls or drywall gypsum boards. The podium blocks and heritage blocks are generally all constructed of reinforced concrete structures with various exterior walls.

Sprinkler protection is provided throughout the offices, retail spaces and hotel with the exception of electrical rooms and risers. FM200 fire protection system installed at the server room on Level 3 of [SPACE] and Basement 1 of [PROPERTY] which are activated by cross zone smoke detectors. Gaseous fire protection system as also installed within tenants' office area within [PROPERTY]. Wet chemical suppression system is installed under the kitchen hoods within hotel kitchen and tenant's kitchen and maintained by hotel facility management team and tenants' third party contractors respectively. Other means of fire protection include wet/dry risers, internal fire hoses, portable fire extinguishers and manual break glass call points installed at strategic locations throughout the buildings as per local code requirements. Buildings are equipped with dedicated fire alarm systems which are monitored centrally at a 24/7-manned fire command centre, via a decentralized alarm monitoring (DECAM) stations which have direct connections to the local fire brigade.

There are 8 diesel generator sets, 5 at the generator room on Basement 1 of [PROPERTY] and 3 at the generator room on P04 (Utility Block) roof. Each generator set has a 1000L day tank. There are leak detectors for each day tank which will send a signal to the FCC if any leaks are detected. There are two 20,000L underground diesel storage tanks at Basement 3 of the [PROPERTY] which are estimated to be topped up every 2 years. The diesel is pumped automatically via the diesel transfer pumps on Basement 2 to top up the day tanks when required. The storage of the flammable liquid complies with the Petroleum and Flammable Material Storage License governed under [LOCATION] authority, [LOCATION] Civil Defense Force. The signal of the diesel tank level sensor is sent to BMS and monitored 24/7.

There is 24/7 security presence and CCTV camera coverage for both internal and external areas. A high standard of risk management programs has been established, including a mature safety management system, formal procedures, self-inspection programs,

comprehensive preventive maintenance program for building utility and fire protection equipment.

Natural catastrophe for the sites are generally low, with the exception of lightning which is adequately addressed via the provision of lightning protection and earthing systems. Building exterior exposures are generally low; the building is situated within non-industrial areas with good spatial separation provided between site boundaries and neighboring third party properties. Overall risk rating for the site is considered to be good risk of its class.

Opportunities for Improvement were submitted to improve the quality of risk control and loss prevention at the surveyed facilities.

Marsh Advisory would like to thank [PROPERTY]'s team for their involvement and assistance in the 1-day survey.

### **Changes Since Previous Survey**

Not applicable.

### **Planned Changes / Projects**

Not applicable.

### **Past Losses**

Not applicable.

## Section 3

# Opportunities for Improvement

Opportunities for Improvement (OFI) are suggested to mitigate risks. They are intended to create value and manage risk exposures while maintaining relevance to your business objectives. The Opportunities for Improvement addresses either specifically identified Risks to Manage<sup>SM</sup> or they are suggested as general sound risk management to implement at the location.


Prioritization of OFI's are classified in line with the following indicative Risk Assessment Matrix (RAM). The relative risk associated with each OFI is measures the estimated consequences of the damage versus the likelihood of occurrence.

## Risk Assessment Matrix (RAM)


| Consequences   |               |            |            |            |              |
|----------------|---------------|------------|------------|------------|--------------|
| Likelihood     | Insignificant | Minor      | Moderate   | Major      | Catastrophic |
| Almost Certain | Priority 2    | Priority 2 | Priority 1 | Priority 1 | Priority 1   |
| Likely         | Priority 3    | Priority 2 | Priority 2 | Priority 1 | Priority 1   |
| Possible       | Priority 4    | Priority 3 | Priority 2 | Priority 1 | Priority 1   |
| Unlikely       | Priority 4    | Priority 4 | Priority 3 | Priority 2 | Priority 1   |
| Very Rare      | Priority 4    | Priority 4 | Priority 3 | Priority 2 | Priority 2   |

A graphical summary of the current opportunities for improvement are shown below:


OFI COUNT BY STATUS

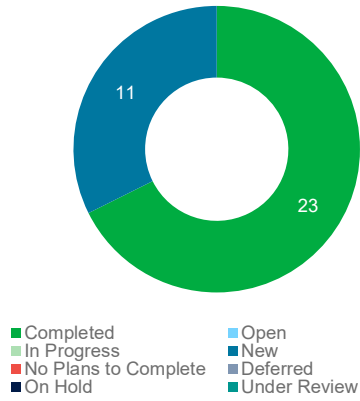


OFI COUNT BY CATEGORY

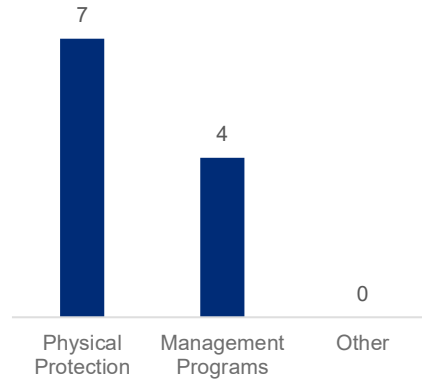

OFI COUNT BY PRIORITY

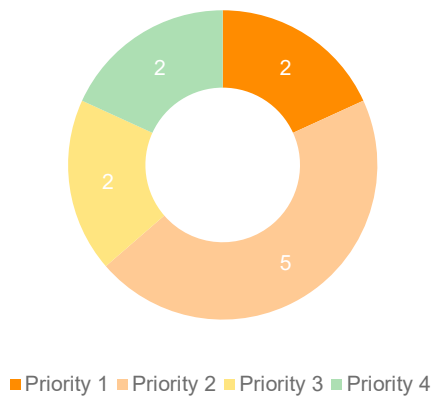

OFI COUNT BY EFFORT OF IMPLEMENTATION

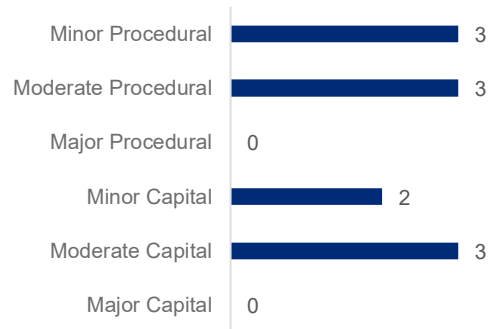

## Management Programs

| 2025-01                  |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Hot Work Permit – to include clearance for combustibles and firewatch requirement |                 |
|--------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------|-----------------|
| Status                   | New                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | Issue Date                                                                        | 24-Jun -2025    |
| Priority                 | Priority 1                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Type                                                                              | Hot Work Permit |
| OFI Issued By            | Marsh                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |                                                                                   |                 |
| Description              | <p>As per NFPA 51B Chapter 5, the existing hot work permit system can be enhanced by incorporating the following precautions:</p> <ul style="list-style-type: none"> <li>• Checks should be made to ensure that any combustibles within 11 meters of the hot work area are removed. If removal is not possible or practical, then the hot work should be separated from the rest of the area with suitable non-combustible shields or covers.</li> <li>• The permit form should incorporate the requirement for a constant fire watch to be maintained throughout the duration of the hot work. Moreover, the hot work area and its vicinity should be monitored for any sign of fire in its incipient stage for at least 1 hour after the completion of the established fire watch period.</li> <li>• The fire watch should sign off at the end of the hot work after the monitoring of the fire has been completed to facilitate responsibility and accountability.</li> </ul> |                                                                                   |                 |
| Observation              | <p>During the review of the hot work checklist on the Permit-to-Work system, it was noted that one of the checks is to verify that there are no combustibles at the designated hot work area. However, the clearance distance allowed was 3m, lower than the recommended 11m. There was also no requirement for fire watch during and after the hot work.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |                                                                                   |                 |
| Effort of Implementation | Moderate Procedural                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |                                                                                   |                 |

| 2025-02       |                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Emergency Response Plan (ERP) to include EV Charger and PV Panels Fire Scenario |                        |
|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------|------------------------|
| Status        | New                                                                                                                                                                                                                                                                                                                                                                                                                                               | Issue Date                                                                      | 24-Jun -2025           |
| Priority      | Priority 4                                                                                                                                                                                                                                                                                                                                                                                                                                        | Type                                                                            | Pre-Emergency Planning |
| OFI Issued By | Marsh                                                                                                                                                                                                                                                                                                                                                                                                                                             |                                                                                 |                        |
| Description   | <p>To allow the Emergency Response Team to better respond to fires at the EV charger and PV panels, these scenarios can be included in the ERP together with the actions to be taken. Examples of actions to take for fire at EV charger:</p> <ul style="list-style-type: none"> <li>• Activate emergency stop button near the EV charger (Do not attempt to unplug the charging cable)</li> <li>• Pull nearby fire alarm and evacuate</li> </ul> |                                                                                 |                        |

|                                 |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |                   |                                                |
|---------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|------------------------------------------------|
| 2025-02                         | Emergency Response Plan (ERP) to include EV Charger and PV Panels Fire Scenario                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |                   |                                                |
|                                 | <ul style="list-style-type: none"> <li>• Call 995 and report the incident with details such as make/model of charger and vehicle, location of electrical panels etc.</li> <li>• <i>Reference from NFPA 70 – Electrical Safety, NFPA 1: Fire Code, NFPA 1620 – Pre-Incident Planning for Fire Department Response and NFPA 855 Standard for the Installation of Stationary Energy Storage Systems.</i></li> </ul> <p>Examples of actions to take for fire at PV panels:</p> <ul style="list-style-type: none"> <li>• If accessible and trained, to shut off the AC disconnect and DC disconnect</li> <li>• Pull nearby fire alarm and evacuate</li> <li>• Call 995 and report the incident with details such as solar system location/type, inverter and disconnect locations, etc.</li> <li>• <i>Reference from NFPA 70 – Electrical Safety, NFPA 1: Fire Code, NFPA 1620 – Pre-Incident Planning for Fire Department Response and NFPA 855 Standard for the Installation of Stationary Energy Storage Systems.</i></li> </ul> |                   |                                                |
| <b>Observation</b>              | During the review of the existing ERP, it was observed that the scenario of fire originating at EV charger and PV panel is not included.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |                   |                                                |
| <b>Effort of Implementation</b> | Minor Procedural                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |                   |                                                |
| 2025-03                         | Ensure Tenancy Reports are provided to Landlord                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |                   |                                                |
| <b>Status</b>                   | New                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | <b>Issue Date</b> | 24-Jun-2025                                    |
| <b>Priority</b>                 | Priority 4                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | <b>Type</b>       | Fire Protection System Maintenance and Testing |
| <b>OFI Issued By</b>            | Marsh                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |                   |                                                |
| <b>Description</b>              | <p>The maintenance reports for the equipment below should be obtained from tenants to ensure the required service is being carried out timely.</p> <ol style="list-style-type: none"> <li>1. Wet chemical suppression system</li> <li>2. Gas leak detectors</li> <li>3. Servicing of gaseous protection systems</li> </ol>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |                   |                                                |
| <b>Observation</b>              | It was noted that the requirements to install and maintain the wet chemical suppression system and gas leak detectors, and to service the gaseous protection system are written on the tenancy agreement. However, it was stated that copies of the service reports are not maintained.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |                   |                                                |
| <b>Client Response</b>          | Pending client response                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |                   |                                                |
| <b>Effort of Implementation</b> | Moderate Procedural                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |                   |                                                |

| 2025-04                  |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Formalize Fire Protection System Impairment Programme |                            |
|--------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------|----------------------------|
| Status                   | Existing                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Issue Date                                            | 24-Jun-2025                |
| Priority                 | Priority 2                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | Type                                                  | Fire Protection Impairment |
| OFI Issued By            | Marsh                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |                                                       |                            |
| Description              | <p>Fire protection systems in place are critical features to detect, suppress, and contain fire. Impairment of these systems can compromise its ability to protect occupants, property, and continuity of the operations.</p> <p>As such, checks should be in place prior to impairment of any fire protection system to ensure the necessity of the impairment. The team should work with the fire contractor to reduce the number of fire alarm system isolations to only required isolations and have a proper tracking system for all fire alarm isolations.</p> |                                                       |                            |
| Observation              | <p>During the visit to the FCC room, it was reported that there are a total of 1451 isolations.</p> <p><i>[Photo]</i></p> <p><i>System used to track isolation of fire protection system</i></p>                                                                                                                                                                                                                                                                                                                                                                     |                                                       |                            |
| Effort of Implementation | Moderate Procedural                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |                                                       |                            |

| 2025-05       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | To improve management of fuel day tanks of diesel generator sets |                                    |
|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------|------------------------------------|
| Status        | New                                                                                                                                                                                                                                                                                                                                                                                                                                                              | Issue Date                                                       | 24-Jun-2025                        |
| Priority      | Priority 2                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Type                                                             | Management of back up power supply |
| OFI Issued By | Marsh                                                                                                                                                                                                                                                                                                                                                                                                                                                            |                                                                  |                                    |
| Description   | <p>Generator sets are critical as they provide reliable backup electrical power in situations where the main power supply is unavailable. Thus, it is important to ensure that the fuel level in the day tanks of diesel generator sets are maintained to support operation during emergencies.</p> <p>As the fuel tank is manually topped up, a procedure can be implemented to ensure that the fuel levels are checked regularly and maintained above 75%.</p> |                                                                  |                                    |

|                                 |                                                                                                                                                                                       |
|---------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>2025-05</b>                  | <b>To improve management of fuel day tanks of diesel generator sets</b>                                                                                                               |
| <b>Observation</b>              | <p>During the visit to the generator set at P04, the fuel level of the day tank was noted to be less than 25%.</p> <p><i>[Photo]</i></p> <p><i>Fuel level for day tank at P04</i></p> |
| <b>Effort of Implementation</b> | Minor Procedural                                                                                                                                                                      |

## Physical Protection

|                                 |                                                                                                                                                                                            |                   |                                  |
|---------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|----------------------------------|
| <b>2025-06</b>                  | <b>Lock Open Hosereel Firewater Valve</b>                                                                                                                                                  |                   |                                  |
| <b>Status</b>                   | New                                                                                                                                                                                        | <b>Issue Date</b> | 24-Jun-2025                      |
| <b>Priority</b>                 | Priority 3                                                                                                                                                                                 | <b>Type</b>       | Fire Protection System Operation |
| <b>OFI Issued By</b>            | Marsh                                                                                                                                                                                      |                   |                                  |
| <b>Description</b>              | The valves on the hosereel firewater supply line should be locked open to prevent tampering or accidental closing of the valves.                                                           |                   |                                  |
| <b>Observation</b>              | <p>During the site visit to the L43 hosereel pump room at [PROPERTY], it was observed that the valves were not locked open.</p> <p><i>[Photo]</i></p> <p><i>L43 Hosereel Pump Room</i></p> |                   |                                  |
| <b>Effort of Implementation</b> | Minor Capital                                                                                                                                                                              |                   |                                  |

| 2025-07                  |                                                                                                                                                                                                                                                                                                                             | Install smoke detector within lift motor room |                        |
|--------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------|------------------------|
| Status                   | New                                                                                                                                                                                                                                                                                                                         | Issue Date                                    | 24-Jun-2025            |
| Priority                 | Priority 3                                                                                                                                                                                                                                                                                                                  | Type                                          | Fire Protection System |
| OFI Issued By            | Marsh                                                                                                                                                                                                                                                                                                                       |                                               |                        |
| Description              | It is beneficial to install smoke detector within unmanned rooms such as the lift motor room in the [PROPERTY]. These rooms are enclosed and fires starting within the room may go unnoticed. Having smoke detectors will allow for early detection and response to contain the fire and prevent the spread to other areas. |                                               |                        |
| Observation              | <p>During the site visit to L44 and L47 lift motor room at [PROPERTY], it was observed that there is no smoke detectors installed within the room.</p> <p><i>[Photo]</i></p> <p><i>[Photo]</i></p> <p><i>L44 and L47 Lift Motor Room</i></p>                                                                                |                                               |                        |
| Effort of Implementation | Moderate Capital                                                                                                                                                                                                                                                                                                            |                                               |                        |

| 2025-08                  |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Improve housekeeping in electrical rooms |              |
|--------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------|
| Status                   | New                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Issue Date                               | 22-Apr-2025  |
| Priority                 | Priority 2                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Type                                     | Housekeeping |
| OFI Issued By            | Marsh                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |                                          |              |
| Description              | Storage of combustible materials in the L22M LV switch room and MDF room should be removed.                                                                                                                                                                                                                                                                                                                                                                                                        |                                          |              |
| Observation              | <p>The storage of combustible materials can increase the fire loading in the room. In the event of a fire, this may result in a higher-than-expected loss. During the site visit, it was observed that there was storage of tables, tools, cardboard boxes and other items in the Level 22M LV switch room and MDF room.</p> <p><i>[Photo]</i></p> <p><i>Storage of items in L22M LV Switchroom at [PROPERTY]</i></p> <p><i>[Photo]</i></p> <p><i>[Photo]</i></p> <p><i>Level 22M MDF Room</i></p> |                                          |              |
| Effort of Implementation | Minor Procedural                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |                                          |              |

| 2025-09                  |                                                                                                                                                                                                                                                                                                              | Ensure room integrity for fire rated room |                        |
|--------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------|------------------------|
| Status                   | New                                                                                                                                                                                                                                                                                                          | Issue Date                                | 24-Jun-2025            |
| Priority                 | Priority 2                                                                                                                                                                                                                                                                                                   | Type                                      | Fire Protection System |
| OFI Issued By            | Marsh                                                                                                                                                                                                                                                                                                        |                                           |                        |
| Description              | Rooms with fire rated construction such as LV switch rooms should be properly sealed with fire stop material. This will ensure that the integrity of the fire compartment is maintained and the effectiveness of the fire rating.                                                                            |                                           |                        |
| Observation              | <p>During the site visit to L22M MDF Room at [PROPERTY] and L32M LV switch room at [PROPERTY], it was observed that the cable penetration was improperly sealed.</p> <p><i>[Photo]</i></p> <p>L22M [PROPERTY] MDF Room</p> <p><i>[Photo]</i></p> <p><i>[Photo]</i></p> <p>L32M [PROPERTY] LV switch room</p> |                                           |                        |
| Effort of Implementation | Moderate Capital                                                                                                                                                                                                                                                                                             |                                           |                        |

| 2025-10       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Replace Concealed Sprinkler Cover Plates |                        |
|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|------------------------|
| Status        | New                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Issue Date                               | 24-Jun-2025            |
| Priority      | Priority 2                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Type                                     | Fire Protection System |
| OFI Issued By | Marsh                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |                                          |                        |
| Description   | <p>The cover plates on the concealed sprinkler heads should be installed to ensure that the sprinklers are protected from dust and debris and to ensure accurate thermal response. If the sprinkler cover plate has dropped, it would also be ideal to check if the sprinkler heads are installed correctly. Cover plates should also not be painted over as this will affect the temperature rating of the cover plate which may result in the delayed activation of the sprinkler in times of fire.</p> <p>As per CP52 Annex C.4, it is recommended to carry out a quarterly visual check (from ground level) of the sprinklers. Carrying out this check will allow for such issues to be quickly identified and rectified.</p> |                                          |                        |
| Observation   | <p>During the site visit, it was observed that there were some sprinkler cover plates that have dropped off and some sprinkler cover plates that were painted over.</p> <p><i>[Photo]</i></p> <p><i>[Photo]</i></p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |                                          |                        |

|                                 |                                                   |
|---------------------------------|---------------------------------------------------|
| <b>2025-10</b>                  | <b>Replace Concealed Sprinkler Cover Plates</b>   |
|                                 | <i>L32 Reading Room at [PROPERTY]<br/>[Photo]</i> |
|                                 | <i>L32 Lift Lobby</i>                             |
| <b>Effort of Implementation</b> | Moderate Capital                                  |

| 2025-11                  | To Cap and Adjust Nozzle Heads for Wet Chemical Suppression System                                                                                                                                                                                                                                                                                                                                                                                                                       |            |                        |
|--------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------------|
| Status                   | New                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Issue Date | 24-Jun-2025            |
| Priority                 | Priority 1                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Type       | Fire Protection System |
| OFI Issued By            | Marsh                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |            |                        |
| Description              | <p>The nozzle caps on the nozzles of the wet chemical suppression system should be properly capped to prevent the buildup of oil and grime on the nozzle openings. The buildup may affect the spray pattern of the nozzles when activated which will reduce its effectiveness in fire extinguishing.</p> <p>The nozzles should also be directly pointed at the cooking area to ensure that the wet chemical is discharged at the cooking area, else, its purpose will not be served.</p> |            |                        |
| Observation              | <p>During the site visit to the L1 Hotel Kitchen, it was found that several of the nozzles for the wet chemical suppression system were not capped or had missing caps. Some nozzles were also found to be pointed away from the cooking area.</p> <p><i>[Photo]</i><br/><i>Hotel All Day Dining Kitchen</i></p>                                                                                                                                                                         |            |                        |
| Effort of Implementation | Minor Capital                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |            |                        |

## Past Opportunities for Improvement

| Rec No.             | Description                                                | Status    |
|---------------------|------------------------------------------------------------|-----------|
| <b>MA SBD-22-01</b> | Enhance Fire Protection System Impairment Procedures       | Completed |
| <b>MA SBD-22-02</b> | To Verify Smoke Detectors Installed Are Compliance to CP   | Completed |
| <b>MA SBD-22-03</b> | Ensure Fire Compartment Integrity – Seal Cable Penetration | Completed |

| Rec No.             | Description                                                                                                                          | Status    |
|---------------------|--------------------------------------------------------------------------------------------------------------------------------------|-----------|
| <b>MA SBD-22-04</b> | Concealed Sprinkler Head Maintenance                                                                                                 | Completed |
| <b>MA SBA-22-05</b> | Ensure Fault & Isolation are tracked and promptly resolved                                                                           | Completed |
| <b>MA SBA-22-06</b> | Consider BCP for Critical Utility Failure                                                                                            | Completed |
| <b>MA SBA-22-07</b> | Secure Control Valve for Sprinkler Pump Sensing Line                                                                                 | Completed |
| <b>MA SBA-22-08</b> | Ensure Minimum 500mm Clearance From Sprinkler Head                                                                                   | Completed |
| <b>MA SBA-22-09</b> | Maintenance of Nozzles for Kitchen Hood Fire Protection                                                                              | Completed |
| <b>2016-1</b>       | Cover battery terminals (LV Switchroom 2, L32M)                                                                                      | Completed |
| <b>2016-2</b>       | Fire compartmentalization between LV Switchroom 1 and switchroom 2 (L32M, Office Tower)                                              | Completed |
| <b>2016-3</b>       | Reinstate fire stopping                                                                                                              | Completed |
| <b>2016-4</b>       | Repair Smoke Stop Lobby Door (L21M, Office Tower)                                                                                    | Completed |
| <b>2016-5</b>       | Smoke Detector Covered (L21, Office Tower)                                                                                           | Completed |
| <b>2016-6</b>       | Relocate overflow pipe (L21M, Office Tower)                                                                                          | Completed |
| <b>2016-7</b>       | Remove flammable liquids (B1, Consumer LV Switchroom – Office)                                                                       | Completed |
| <b>2016-8</b>       | Prevent unauthorized motorcycles parking and obstructing the doors to the Transformer Room. (B1, Consumer Transformer Room – Common) | Completed |
| <b>2016-9</b>       | Recommendation for Distribution Boards door enclosures (B2 carpark)                                                                  | Completed |
| <b>2016-10</b>      | Recommendation for Hot Works Permit                                                                                                  | Completed |
| <b>2016-11</b>      | Remove storages within Sprinkler Control Valve (C14, L1)                                                                             | Completed |
| <b>2016-12</b>      | Depth Markers for Dive Pool (NCO Building, L1)                                                                                       | Completed |
| <b>2016-13</b>      | Concealed sprinkler cap plastered cover (Gym, L18)                                                                                   | Completed |
| <b>2016-14</b>      | Recommendation for the Linen Collection Room                                                                                         | Completed |


## Section 4

# Risk Quality Ratings and Comments


| Main Category                       | Current Score | Potential Score |
|-------------------------------------|---------------|-----------------|
| External Exposure                   | 9             | 9               |
| Fire Protection                     | 7             | 9               |
| Occupancy Hazards                   | 8             | 8               |
| Construction                        | 7             | 8               |
| Water Supply                        | 10            | 10              |
| Surveillance                        | 7             | 7               |
| Management Programs                 | 6             | 9               |
| <b>Location Risk Quality Score</b>  | <b>72.4</b>   | <b>86.0</b>     |
| <b>Location Risk Quality Rating</b> | <b>B</b>      | <b>A</b>        |

| Rating Legend |
|---------------|
| A: 85 to 100  |
| B: 70 to 84   |
| C: 51 to 69   |
| D: 36 to 50   |
| E: 0 to 35    |


RQR SCORE BENCHMARKING

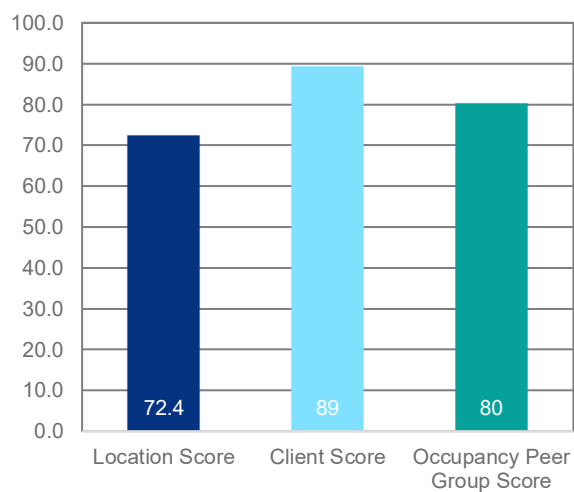

CURRENT RISK QUALITY SCORE VERSUS % POTENTIAL

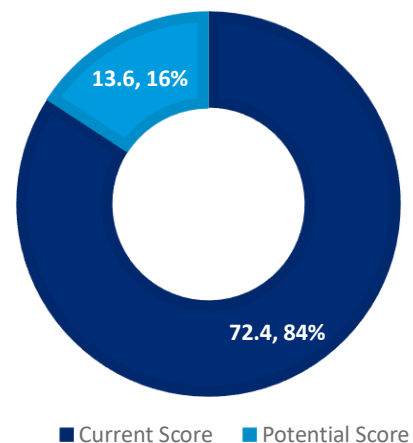

RISK QUALITY RATING CATEGORY SUMMARY

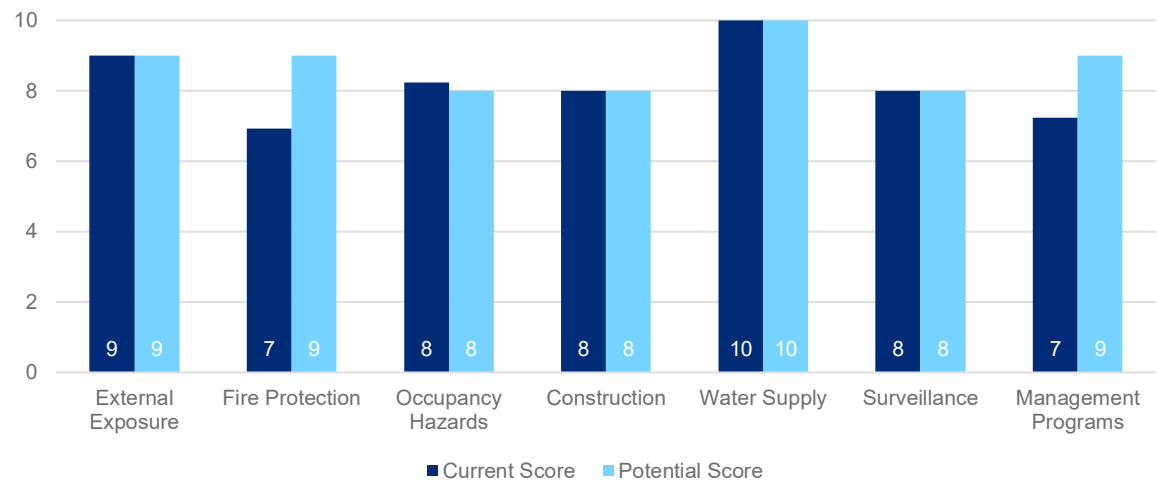

Risk Quality Rating Comments

The positive points from the visit are the following:

- Buildings were constructed of fire resistive construction materials
- The buildings are fully sprinklered except for residential areas, electrical rooms and risers.
- Water monitoring system installed in the open-air podium area and activated via IR/UV sensors provided in the area.
- Wet chemical suppression system is in place within hotel kitchen and tenants' commercial kitchen.
- Gaseous fire suppression system is installed within tenants' area and in IT Server Room at Level 3 [SPACE] and at Basement 1 of [PROPERTY] (hotel).
- Preventive maintenance programmes in place for fire protection and detection equipment.
- Good housekeeping observed for most areas visited.

## Section 5

# Loss Estimates ([PROPERTY] Consortium)

The Loss Estimates presented here are believed to be reasonable, based on industry experience, events postulated, and information provided by the client. The calculation of Loss Expectancies is based on the review of building construction, operations, fire protection systems, and fire protection features at the time of our assessment. The estimates are further based on conditions observed at the time of the visit. By their nature, these estimates contain some element of subjectivity. Accordingly, the estimates cannot be taken as absolutes and could be exceeded due to changes in physical conditions on site, or the initiating event or escalation being more severe than anticipated within the boundaries of the estimate.

All damage and loss potential figures presented pertain exclusively to primary property damage, associated contents damage, and associated business interruption recovery time loss, caused directly by (fire or explosion) as defined in our Loss Estimate.

## Values ([PROPERTY] Consortium)

| Date of Values: 2025                                    |         | Currency: SGD                                                                                 |         |
|---------------------------------------------------------|---------|-----------------------------------------------------------------------------------------------|---------|
| Property Damage (PD) Values                             |         | Business Interruption (BI)<br>Time Element (TE) Values<br><i>Indemnity Period (36 months)</i> |         |
| Office                                                  | [VALUE] | Office (Gross Profit)                                                                         | [VALUE] |
| Retail                                                  | [VALUE] | Retail (Gross Profit)                                                                         | [VALUE] |
| Hotel                                                   | [VALUE] | Hotel (Gross Profit)                                                                          | [VALUE] |
| Total Reported Site PD                                  |         | Total Reported Site TE                                                                        | [VALUE] |
| Total Insurable Values (TIV) / Total Sums Insured (TSI) |         | [VALUE]                                                                                       |         |

These values are provided by the client unless otherwise specified. Unless stated differently the PD values are assumed to be Replacement Cost Values (RCV), and the financial numbers are deemed to be for a fiscal year.

## Loss Estimate Definitions

| Level            | Definition                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
|------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Level I</b>   | <p><u>Primary Protection Systems are functioning and manual firefighting available</u></p> <p>A loss event in which damage is based on the nature of hazards and construction factors, and where:</p> <ul style="list-style-type: none"> <li>• All fire protection systems are in service and functioning as designed.</li> <li>• Full facility Industrial Fire Brigade (Or Plant Emergency Organization) and Municipal Fire Department response expected.</li> <li>• Credit is given to all properly maintained fire barriers up to their design duration rating</li> <li>• Construction features function as designed.</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>Level II</b>  | <p><u>Primary Protection Systems are not functioning, Manual firefighting response only</u></p> <p>A level II Loss Event is one which occurs when:</p> <ul style="list-style-type: none"> <li>• The fire protection system protection the area with the largest PD / BI potential is impaired or is rendered inoperative or ineffective due to the nature of the event. Adjacent fire protection systems are presumed operational unless rendered inoperative or ineffective due to structural failure. Same applies for the use of special extinguishing systems.</li> <li>• Credit can be given for adequate manual emergency response, defined as: <ul style="list-style-type: none"> <li>— A responding organization that is trained to address the hazards of the facility being evaluated.</li> <li>— Can arrive on site within a reasonable time of being notified to be effective in reducing or limiting impact.</li> <li>— Has up to date preplans or emergency response plans for the facility.</li> </ul> </li> <li>• Credit given to minimum adequately maintained (including fire doors and fire penetrations) 3 hour rated walls where the combustible loading is light to ordinary, structural failure is not expected, and roof assembly is a listed or approved noncombustible.</li> <li>• Combustible roof construction (including combustible or unknown metal deck assemblies) results in a contiguous structure loss.</li> </ul> <p>Damage may be limited to the area where the impaired protection system is located and the nearby surroundings or may extend to the nearest adequate separation or properly designed and approved construction cutoffs, depending on site conditions.</p> |
| <b>Level III</b> | <p><u>Fire Protection Systems are not functioning and no manual firefighting response</u></p> <p>A level III Loss Event is one which occurs when:</p> <ul style="list-style-type: none"> <li>• All fire protection systems throughout the entire site or facility are impaired.</li> <li>• No credit is given for manual emergency response.</li> <li>• Damage is limited only by adequate separation and/or free-standing 4-hours rated firewalls or equivalent. (Equivalencies must be well defined and proven.)</li> <li>• Combustible roof construction (including combustible or unknown metal deck assemblies) results in a contiguous structure loss.</li> </ul> <p>The size of this loss can approach the value of the buildings of origin or an entire facility, depending on site layout.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |

## Property – Level I Loss Estimate

### Normal Loss Expectancy

| Definition         | Definition: Primary Protection Systems are functioning and manual firefighting available                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
|--------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Scenario</b>    | The NLE scenario is a fire originating from Basement 1 HT switchroom due to fault in electrical fixture/equipment, improperly managed hot work activity, arson, etc. The area is protected by smoke detectors and an alarm will be sent to the FCC room. It is assumed that the fire will spread throughout the HT switchboards within the room. The fire will subsequently be controlled by the CERT members and extinguished by the responding fire brigade.                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>Assumptions</b> | <p>Direct fire damage, smoke damage, and fire water damage from the sprinklers and fire brigade are not expected to impact beyond the Basement 1 HT switchroom. The PD NLE will include the total loss of the HT switchboards (ie. Restoration is not possible resulting in total replacement), in addition to some smoke/thermal and fire water damage. The PD NLE for building is estimated to be in the range of SGD [VALUE].</p> <p>It will take about 1 month for clean-up and fire investigation and structural review of the building by local authorities. The estimated replacement time for the HT switchboards including procurement, installation and commissioning will be up to 5 months. As power is distributed to all transformers from this HT switchroom, the whole development will not be operable for up to 6 months.</p> |

| Property Damage                   | Value (SGD) | % Damage | Property Damage (SGD) |
|-----------------------------------|-------------|----------|-----------------------|
| Reported Site PD                  | [VALUE]     | -        | [VALUE]               |
| <b>Total Property Damage Loss</b> |             |          | <b>[VALUE]</b>        |

| Business Interruption | Duration | Duration Units | % Impacted | BI Loss (SGD) |
|-----------------------|----------|----------------|------------|---------------|
| Gross Profit          | 6        | months         | 100%       | [VALUE]       |

|                                             |  |  |  |                |
|---------------------------------------------|--|--|--|----------------|
| <b>Total Business Interruption Loss</b>     |  |  |  | <b>[VALUE]</b> |
| <b>Total Level I Property Loss Estimate</b> |  |  |  | <b>[VALUE]</b> |

## Property – Level II Loss Estimate

### Probable Maximum Loss

| Definition         | Definition: Primary Protection Systems are not functioning, Manual firefighting response only                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
|--------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Scenario</b>    | <p>The PML scenario is a fire originating from one of the hotel guest rooms on Level 11 due to electrical faults, arson, etc after operating hours.</p> <p>In the absence of sprinkler protection and lack of 3 hour rated fire doors / shutters (as per PML definition), the fire will reach a fully grown state and spread throughout Level 11 and Level 12. The fire will subsequently be controlled by the CERT members and extinguished by the responding fire brigade.</p>                                                                                                                                                                                                                                                                                                                                                                              |
| <b>Assumptions</b> | <p>It is assumed that the fire damage will be limited to Level 11 and 12 of [PROPERTY]. However, smoke damage will affect the floors above while water damage from firefighting efforts will affect the floors. The PD PML for the building is estimated to be in the range of SGD [VALUE].</p> <p>It will take about 3 months for clean-up, investigation and structural review of the building by local authorities. It will take up to 9 months for full reinstatement of the damaged / affected areas resulting in a total of 12 months of recovery time. The hotel will not be able to operate during this period while retail and offices will be operable. However, as this may result in significantly lower foot traffic and disruptions to the retail business during the reparation works, a rental rebate may have to be provided to tenants.</p> |

| Property Damage                   | Value (SGD) | % Damage | Property Damage (SGD) |
|-----------------------------------|-------------|----------|-----------------------|
| Office                            | [VALUE]     | 0%       | -                     |
| Retail                            | [VALUE]     | 0%       | -                     |
| Hotel                             | [VALUE]     | 28.4%    | [VALUE]               |
| <b>Total Property Damage Loss</b> |             |          | <b>[VALUE]</b>        |

| Business Interruption | Duration | Duration Units | % Impacted | BI Loss (SGD) |
|-----------------------|----------|----------------|------------|---------------|
| Office (Gross Profit) | -        | months         | -          | -             |
| Retail (Gross Profit) | 12       | months         | 10%        | [VALUE]       |

| Business Interruption                 | Duration | Duration Units | % Impacted | BI Loss (SGD) |
|---------------------------------------|----------|----------------|------------|---------------|
| Hotel (Gross Profit)                  | 12       | months         | 100%       | [VALUE]       |
| Total Business Interruption Loss      |          |                |            | [VALUE]       |
| Total Level II Property Loss Estimate |          |                |            | [VALUE]       |

## Property – Level III Loss Estimate

### Maximum Foreseeable Loss

| Definition  | Definition: Fire Protection Systems are not functioning and no manual firefighting response                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
|-------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Scenario    | <p>The MFL scenario is a fire originating from one of the hotel guest rooms on Level 11 due to electrical faults, arson, etc after operating hours.</p> <p>As per MFL Loss Estimate definition, fire protection systems for the buildings are impaired and no credit is given to manual emergency response. However, public fire brigade in [LOCATION] is very reliable and typical respond time is 10 minutes. Instead of no manual emergency response, the local fire brigade is assumed to be severely delayed.</p> <p>The fire is expected to spread to the whole hotel block and some neighbouring blocks such as P02 (Padang Terrace) and P02 (Writer's Corner). However, [PROPERTY] is not expected to be affected due to the distance between the two towers.</p>                                                             |
| Assumptions | <p>MFL is estimated to be 70% of the total sum insured of the hotel building and 10% of the retail blocks. The hotel block and surrounding blocks are expected to suffer from fire damage, smoke damage and water damage. The foundation and some framework should not be affected by the fire. However, the other items within the building should be significantly damaged.</p> <p>It will take about 6 months for the clean-up, investigation and structural review of the building by local authorities, and up to 12 months for full reinstatement of the damaged areas. The hotel and affected retail units will not be operable for 18 months in total. However, as this may result in significantly lower foot traffic and disruptions to the retail business during, a rental rebate may have to be provided to tenants.</p> |

| Property Damage            | Value (SGD) | % Damage | Property Damage (SGD) |
|----------------------------|-------------|----------|-----------------------|
| Office                     | [VALUE]     | 0%       | -                     |
| Retail                     | [VALUE]     | 10%      | [VALUE]               |
| Hotel                      | [VALUE]     | 70%      | [VALUE]               |
| Total Property Damage Loss |             |          | [VALUE]               |

| Business Interruption            | Duration | Duration Units | % Impacted | BI Loss (SGD) |
|----------------------------------|----------|----------------|------------|---------------|
| Office (Gross Profit)            | -        | months         | -          | -             |
| Retail (Gross Profit)            | 18       | months         | 10%        | [VALUE]       |
| Hotel (Gross Profit)             | 18       | months         | 100%       | [VALUE]       |
| Total Business Interruption Loss |          |                |            | [VALUE]       |

|                                        |         |
|----------------------------------------|---------|
| Total Level III Property Loss Estimate | [VALUE] |
|----------------------------------------|---------|

# Loss Estimates (MCST)

The Loss Estimates presented here are believed to be reasonable, based on industry experience, events postulated, and information provided by the client. The calculation of Loss Expectancies is based on the review of building construction, operations, fire protection systems, and fire protection features at the time of our assessment. The estimates are further based on conditions observed at the time of the visit. By their nature, these estimates contain some element of subjectivity. Accordingly, the estimates cannot be taken as absolutes and could be exceeded due to changes in physical conditions on site, or the initiating event or escalation being more severe than anticipated within the boundaries of the estimate.

All damage and loss potential figures presented pertain exclusively to primary property damage, associated contents damage, and associated business interruption recovery time loss, caused directly by (fire or explosion) as defined in our Loss Estimate.

## Values (MCST)

| Date of Values: 2025                                    |             | Currency: SGD                                                                                                                            |         |
|---------------------------------------------------------|-------------|------------------------------------------------------------------------------------------------------------------------------------------|---------|
| Property Damage (PD) <u>Values</u>                      |             | Business Interruption (BI)<br>Loss of profit as a result of interruption<br>to insured's business<br><i>Indemnity Period (36 months)</i> |         |
| Main MC (Common Common)                                 | [VALUE]     | Main MC Common-Common Property                                                                                                           | [VALUE] |
| Sub-MC No. 1 (Retail)                                   | [VALUE]     | Sub-MC No. 1 (Retail)                                                                                                                    | [VALUE] |
| Sub-MC No. 2 (Residential)                              | [VALUE]     | Sub-MC No. 3 (Office)                                                                                                                    | [VALUE] |
| Sub-MC No. 3 (Office)                                   | 223,[VALUE] |                                                                                                                                          |         |
| Total Reported Site PD                                  | [VALUE]     | Total Reported Site BI                                                                                                                   | [VALUE] |
| Total Insurable Values (TIV) / Total Sums Insured (TSI) |             |                                                                                                                                          | [VALUE] |

These values are provided by the client unless otherwise specified. Unless stated differently the PD values are assumed to be Replacement Cost Values (RCV), and the financial numbers are deemed to be for a fiscal year.

## Loss Estimate Definitions

| Level            | Definition                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
|------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Level I</b>   | <p><u>Primary Protection Systems are functioning and manual firefighting available</u></p> <p>A loss event in which damage is based on the nature of hazards and construction factors, and where:</p> <ul style="list-style-type: none"> <li>• All fire protection systems are in service and functioning as designed.</li> <li>• Full facility Industrial Fire Brigade (Or Plant Emergency Organization) and Municipal Fire Department response expected.</li> <li>• Credit is given to all properly maintained fire barriers up to their design duration rating</li> <li>• Construction features function as designed.</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>Level II</b>  | <p><u>Primary Protection Systems are not functioning. Manual firefighting response only</u></p> <p>A level II Loss Event is one which occurs when:</p> <ul style="list-style-type: none"> <li>• The fire protection system protection the area with the largest PD / BI potential is impaired or is rendered inoperative or ineffective due to the nature of the event. Adjacent fire protection systems are presumed operational unless rendered inoperative or ineffective due to structural failure. Same applies for the use of special extinguishing systems.</li> <li>• Credit can be given for adequate manual emergency response, defined as: <ul style="list-style-type: none"> <li>— A responding organization that is trained to address the hazards of the facility being evaluated.</li> <li>— Can arrive on site within a reasonable time of being notified to be effective in reducing or limiting impact.</li> <li>— Has up to date preplans or emergency response plans for the facility.</li> </ul> </li> <li>• Credit given to minimum adequately maintained (including fire doors and fire penetrations) 3 hour rated walls where the combustible loading is light to ordinary, structural failure is not expected, and roof assembly is a listed or approved noncombustible.</li> <li>• Combustible roof construction (including combustible or unknown metal deck assemblies) results in a contiguous structure loss.</li> </ul> <p>Damage may be limited to the area where the impaired protection system is located and the nearby surroundings or may extend to the nearest adequate separation or properly designed and approved construction cutoffs, depending on site conditions.</p> |
| <b>Level III</b> | <p><u>Fire Protection Systems are not functioning and no manual firefighting response</u></p> <p>A level III Loss Event is one which occurs when:</p> <ul style="list-style-type: none"> <li>• All fire protection systems throughout the entire site or facility are impaired.</li> <li>• No credit is given for manual emergency response.</li> <li>• Damage is limited only by adequate separation and/or free-standing 4-hours rated firewalls or equivalent. (Equivalencies must be well defined and proven.)</li> <li>• Combustible roof construction (including combustible or unknown metal deck assemblies) results in a contiguous structure loss.</li> </ul> <p>The size of this loss can approach the value of the buildings of origin or an entire facility, depending on site layout.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |

## Property – Level I Loss Estimate

### Normal Loss Expectancy

| Definition  | Definition: Primary Protection Systems are functioning and manual firefighting available                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |  |  |  |
|-------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--|--|--|
| Scenario    | <p>The NLE scenario is a fire originating from Basement 1 HT switchroom due to fault in electrical fixture/equipment, improperly managed hot work activity, arson, etc.</p> <p>The area protected by smoke detectors and an alarm will be sent to the FCC room. It is assumed that the fire will spread throughout the HT switchboards within the room. The fire will subsequently be controlled by the CERT members and extinguished by the responding fire brigade.</p>                                                                                                                                                                                                                                                                                                                                                                       |  |  |  |
| Assumptions | <p>Direct fire damage, smoke damage, and fire water damage from the sprinklers and fire brigade are not expected to impact beyond the Basement 1 HT switchroom. The PD NLE will include the total loss of the HT switchboards (ie. Restoration is not possible resulting in total replacement), in addition to some smoke/thermal and fire water damage. The PD NLE for building is estimated to be in the range of SGD [VALUE].</p> <p>It will take about 1 month for clean-up and fire investigation and structural review of the building by local authorities. The estimated replacement time for the HT switchboards including procurement, installation and commissioning will be up to 5 months. As power is distributed to all transformers from this HT switchroom, the whole development will not be operable for up to 6 months.</p> |  |  |  |

| Property Damage            | Value (SGD) | % Damage | Property Damage (SGD) |
|----------------------------|-------------|----------|-----------------------|
| Reported Site PD           | [VALUE]     | -        | [VALUE]               |
| Total Property Damage Loss |             |          | [VALUE]               |

| Business Interruption            | Duration | Duration Units | % Impacted | BI Loss (SGD) |
|----------------------------------|----------|----------------|------------|---------------|
| Gross Revenue                    | 6        | months         | 100%       | [VALUE]       |
| Total Business Interruption Loss |          |                |            | [VALUE]       |

|                                      |  |  |  |         |
|--------------------------------------|--|--|--|---------|
| Total Level I Property Loss Estimate |  |  |  | [VALUE] |
|--------------------------------------|--|--|--|---------|

## Property – Level II Loss Estimate

### Probable Maximum Loss

| Definition         | Definition: Primary Protection Systems are not functioning, Manual firefighting response only                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
|--------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Scenario</b>    | <p>The PML scenario is a fire originating from one of the office units on Level 20 due to electrical faults, arson, etc after operating hours.</p> <p>In the absence of 3 hour rated fire doors / shutters (as per PML definition), the fire will reach a fully grown state and spread throughout Level 20 and Level 21 via continuity of combustibles, etc. The fire will subsequently be controlled by the CERT members and extinguished by the responding fire brigade.</p>                                                                                                                                                                                                                                                                                                                                                   |
| <b>Assumptions</b> | <p>It is assumed that the fire damage will be limited to Level 20 and 21. However, smoke damage will affect the floors above while water damage from firefighting efforts will affect the floors below. The PD PML is estimated to be in the range of SGD [VALUE].</p> <p>It will take about 3 months for clean-up, investigation and structural review of the building by local authorities. It will take up to 9 months for full reinstatement of the damaged / affected areas resulting in a total of 12 months of recovery time. Floors not affected by the fire/smoke/water damage can continue operation with the damaged floors being properly boarded off. As this may result in significantly lower foot traffic and disruptions to the retail business during, a rental rebate may have to be provided to tenants.</p> |

| Property Damage                       | Value (SGD) | % Damage | Property Damage (SGD) |
|---------------------------------------|-------------|----------|-----------------------|
| <b>Main MC<br/>(Common Common)</b>    | [VALUE]     | -        | -                     |
| <b>Sub-MC No. 1<br/>(Retail)</b>      | [VALUE]     | -        | -                     |
| <b>Sub-MC No. 2<br/>(Residential)</b> | [VALUE]     | -        | -                     |
| <b>Sub-MC No. 3<br/>(Office)</b>      | [VALUE]     | 30%      | [VALUE]               |
| <b>Total Property Damage Loss</b>     |             |          | <b>[VALUE]</b>        |

| Business Interruption                 | Duration | Duration Units | % Impacted | BI Loss (SGD) |
|---------------------------------------|----------|----------------|------------|---------------|
| Main MC Common-Common Property        | -        | months         | -          | -             |
| Sub-MC No. 1 (Retail)                 | 12       | months         | 10%        | [VALUE]       |
| Sub-MC No. 3 (Office)                 | 12       | months         | 50%        | [VALUE]       |
| Total Business Interruption Loss      |          |                |            | [VALUE]       |
| Total Level II Property Loss Estimate |          |                |            | [VALUE]       |

## Property – Level III Loss Estimate

### Maximum Foreseeable Loss

| Definition  | Definition: Fire Protection Systems are not functioning and no manual firefighting response                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
|-------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Scenario    | <p>The MFL scenario is a fire originating from one of the office units on Level 20 due to electrical faults, arson, etc after operating hours.</p> <p>As per MFL Loss Estimate definition, fire protection systems for the buildings are impaired and no credit is given to manual emergency response. However, public fire brigade in [LOCATION] is very reliable and typical respond time is 10 minutes. Instead of no manual emergency response, the local fire brigade is assumed to be severely delayed.</p> <p>The fire is expected to spread throughout the office tower and to neighbouring buildings such as P04 (Utility Block) and C01 ([PROPERTY] Quarter). Due to the distance, the residential block will not be affected.</p> |
| Assumptions | <p>MFL is estimated to be 70% of the total sum insured for the office tower and 10% of the total sum insured for common-common and retail. Most of the building is expected to suffer from fire damage, smoke damage and water damage. The foundation and some framework should not be affected by the fire. However, the other items within the building should be significantly damaged.</p> <p>It will take about 6 months for the clean-up, investigation and structural review of the building by local authorities, and up to 12</p>                                                                                                                                                                                                   |

| Definition | Definition: Fire Protection Systems are not functioning and no manual firefighting response                   |
|------------|---------------------------------------------------------------------------------------------------------------|
|            | months for full reinstatement of the damaged areas. The building will not be operable for 18 months in total. |

| Property Damage               | Value (SGD) | % Damage | Property Damage (SGD) |
|-------------------------------|-------------|----------|-----------------------|
| Main MC<br>(Common Common)    | [VALUE]     | 10%      | [VALUE]               |
| Sub-MC No. 1<br>(Retail)      | [VALUE]     | 10%      | [VALUE]               |
| Sub-MC No. 2<br>(Residential) | [VALUE]     | -        | -                     |
| Sub-MC No. 3<br>(Office)      | [VALUE]     | 70%      | [VALUE]               |
| Total Property Damage Loss    |             |          | [VALUE]               |

| Business Interruption                  | Duration | Duration Units | % Impacted | BI Loss (SGD) |
|----------------------------------------|----------|----------------|------------|---------------|
| Main MC Common-Common Property         | 12       | months         | 10%        | [VALUE]       |
| Sub-MC No. 1<br>(Retail)               | 12       | months         | 10%        | [VALUE]       |
| Sub-MC No. 3<br>(Office)               | 12       | months         | 50%        | [VALUE]       |
| Total Business Interruption Loss       |          |                |            | [VALUE]       |
| Total Level III Property Loss Estimate |          |                |            | [VALUE]       |

## Section 6

# Management Programs

Our site visit, interviews and review of information provided leads us to the following maturity assessment of Management Programs in place to manage the risks at the location.

| Program Category                      | Maturity   | Comments                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
|---------------------------------------|------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Building Maintenance                  | Embedded   | The buildings were noted to be in good condition. Structural inspection of the buildings is conducted once every 5 years by appointed professional civil engineer with report submitted to the local authority, BCA.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
| Electrical Maintenance                | Embedded   | <p>Planned preventive maintenance programme with predictive elements included. Inspection, testing and maintenance are conducted by third party electrical contractors and Licensed Electrical Workers (LEWs). Maintenance activity includes, but not limited to the following:</p> <ul style="list-style-type: none"> <li>• Biennial partial discharge testing for HT systems and transformers;</li> <li>• Biennial shutdown maintenance for HT and LT switchgears</li> <li>• Biennial IR thermography scanning for electrical risers</li> <li>• Biennial dissolved gas analysis for all transformers</li> <li>• Load test done on diesel generator set during shutdown</li> <li>• Twice monthly no-load test on diesel generator set</li> </ul> |
| Equipment Maintenance                 | Embedded   | Maintenance of equipment such as air handling units are being carried out by in house contractors as per manufacturer's recommendation.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| Fire Protection Impairment Management | Formalized | <p>Under office and residence team, there is fire impairment programme in place to ensure that the required personnel are notified of the impairment and the proper approval is obtained prior to approval. It was noted that the hotel has their own programme. However, it was not verified during the visit.</p> <p>OFls have been raised to enhance the fire protection impairment management programme.</p>                                                                                                                                                                                                                                                                                                                                  |

|                                                         |                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
|---------------------------------------------------------|--------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Fire Protection System Maintenance &amp; Testing</b> | <b>Formalized</b>  | <p>A service contract with Aim Fire Systems &amp; Engineering Pte Ltd is available for the servicing of fire protection equipment. Detailed inspection, testing and maintenance of fire protection systems as follows:</p> <ul style="list-style-type: none"> <li>• Monthly functional test of fire pumps</li> <li>• Monthly servicing of fire pumps</li> <li>• Annual water flow test of hydrants</li> <li>• Annual testing of control valves</li> <li>• Quarterly testing of fire detectors (100% covered annually)</li> </ul> <p>An OFI has been raised to improve the fire protection system maintenance programme.</p>               |
| <b>Hazardous Materials Handling</b>                     | <b>Embedded</b>    | <p>There are two 20,000L underground diesel tank supplies the eight 1,000L diesel generator set day tanks for each of the generator sets – 5 at the generator room on Basement 1 of [PROPERTY] and 3 at the generator room on P04 (Utility Block) roof. The storage of the diesel strictly complies with the Petroleum and Flammable Materials License governed by [LOCATION] Authority, [LOCATION] Civil Defence Force (SCDF). Additionally, there are leak detectors for each generator set to quickly alert the team when there is any leak detected.</p> <p>An OFI has been raised to carry out maintenance on the leak detector.</p> |
| <b>Housekeeping</b>                                     | <b>Established</b> | Housekeeping is generally good in most areas inspected.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <b>Hot Work Permit System</b>                           | <b>Established</b> | <p>Formal hot work permit and procedures have been established. After the required checks are done, the permit will be approved by appointed personnel before job commencement.</p> <p>An OFI has been raised to improve on some of the checks required before the hot work is approved.</p>                                                                                                                                                                                                                                                                                                                                              |
| <b>Management of Change</b>                             | <b>Embedded</b>    | Management of change usually involves the different stakeholders with risk assessment conducted.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |

|                                                     |                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
|-----------------------------------------------------|--------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Pre-Emergency Planning</b>                       | <b>Established</b> | <p>Emergency response plans/procedures have been established for various plans/procedures have been established for various scenarios including EV fire, fire, bomb threats and pandemic.</p> <p>A 6-man emergency response team including 1 site management controller, 1 site incident controller and 4 Emergency Response Team (ERT) members comprising of security team is established during the day. During the night, there is a similar set-up with the SIC and SMC on call.</p> <p>The CERT team carries out minimally 1 drill per month.</p> |
| <b>Self-Inspections</b>                             | <b>Embedded</b>    | Daily checks are carried out by technicians who will highlight any issues via Whatsapp so that it can be rectified quickly. Monthly walkabout are also carried out by management.                                                                                                                                                                                                                                                                                                                                                                      |
| <b>Smoking Controls</b>                             | <b>Optimized</b>   | Smoking is prohibited on [PROPERTY] compounds. During the site visit, no cigarette butt was observed throughout the areas inspected.                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <b>Contractor Management</b>                        | <b>Embedded</b>    | In-house rules are available in PTW for contractors to read and comply to.                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>Business Continuity Planning</b>                 | <b>Established</b> | Business Continuity Plan (BCP) has been established on a corporate level.                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
| <b>Environmental, Social &amp; Governance (ESG)</b> | <b>Optimized</b>   | [PROPERTY] was awarded Green Mark Platinum by BCA. [PROPERTY] also received funding under BCA's GBIC 2.0 Demonstration Programme.                                                                                                                                                                                                                                                                                                                                                                                                                      |

In assessing the maturity of the Management Programs the following maturity scale was applied:

| Maturity Rank | Definition                                                                                               |
|---------------|----------------------------------------------------------------------------------------------------------|
| Undeveloped   | Informal actions with little or no systematic procedures.                                                |
| Formalized    | Programs and procedures are established. Full familiarity is uncertain.                                  |
| Established   | Programs and procedures are communicated throughout the organization. Orientation is ongoing.            |
| Embedded      | Ownership is established at most or all organizational levels. Training and some exercises is conducted. |
| Optimized     | Full ownership with active program maintenance, testing, exercising and continuous improvement.          |

## Management Program Comments

Overall, based on site discussion and observation, the site has established good management procedures/policy and fulfilling local regulatory requirements.

## Section 7

# Construction

### Construction Narrative

[PROPERTY] comprise of 1 35-storey office tower, 1 47-storey tower housing a hotel and residences, 4 low rise podium blocks and 4 heritage buildings. The entire complex sits on a 3.5 ha plot surrounded by [road]. The offices occupy 40%, hotel 30%, residences 22.5% and retail 7.5% of the total Gross Floor Area (GFA). The site area is 34,959 m<sup>2</sup> and the breakdown of date of TOP and Gross Floor Area (GFA) is in the table below.

| Area                                         | TOP          | GFA (m <sup>2</sup> ) |
|----------------------------------------------|--------------|-----------------------|
| [PROPERTY] (Office)                          | 13 Feb 2015  | 57,452                |
| Hotel ( [LOCATION] – L1 – L22 of [PROPERTY]) | 19 June 2015 | 39,677                |
| Residences (L23 – L46 of [PROPERTY])         | 9 Dec 2015   | 33,024                |
| P01 ([PROPERTY] Avenue)                      | 3 Dec 2015   | 1,085                 |
| P02                                          | 19 June 2015 | 5,077                 |
| P03 (                                        | 8 Oct 2015   | 2,199                 |
| P04 (Utility Block)                          | 13 Feb 2015  | 1,929                 |
| C01 ([PROPERTY] Quarter)                     | 29 May 2015  | 1,263                 |
| C09                                          | 8 Oct 2015   | 2,585                 |
| C14 (Assembly)                               | 21 Sept 2015 | 1,436                 |
| [SPACE]                                      | 28 Sept 2015 | 613                   |
| Retail Common                                | N/A          | 1,023                 |
| <b>Total</b>                                 | -            | 147,363               |

The outdoor area of the first floor of the development where the podium blocks, heritage blocks and both towers are connected is sheltered by a 280m long canopy. The canopy is constructed of aluminum louver blades with glass and no insulation. The blades are made of aluminum alloys (A6063-T5) coating with Fluorocarbon coating (PVDF) (melting point of about 615°C).

For the 35-storey office tower, the building is generally constructed with reinforced concrete structures (floor plate, beams, columns) with concrete flat roof. The exterior walls of the tower is made of full glazed glass curtain wall with thickness of 33.52mm and aluminum cladding. The surface of the glass curtain is coated with low emissivity coating silver and metal-oxide film, giving the building a blue colour. The interior walls are of masonry construction and internal partition walls in the office spaces are made of mainly drywall gypsum boards.

The 47-storey hotel and residences tower is constructed of similar materials to the office tower. The building is generally constructed with reinforced concrete structures (floor plate,

beams, columns) with concrete flat roof. The external walls are similarly glass curtain walls while the internal partitions are of masonry walls or drywall gypsum boards.

The 4 podium blocks (P01 to P04) are constructed of reinforced concrete structures (floor plates, beams, columns) with concrete flat roofs. The external walls of P01, P02 and P03 are constructed of curtain glass walls while that of P04 (Utility Block) is constructed of reinforced concrete. Co

The 4 heritage buildings were given conservation status in 2002 due to their rich historical and architectural significance. Block 1, 9 and 14 were built in 1930s and is constructed in Art Deco style and has the façade finished in Shanghai plaster. The 3 blocks are painted with white mineral paint and orange concrete tile pitch roof. The [SPACE] building, designed by Palmer and Turner and built in 1952-53, is a hybrid of the Art Deco and the Modern style known as Modern architecture. Under the conservation status, more than 50% of the façade on the 4 buildings were retained such as Block 14 which retained its veranda spaces on the 2<sup>nd</sup> storey and the old vehicle maintenance pit.

## Compartmentalization and Fire Divisions

The whole complex is connected via the 3 basement levels (carpark) where the 3 levels are connected via vehicle ramps. Thus, the entire 3 basement levels of the 3 levels are carpark are considered to be one fire compartment.

The 4 podium blocks and 4 heritage blocks are interconnected via link bridges on Level 2.

At P01 ([PROPERTY] Avenue), there is vertical communication throughout basement 1 and level 1 via the atrium void.

P04 (Utility block) has an open-air link bridge on the second floor to both Suntec City and [LANDMARK]. There is a 2-hour fire rated shutter on the first floor of P04 before the escalator up to the second floor.

At P01 ([PROPERTY] Avenue), there is a connection to Esplanade MRT Station on Level 1. There is a 2-hour fire rated shutter at the entrance to the MRT Station.

Each floor of both towers from Level 1 and above are considered to be one 2-hour fire rated compartment.

Electrical equipment rooms (high-tension switchgear, low-tension switchgear, transformer, etc.) are fire compartmented via 2-hour fire-rated access doors.

## Section 8

# Occupancy, Hazards, and Utilities

## Occupancy

### Overview

[PROPERTY] consist of a 35-storey Grade A premium office tower, a 47-storey tower housing [TENANT] Hotel [LOCATION] [PROPERTY] (L3 – 21) and [PROPERTY] Residences (L22 – 47), 4 podium blocks and 4 heritage buildings. There are some retail and F&B establishments on top of some of the hotel operations housed in the low-rise podium blocks and heritage buildings. Podium block P01 is directly connected to [LOCATION] MRT Station while podium block P04 has a link bridge to [LANDMARK] and [LANDMARK]. [PROPERTY] Residences occupies Level 23 to 47 of the [PROPERTY], above [TENANT]. It houses 190 residential units ranging from 950 sqft for 2-bedroom units to more than 6,400 sqft for a 5-bedroom penthouse unit. [TENANT] occupies Level 3 to 21 of [PROPERTY] with a total of 634 guest rooms, including 47 suites.

[Site Photo]

More details regarding the occupancy of [PROPERTY] are shown in the table below:

| [PROPERTY]                                                         |                                                                                                                                                                                                                                     |
|--------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Level                                                              | Occupancy                                                                                                                                                                                                                           |
| Basement 3                                                         | Carpark, domestic water tank (office), sprinkler pump room (common), transfer pump rooms (office and retail), underground diesel tank                                                                                               |
| Basement 2                                                         | Carpark, centre management office, fuel pump room (common)                                                                                                                                                                          |
| Basement 1                                                         | Carpark, security centre, chiller plantroom (common), transformer rooms (office and common), LV switchrooms (office and common), HT switch rooms (office & common), MDF room (office), generator set room (common), SPPG substation |
| Level 1                                                            | Lobby, sprinkler control valves, Fire Command Centre (FCC)                                                                                                                                                                          |
| Level 2 – 11,<br>Level 12 – 21,<br>Level 22 – 32,<br>Level 33 – 34 | Offices                                                                                                                                                                                                                             |
| Level 11M                                                          | Sky Garden (outdoor greenery area), chilled water pump room                                                                                                                                                                         |
| Level 21M                                                          | Sky Garden (outdoor greenery area), chilled water pump room, MDF room, Lift Motor Room                                                                                                                                              |
| Level 32M                                                          | Packaged Air-conditioning unit room, LV switchroom 2, transformer room, lift motor room (high zone)                                                                                                                                 |
| Level 35<br>(Roof)                                                 | Roof Garden, hosereel pump room, hosereel tank, office domestic water roof tank, lift motor room                                                                                                                                    |

| <b>[PROPERTY] (Hotel and Residence)</b> |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
|-----------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Level</b>                            | <b>Occupancy</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
| Basement 3                              | Carpark, linen collection room (for hotel guests only), heat pump room                                                                                                                                                                                                                                                                                                                                                                                                                  |
| Basement 2                              | Carpark                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
| Basement 1 and Basement 1M              | Carpark area: Carpark, hot water tank room, hot water tank, transformer room (hotel)<br>Hotel block (Back-of-house): hot production kitchen for banquet, stewarding office & store, vegetable/fruit/poultry/seafood/meat preparation room, laundry room, sales & marketing office, engineering & maintenance office, HR & Finance office, banquet & catering office, IT server room, housekeeping office, call centre, chef office, General Manager office, main kitchen, staff kitchen |
| Level 1                                 | Lobby, lounge, loss prevention room                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
| Level 2                                 | Meeting rooms, link bridge to Writer's Corner                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| Level 3 – 17                            | Hotel guest rooms                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| Level 18                                | Sky Terrace (outdoor swimming pool, gym, bar)                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| Level 18M                               | Domestic pump room, hot water tanks, heat pumps                                                                                                                                                                                                                                                                                                                                                                                                                                         |
| Level 19 – 21                           | Hotel guest rooms                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| Level 22                                | Sky Garden (outdoor swimming pool, outdoor gym, residential gym, function room with kitchenette)                                                                                                                                                                                                                                                                                                                                                                                        |
| Level 22M                               | AHU, hot water tanks, heat pumps, LV Switch room, MDF room                                                                                                                                                                                                                                                                                                                                                                                                                              |
| Level 23 – 31                           | Condominium units                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| Level 32                                | Sky Garden (outdoor exercise area, children's pool, outdoor cooking area (equipped with electrical grill), reading room)                                                                                                                                                                                                                                                                                                                                                                |
| Level 32M                               | LV switchroom, CAS room, transformer room                                                                                                                                                                                                                                                                                                                                                                                                                                               |
| Level 33 – 46                           | Condominium units (L44: lift motor room; L43: hosereel pump room)                                                                                                                                                                                                                                                                                                                                                                                                                       |
| Level 47                                | Gondola, PV panel inverter, lift motor room                                                                                                                                                                                                                                                                                                                                                                                                                                             |

## **Podium Blocks**

### **Podium Block P01 – [PROPERTY] Avenue**

| <b>Level</b> | <b>Occupancy</b>                                        |
|--------------|---------------------------------------------------------|
| Basement 1   | F&B establishments, connection to Esplanade MRT Station |
| Level 1      | F&B establishments, connection to Esplanade MRT Station |

### **Podium Block P02**

| <b>Level</b> | <b>Occupancy</b>              |
|--------------|-------------------------------|
| Basement 1   | F&B establishments            |
| Level 1      | Hotel dining area and kitchen |

## Podium Blocks

Level 2 Spa, hotel rooms, link bridge to [PROPERTY]

Level 3 – 5 Hotel rooms

Roof Pool, open air area

## Podium Block P03

| Level | Occupancy |
|-------|-----------|
|-------|-----------|

|             |                    |
|-------------|--------------------|
| Basement 1M | F&B establishments |
|-------------|--------------------|

|         |                                                      |
|---------|------------------------------------------------------|
| Level 1 | All day dining (for hotel guests and open to public) |
|---------|------------------------------------------------------|

|         |                                                            |
|---------|------------------------------------------------------------|
| Level 2 | Retail, link bridge to [PROPERTY], link bridge to Assembly |
|---------|------------------------------------------------------------|

## Podium Block P04 – Utility Block

| Level | Occupancy |
|-------|-----------|
|-------|-----------|

|                |         |
|----------------|---------|
| Basement 3 – 1 | Carpark |
|----------------|---------|

|         |                       |
|---------|-----------------------|
| Level 1 | Escalator, lift lobby |
|---------|-----------------------|

|         |                                                      |
|---------|------------------------------------------------------|
| Level 2 | Link bridge to [LANDMARK], link bridge to [LANDMARK] |
|---------|------------------------------------------------------|

|      |                                       |
|------|---------------------------------------|
| Roof | Diesel generator sets, cooling towers |
|------|---------------------------------------|

## Heritage Blocks

### Heritage Block C01 – [PROPERTY] Quarter

| Level | Occupancy |
|-------|-----------|
|-------|-----------|

|             |                           |
|-------------|---------------------------|
| Level 1 – 2 | F&B establishment, retail |
|-------------|---------------------------|

### Heritage Block C09

| Level | Occupancy |
|-------|-----------|
|-------|-----------|

|         |                    |
|---------|--------------------|
| Level 1 | Cocktail reception |
|---------|--------------------|

|         |          |
|---------|----------|
| Level 2 | Ballroom |
|---------|----------|

|          |           |
|----------|-----------|
| Level 2M | Mezzanine |
|----------|-----------|

### Heritage Block C14

| Level | Occupancy |
|-------|-----------|
|-------|-----------|

|         |                                                 |
|---------|-------------------------------------------------|
| Level 1 | Bar (Court Martial Bar), meeting rooms (7 no.s) |
|---------|-------------------------------------------------|

|         |                                                            |
|---------|------------------------------------------------------------|
| Level 2 | Meeting rooms (8 no.s), link bridge to P03 Writer's Corner |
|---------|------------------------------------------------------------|

## The [SPACE]

| Level | Occupancy |
|-------|-----------|
|-------|-----------|

|             |                                |
|-------------|--------------------------------|
| Level 1 – 2 | Restaurant, bars, private pool |
|-------------|--------------------------------|

## Key Processes

|                                       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
|---------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Activity / Processes</b>           | <p>The entire [PROPERTY] development is a Strata Titles property. [PROPERTY] Consortium team oversees the management and maintenance of the office, retail and hotel area. The main MCST formed together with 3 other subsidiary MCST looks after different areas of the development. The residence is fully sold and maintenance is handed over to the management corporation (MC). [MANAGEMENT] [LOCATION] is appointed as the managing agent (MA) taking care of day-to-day operations and maintenance of the development. Hotel operations and maintenance are fully managed by [TENANT] Hotel [LOCATION] who has a dedicated facility management team.</p> |
| <b>South Tower Amenities</b>          | <p>At the [PROPERTY], Level 22 and 32 has an open air Sky Garden with amenities such as swimming pool, gym, reading room, etc. There is an outdoor electric grill available on Level 32 Sky Garden. Residents will need to book their preferred timeslot (9am – 3pm or 4pm – 10pm) in order to use the facility. All common areas are monitored by the security guards via CCTV.</p>                                                                                                                                                                                                                                                                            |
| <b>Employee / Operating Hours</b>     | <p>[MANAGEMENT] [LOCATION] is appointed as the MA responsible for maintaining the commons areas, office tower and residences. [MANAGEMENT] has a total of 11 staff operating from 8.30am to 5.30pm and 1 in house technician operating from 9am to 6pm. On top of that, cleaning contractors and contract technicians are engaged to assist with day-to-day operations and maintenance. The contract technicians are available 24/7 and operate in 3 shifts. There are about 4 technicians in the day shift, 4 technicians in the afternoon shift and 2 technicians in the night shift.</p>                                                                     |
| <b>Third parties / tenanted areas</b> | <p>The retail and office units are 100% tenanted. Some anchor tenants for the office tower include [ANCHOR TENANTS].</p> <p>The units in [PROPERTY] Residences are fully sold.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
| <b>Common Hazard</b>                  | <p>Common property hazards for such occupancy include fire arising from faults in electrical equipment / fixtures, commercial cooking operations; and water damage arising from wet-pipe sprinkler actuation or chilled/domestic water pipe leaks/bursts.</p> <p>Most of the common property hazards are well managed. Preventive and predicative electrical maintenance is expected to be conducted by appointed electrical contractor which will include infra-red thermography.</p>                                                                                                                                                                          |

| <b>Special Hazards</b>          | <p>There are 8 diesel generator sets, 5 at the generator room on Basement 1 of [PROPERTY] and 3 at the generator room on P04 (Utility Block) roof. Each generator set has a 1000L day tank. There are leak detectors for each day tank which will send a signal to the FCC if any leaks are detected.</p> <p>There are two 20,000L underground diesel storage tanks at Basement 3 of the [PROPERTY] which are estimated to be topped up every 2 years. The diesel is pumped automatically via the diesel transfer pumps on Basement 2 to top up the day tanks when required.</p>                                                                                   |
|---------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Hotel Laundry Operations</b> | <p>Linen chute is installed from Basement 1 to Level 21. All the linen chute doors are installed with safety interlock, ensuring only one chute door can be opened at a time. The chute doors are usually locked and only housekeepers have the key.</p> <p>Majority of the laundry is sent out to be washed by contractors. However, hotel guests' laundry are being washed in house in the laundry room located on Basement 1. There is one dry cleaning machine available with the dry-cleaning chemical being refilled every 9 – 12 months by specialist contractor. The dryers are cleared of lint daily to prevent build up and reduce the risk of fire.</p> |
| <b>Carpark/Bicycle Parking</b>  | <p>There is a total of 550 carpark lots across Basement 1 – 3 with some dedicated lots for residents of [PROPERTY] Residences. On Basement 2, there are 5 EV chargers available at commercial zone and 2 EV chargers at residential zone.</p>                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>Grand Ballroom</b>           | <p>The Grand Ballroom located at Level 2 of C09 is fitted with 11,520 light installations. Each electric light is encased in aluminum tube dripping down from the ceiling forming a sea of lights like icicles. The hall seats 370 guests banquet-style, with 320 guests seated on the ballroom floor and the rest on the mezzanine level.</p>                                                                                                                                                                                                                                                                                                                     |
| <b>Commercial Kitchens</b>      | <p>Town gas is piped into the site from a main underground pipe and distributed to the respective F&amp;B tenant kitchens and hotel kitchens via the gas pipe riser. The gas leak detectors are located at the ceilings of the respective kitchens where there is highest potential for gas leak. The gas leak detectors are interlocked with gas supply. Maintenance is carried out as per manufacturer's recommendation by tenant's appointed contractors.</p> <p>The exhaust ducts from the kitchen hoods of the F&amp;B establishments converge into a common header before</p>                                                                                |

|                | <p>being vented. The cleaning of the kitchen hoods, exhaust ducts and common headers are carried out annually by an appointed contractor.</p> <p>All kitchen hoods (in tenant's and hotel's kitchens) for greasy cooking are protected by wet chemical suppression system which is maintained by contractor appointed by tenant or hotel respectively.</p> <p>The maintenance requirements mentioned above are written in the tenant's agreement. An OFI has been raised for the landlord to collect the service reports for the above systems to ensure that the maintenance is carried out as required.</p> |
|----------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Storage</b> | <p>Generally limited to small pockets of back-of-house merchandise storage belonging to retail tenants. There are no major warehousing facilities in the office and retail areas.</p> <p>For storage in hotel, most of the operations related storages are location on back-of-house area of B1/B1M. These are stored in various stores managed by different departments. Goods are typically stored on metal shelving up to 2m high, approved by Qualified Persons (QP) and within the protection limit of the sprinkler system installed.</p>                                                               |

## Utilities and Infrastructure

### Power

|                             |                                                                                                                                                                                                                                                                                                                                                                                                                                     |
|-----------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>University Town</b>      |                                                                                                                                                                                                                                                                                                                                                                                                                                     |
| <b>Site Feed</b>            | SP PowerGrid substation through 2 incoming feeders                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>Incoming Voltage</b>     | 22kV                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>Distribution on Site</b> | Underground cables                                                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>Details</b>              | Power is supplied from 22kV incoming feeders to the HT switchrooms at Basement 1 of the office tower. The power will then be stepped down to 433V by 12 silicon oil-filled and 4 dry-type transformers at Basement 1 and Level 32M of [PROPERTY]. It is then distributed in the two LT switchroom located at Basement 1 of [PROPERTY] and Level 22M.                                                                                |
| <b>Back-up Power</b>        | Backup power for essential services (lifts, fire pumps, FCC equipment) within the development is provided to maintain essential, life safety equipment of the property. On top of the 8 diesel generator sets, the facility also has Legrand Keor S 10KVA UPS located at LV Switchroom on Level 32M of [PROPERTY]. UPS provides continuous power supply to critical equipment until the diesel generator becomes fully operational. |

Details on the diesel generator sets are in the table below.

| Quantity and Rating of Genset | Genset Brand | Genset Location                             |                                |
|-------------------------------|--------------|---------------------------------------------|--------------------------------|
| 1 X 500 KVA                   | Meccatte     | Basement 1 of [PROPERTY]                    | Common areas, hotel, residence |
| 2 X 1,000 KVA                 | Meccatte     |                                             |                                |
| 2 X 2,000 KVA                 | Meccatte     |                                             |                                |
| 2 X 1,500 KVA                 | Meccatte     | Roof of P04 (Utility Block) (Outdoor units) | Office tower                   |
| 1 X 1,000 KVA                 | Meccatte     |                                             |                                |

### Transformer details

There are a total of 16 silicon oil-filled transformers. Each transformer is estimated to have less than 20% loading. The transformers on each level are reportedly connected in a loop system which allows easy coupling when any transformer breaks down. However, the loads from transformers of different levels cannot be transferred.

| Location of Transformer                          | Number and Rating of transformer | Area Served | Make/Type          |
|--------------------------------------------------|----------------------------------|-------------|--------------------|
| <b>Basement 1 Transformer Room at [PROPERTY]</b> | 4 X 3 MVA                        | Common area | Meiden/silicon oil |
|                                                  | 2 X 3 MVA                        | Office      | Meiden/silicon oil |
|                                                  | 2 X 2.5 MVA                      |             | Meiden/silicon oil |
|                                                  | 4 X 2.5 MVA                      | Hotel       | Meiden/silicon oil |
| <b>Level 32M Transformer Room at [PROPERTY]</b>  | 2 X 2.5 MVA                      | Office      | Schneider/dry      |
|                                                  | 2 X 2 MVA                        |             | Schneider/dry      |

The transformers at Basement 1 transformer room and Level 32M transformer room are housed within the same fire compartment, without firewall separation, but are equipped with smoke detectors. The HT switchboard at Basement 1 and LT switchboards on Basement 1 and Level 22M are housed in separate 2-hour fire rated rooms.

## Refrigeration / Chillers / Cooling towers

Centralized chilled water system is provided for this development. There are a total of 7 chillers located on Basement 1 Chiller Room which is sprinkler protected – 4 chillers with rated capacity of 1,000 RT and 2 chillers with rated capacity of 500 RT. During the day, 3 large chillers will be running. During the night, only 2 small chiller will be running.

There are 6 cooling towers on Roof of P04 (Utility Block) – 4 cooling towers with rated capacity of 30kW and 2 cooling towers with rated capacity of 15kW. Each cooling towers is dedicated to a corresponding chiller unit.

## Fuels and energy supplies

Diesel for the 8 diesel generator sets are held in their respective 1,000 litres fuel day-tanks and automatically topped up from two 20,000L diesel underground storage tank via fuel pumps. The underground diesel storage tanks are topped up about every 2 years. At the sampled generator set on the roof of P04, it was seen that the fuel level is less than half the total capacity. An OFI was raised to verify if the tank level and the fuel pump functionality.

## Photo Voltaic (PV) Panels

There are 288 PV panels installed on the lower roof (132 panels) and upper roof (156 panels) of [PROPERTY]. The rated output of each panel is 275 Wp resulting in total system capacity of 79.2 kWp. The PV inverters are located on the lower roof of [PROPERTY]. The PV panels are installed and maintained by SolarGy.

## Section 9

# Fire Protection

## Automatic Sprinkler Protection

Automatic sprinklers are installed as follows:

| Location                               | System Type | Area covered                                             | Design Standard Applied | Assessment |
|----------------------------------------|-------------|----------------------------------------------------------|-------------------------|------------|
| B1 Fire Pump Room                      | Wet         | [PROPERTY] B3 – L10, C01, C01, P04                       | CP52:2004, OH2          | Adequate   |
| B1 Fire Pump Room / L32 Fire Pump Room | Wet         | [PROPERTY] L11 – 22M, L32 – 32M<br>[PROPERTY] L11 – roof | CP52:2004, OH1          | Adequate   |
| B1 Fire Pump Room / L32 Fire Pump Room | Wet         | [PROPERTY] B3 – L10, P01, P02, P03, [SPACE]              | CP52:2004, OH3          | Adequate   |

## Comments

Automatic sprinkler systems are provided for the whole Frasers Tower with the exception of

1. [PROPERTY] Residences (Level 23 to 31 and Level 33 to 47 of [PROPERTY]). Sprinkler protection is not required in the condominium area as per local code. Sky Garden on Level 32 and Level 22 are covered by sprinklers.
2. Electrical equipment rooms, lift shafts and riser compartments.

The primary system is primarily designed and installed to local code, CP52: 2004 (Code of Practice for Automatic Fire Sprinkler System. The office towers from Basement 3 to Level 10 is designed to OH2 while Level 10 to roof is designed to OH1.

## Special Extinguishing Systems

### Gaseous Protection Systems

FM200 gaseous protection system is installed at the Level 3 IT Server Room in the former [SPACE]. FM200 gaseous protection system is also installed at the Basement 1 server room in the [PROPERTY] and is activated via cross zone smoke detectors installed within the room and in the false ceiling. The discharge nozzle is also installed within the room and in the false ceiling. The maintenance for the above systems are maintained by the respective facility management team.

Additionally, gaseous protection system is installed within some tenant's area and is maintained by the tenants' appointed contractor. The signals from the gaseous suppression system are reportedly required to be linked to the main fire alarm panel. Maintenance of the gaseous protection system is wholly managed by the respective tenants. Information regarding office areas which are protected by the gaseous protection system was not available at the time of the visit.

### Wet Chemical Suppression Systems

Ansul's Wet Chemical Suppression System is installed for the kitchen hoods of the retail F&Bs and hotel kitchen throughout the complex. It is outlined in the tenancy agreement that all F&B establishments will have to install the wet chemical suppression system before starting operation. Maintenance of the wet chemical suppression system is managed by the tenants and hotel respectively.

### Automatic Water Monitoring System

The open podium area is protected by 6 automatic water monitor systems comprising of the water monitor device, water monitor control panel and water monitor alarm panel. The systems are installed on the rooftop of P01, P02, P03 and [SPACE]. The water monitor devices are activated by IR/UV sensors to determine the location of the fire source. The water monitor device will then directly discharge water at the source, extinguishing the fire. The monitor has a protection radius of 32m, flowrate of 5 litres/sec, at 600 Pa. The automatic water monitor system is a Chinese product from Liaoyang Tianhe Automatic Fire Extinguishing Equipment Manufacturing Co. Ltd.

## Water Supply Details

Sprinkler system in [PROPERTY] is supplied by a combination of fire sprinkler transfer pumps, gravity feed pumps and booster pumps set. The booster pumps and gravity feed pumps comprise of 1 duty, 1 standby and 3 jockey pumps, all of which are electric motor driven and provided with emergency backup power via the building generator set. The sprinkler system is split into low zone, mid zone and high zone where each zone has a dedicated jockey pump. Both sprinkler pumps are FM approved and UL listed. There is also another set of sprinkler pumps at the L32 [PROPERTY] which comprises of 1 duty, 1 standby and 1 jockey pump, all of which are electric motor driven and provided with emergency backup power via the building generator set.

The table below shows the area served for each zone by the B1 fire pump set:

| Zone             | Area Served                                                                                                                                                                                                                                                                                                                                                            |
|------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Low Zone</b>  | Entire Basement 3, Basement 2, Basement 1 and Basement 1M<br>P01 – Level 1 to Level 1<br>P02 – Level 1 to Level 6<br>P03 – Level 1 to Level 2<br>P03 – Level 1 to Level 3<br>C01 – Level 1 to Level 2<br>C09 – Level 1 to Level 2M<br>C14 – Level 1 to Level 2<br>[SPACE] – Level 1 to Level 3<br>[PROPERTY] – Level 1 to Level 10<br>[PROPERTY] – Level 1 to Level 13 |
| <b>Mid Zone</b>  | [PROPERTY] – Level 11 to Level 23<br>[PROPERTY] – Level 14 to Level 22M                                                                                                                                                                                                                                                                                                |
| <b>High Zone</b> | [PROPERTY] – Level 24 to Level 37<br>[PROPERTY] – Level 32 to Level 32M                                                                                                                                                                                                                                                                                                |

Refer to the table below for the details of the fire pumps:

| Location                        | Area Served          | Pump         | Nominal Rating/<br>Hazard Group | Cut in Pressure (PSI) | Cut out Pressure (PSI) |
|---------------------------------|----------------------|--------------|---------------------------------|-----------------------|------------------------|
| B1 Fire Pump Room               | Low Zone             | Duty Pump    | 1,650 L/min @17.7 bar           | 120                   | Manual Stop            |
|                                 |                      | Standby Pump | 1,650 L/min @17.7 bar           | 110                   | Manual Stop            |
|                                 |                      | Jockey Pump  | -                               | 130                   | 170                    |
| B1 Fire Pump Room               | Mid Zone             | Duty Pump    | 1,650 L/min @17.7 bar           | 200                   | Manual Stop            |
|                                 |                      | Standby Pump | 1,650 L/min @17.7 bar           | 190                   | Manual Stop            |
|                                 |                      | Jockey Pump  | -                               | 210                   | 260                    |
| B1 Fire Pump Room               | High Zone            | Duty Pump    | 1,650 L/min @17.7 bar           | 280                   | Manual Stop            |
|                                 |                      | Standby Pump | 1,650 L/min @17.7 bar           | 270                   | Manual Stop            |
|                                 |                      | Jockey Pump  | -                               | 290                   | 350                    |
| L32 Fire Pump Room ([PROPERTY]) | [PROPERTY] L1 – L22M | Duty Pump    | Info not available              | Info not available    | Info not available     |
|                                 |                      | Standby Pump | Info not available              | Info not available    | Info not available     |
|                                 |                      | Jockey Pump  | Info not available              | Info not available    | Info not available     |

Refer to the table below for the details of the fire water tank:

| Location of Fire Pump                | Equipment/Area Served                                     | Capacity           | Tank Material       |
|--------------------------------------|-----------------------------------------------------------|--------------------|---------------------|
| Basement 1 Fire Pump Room            | Fire pumps, wet riser, hose reel and transfer pump system | 260 m <sup>3</sup> | Reinforced Concrete |
| Level 32 Fire Pump Room ([PROPERTY]) | Fire pumps, wet riser system                              | 154 m <sup>3</sup> | Press Steel         |

## Pump Flow Test Data

Fire pump performance test was not observed during the site survey.

## Wet and Dry Risers

| Wet / Dry Riser | Building   | Floors Covered   |
|-----------------|------------|------------------|
| Dry Riser       | C09        | B3 – L3 (2 nos.) |
|                 | C01        | L1 – L2          |
|                 | [SPACE]    | L1 – L3          |
| Wet Riser       | P03        | L1 – L2          |
|                 | P04        | B3 – L3          |
|                 | P01        | B3 – L1          |
|                 | P02        | B3 – Roof        |
|                 | [PROPERTY] | B3 – L44         |
|                 | [PROPERTY] | B3 – Roof        |
|                 | [PROPERTY] | B3 – L32M        |
|                 | [PROPERTY] | B3 – Roof        |

## Manual Firefighting Features

|                                    |                                                                                                                                                                                                 |
|------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Distance to Fire Department</b> | 1.7 km ([LOCATION] Fire Station)                                                                                                                                                                |
| <b>Response Time (minutes)</b>     | Within 10 minutes                                                                                                                                                                               |
| <b>Hydrant Coverage</b>            | There are public fire hydrants installed adjacent to the site along [ADDRESS] and Nicoll Highway.<br>There are 8 private hydrants available on site, connected directly to public water supply. |
| <b>Fire Hydrant Type</b>           | Above ground.                                                                                                                                                                                   |
| <b>Industrial Fire Brigade</b>     | No.                                                                                                                                                                                             |
| <b>Portable Extinguishers</b>      | Portable fire extinguishers strategically located through building as per local code.                                                                                                           |
| <b>Hose Stations / Reels</b>       | Internal 50mm diameter, 30m length hose reels are strategically located through building as per local code.                                                                                     |

## Other Manual Firefighting Comments

Hydrants are drawing water directly from the public water supply which is considered as very reliable in [LOCATION].

## Fire Alarm Monitoring

- Spot-type smoke detectors are installed in electrical/telecommunication risers, lift lobbies and electrical equipment rooms such as motor lift rooms (except in residence area), HT and LT rooms and transformer rooms.
- IR/UV detectors are installed in the podium area to activate the water monitor system provided in that area.
- Spot-type smoke and heat detectors are also installed on each floor of the [PROPERTY].
- Cross zone spot type smoke detectors within the L3 server room of [SPACE] and B1 server room of [PROPERTY] are installed to activate the FM200 gaseous protection system.
- Manual break glass call points with fire alarm bells are installed at strategic locations throughout the development.
- Building fire alarm systems are monitored 24/7 both locally in a constantly attended central fire command centre and via a decentralized alarm monitoring (DECAM) which is managed by third party, Ademco.

## Section 10

# External Exposures

### Location Details

|                                                          |                                                        |
|----------------------------------------------------------|--------------------------------------------------------|
| Latitude                                                 | [VALUE]                                                |
| Longitude                                                | [VALUE]                                                |
| Point where geo coding was taken                         | Google Earth                                           |
| Ground Elevation (above mean sea level)                  | 6Sm                                                    |
| Ground Elevation Source                                  | Munich Re's NATHAN                                     |
| Building Finished Floor Elevation (above mean sea level) | 0.5m higher than public road based on site observation |

### Boundary Exposures

| Direction | Exposure Rating | Distance | Comments                                                                                                                         |
|-----------|-----------------|----------|----------------------------------------------------------------------------------------------------------------------------------|
| North     | Light           | 70m      | [LANDMARK] (33-storey commercial development) separated by [PROPERTY] (currently under construction, to be completed by Q2 2026) |
| East      | Light           | 80m      | [LANDMARK] (commercial development) separated by [road]                                                                          |
| South     | Light           | 40m      | [LANDMARK] Park (Open green space) separated by [road]                                                                           |
| West      | Light           | 10m      | Low rise commercial buildings separated by [road]                                                                                |

## Natural Catastrophe Exposures

Based on Munich Re's Risk Suite (NATHAN – Natural Hazard)

| NATHAN Hazards                                                                                             | Score                                                     | Low Hazard | High Hazard |
|------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------|------------|-------------|
|  Earthquake               | Zone 0<br>MM V and below                                  | 0          |             |
|  Volcanoes                | No Hazard                                                 | -1         |             |
|  Tsunami                  | No Hazard                                                 | -1         |             |
|  Tropical Cyclone         | No Hazard                                                 | -1         |             |
|  Extratropical Storm      | No Hazard                                                 | -1         |             |
|  Hail                     | Zone 2                                                    |            | 2           |
|  Tornado                  | Zone 1<br>0.1 – 0.5 (per 10,000 km <sup>2</sup> and year) | 1          |             |
|  Lightning              | Zone 5<br>20.1 – 40.0 (per km <sup>2</sup> and year)      |            | 5           |
|  River Flood (Defended) | Zone 0<br>minimal flood risk                              | 0          |             |
|  Flash Flood            | Zone 4                                                    |            | 4           |
|  Storm Surge (Defended) | No Hazard                                                 | -1         |             |
|  Wildfire               | No Hazard                                                 | -1         |             |

| Peril                                           | Source          | Exposure Rating | Comments                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
|-------------------------------------------------|-----------------|-----------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Pluvial Flood (Heavy Rain / Flash Flood)</b> | MunichRe NATHAN | Low             | <p>Moderate exposure per Munich Re's NATHAN risk suite.</p> <p>Localized flash flooding due to heavy rainfall and storm water accumulation is a possibility, with the site situated within a NATHAN flash flood hazard Zone 4 (zones range from 1 to 6, with 6 being the most severe). The building is expected to be compliant with local codes/regulations with regards to flood mitigation and not listed as floor prone area. Based on the above, the exposure is considered to be low.</p> |

| Peril                                 | Source             | Exposure Rating | Comments                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
|---------------------------------------|--------------------|-----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Hail</b>                           | MunichRe<br>NATHAN | Low             | Per Munich Re's NATHAN risk suite, a low frequency and intensity of hailstorms is anticipated at the site.                                                                                                                                                                                                                                                                                                                                                           |
| <b>Tornado</b>                        | MunichRe<br>NATHAN | Low             | Buildings are of robust (reinforced concrete) construction which is expected to provide for wind loading.                                                                                                                                                                                                                                                                                                                                                            |
| <b>Tropical Cyclone</b>               | MunichRe<br>NATHAN | No Hazard       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>Extra-Tropical Storm</b>           | MunichRe<br>NATHAN | No Hazard       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>River (Inland) Flood</b>           | MunichRe<br>NATHAN | Low             | The nearest river is located about [DISTANCE] away. The exposure to river flood is expected to be low.                                                                                                                                                                                                                                                                                                                                                               |
| <b>Storm Surge / Coastal Flooding</b> | MunichRe<br>NATHAN | No Hazard       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>Tsunami</b>                        | MunichRe<br>NATHAN | No Hazard       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>Lightning</b>                      | MunichRe<br>NATHAN | Moderate        | As per Munich Re's NATHAN risk suite, there is a moderate to high exposure to lightning with 20.1 to 40.0 lightning strokes per sq. km. per year. Lightning presents a source of ignition and can cause electrical power surges which may damage and disrupt power supply systems. The building is provided with an extensive lightning protection system.                                                                                                           |
| <b>Earthquake</b>                     | MunichRe<br>NATHAN | Low             | [LOCATION] is not situated near any major tectonic plate boundaries, resulting in low exposure to earthquake. However, [LOCATION] do occasionally experience tremors due to earthquakes that happens in the region.<br><br>Per Munich Re's NATHAN risk suite, the site is situated within an area with a probable maximum earthquake intensity of Modified Mercalli Intensity (MMI) V and below based on a return period of 475 years for medium subsoil conditions. |
| <b>Volcanic</b>                       | MunichRe<br>NATHAN | No Hazard       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>Wild Fire</b>                      | MunichRe<br>NATHAN | No Hazard       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |

| Peril | Source             | Exposure Rating | Comments                                                                                                                                     |
|-------|--------------------|-----------------|----------------------------------------------------------------------------------------------------------------------------------------------|
| Other | MunichRe<br>NATHAN | Low             | For underground soil condition, it is classified as soft rock/dense soil and there are no signs of soil subsidence at the time of the visit. |

---

## Section 11

# Security

### Site Perimeter

|                                |                                                                                                                                                   |
|--------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Vehicle Access</b>          | Yes, parking is allowed in the site.                                                                                                              |
| <b>Perimeter Fencing</b>       | No, the complex is accessible by the general public during operating hours.                                                                       |
| <b>Entry Provisions Posted</b> | NA                                                                                                                                                |
| <b>No Trespassing Signage</b>  | Yes, for restricted areas.                                                                                                                        |
| <b>Fencing Height</b>          | NA                                                                                                                                                |
| <b>Exterior Lighting</b>       | Generally provided via external lamp/light posts and access road streetlamps throughout the site compounds; these are activated during the night. |

### Building Physical Features

|                                    |                                                                                                                                                                                                                                                                                                           |
|------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Ground Level Windows Secure</b> | NA                                                                                                                                                                                                                                                                                                        |
| <b>Lock and Key Control</b>        | All access doors to offices and restricted areas are fitted with electromagnetic locks and/or door magnetic contact to control access. After operating hours, the entry doors will be locked. Critically utility rooms such as fire pump rooms and transformer rooms are secured by lock and key control. |

### Security Staff / Guards

|                            |                                                                                                                                                                                                                                                                                                                       |
|----------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>On-Site Guards</b>      | Guards, provided by accredited security company, CBM Security, are unarmed and perform 12 hour shifts.<br><br>Day shift has 7 security guards while night, weekends and public holidays shift has 4 security guards. Guards are deployed at the security counters, access points and common areas of the development. |
| <b>Visiting Patrols</b>    | Regular patrol is expected to be conducted by the local police in the vicinity.                                                                                                                                                                                                                                       |
| <b>Police Surveillance</b> | No.                                                                                                                                                                                                                                                                                                                   |
| <b>Recorded Rounds</b>     | Yes.                                                                                                                                                                                                                                                                                                                  |
| <b>Rounds Frequency</b>    | 2 physical rounds and 2 virtual rounds per shift.                                                                                                                                                                                                                                                                     |
| <b>CCTV</b>                | More than 250 fixed CCTV cameras installed with recordings kept for at least 30 days.                                                                                                                                                                                                                                 |

## Intruder Detection

|                          |                                                                                              |
|--------------------------|----------------------------------------------------------------------------------------------|
| <b>Motion Sensors</b>    | No.                                                                                          |
| <b>Beams</b>             | No.                                                                                          |
| <b>Door Contacts</b>     | Yes. Alarms from doors will sound when the door is left open for an extended period of time. |
| <b>Access Monitored</b>  | Yes, CCTV is monitored 24/7.                                                                 |
| <b>ID Cards / Badges</b> | Yes.                                                                                         |

## Other Security Programs / Controls

|                                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
|--------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Emergency Response</b>      | Documented emergency response plan has been established. A 6-man emergency response team including 1 site management controller, 1 site incident controller and 4 Emergency Response Team (ERT) members comprising of staff and security team is established during the day. During the night, there are 4 ERT members comprising of the security team with the SIC and SMC on call. There are 3 fire evacuation drills (2 internal drills and 1 CERT audit), and 2 tabletop exercise carried out annually. |
| <b>Employee Screening</b>      | Yes, expected to be conducted as part of the employment process.                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <b>Visitor Management</b>      | Tenants will need to register their visitors and get a dedicated QR code. This QR code should then be emailed to the visitor. With the given QR code, the visitor can access the office tower without queuing and registering at the level 1 concierge. For security reason, anti-pass back feature will be in place and QR code will be refreshed on a daily basis.                                                                                                                                        |
| <b>Safe / Vaults</b>           | Tenants may have their own safe within their premises.                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>Bomb Threat</b>             | Detailed instructions are expected to be covered in the security plan.                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>Cash / Check Management</b> | Not applicable.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>Parking</b>                 | Carpark is open to public and overnight parking is permitted.                                                                                                                                                                                                                                                                                                                                                                                                                                               |

## Section 12


# Business Interruption

### Business Continuity / Disaster Recovery Planning


|                                             |                                                                                                                                                                                                                                                                                           |
|---------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Emergency Response Procedures</b>        | In the event of business interruption, there is a crisis communication plan and business continuity plan from corporate in place. There are various scenarios in place based on which equipment has failed. An OFI has been raised to formalize a site-specific business continuity plan. |
| <b>Business Continuity Plans available?</b> | Yes                                                                                                                                                                                                                                                                                       |
| <b>Last Reviewed / Updated</b>              | Reviewed on an annual basis.                                                                                                                                                                                                                                                              |

## Appendix A


# Site Photos




External Building Façade




The Terrace




Main Fire Alarm Panel




CCTV with VA




Underground diesel tank and pumps




Basement 3 Fire Pump Room




Level 1 HT Switchroom




Level 4 Generator Set Panel




Level 4 Chiller Plant Room




L16 Fire Pump Room




Level 16 Transformer Room




L37 Fire Pump Panel




Level 16 Generator Set



L16 Low Tension Switchroom



L37 Sprinkler Pump room

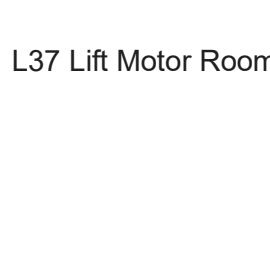

L37 Lift Motor Room



This document and any recommendations, analysis, or advice provided by Marsh (collectively, the "Marsh Analysis") are not intended to be taken as advice regarding any individual situation and should not be relied upon as such. The information contained herein is based on sources we believe reliable, but we make no representation or warranty as to its accuracy. Marsh shall have no obligation to update the Marsh Analysis and shall have no liability to you or any other party arising out of this publication or any matter contained herein. Any statements concerning actuarial, tax, accounting, or legal matters are based solely on our experience as insurance brokers and risk consultants and are not to be relied upon as actuarial, tax, accounting, or legal advice, for which you should consult your own professional advisors. Any modeling, analytics, or projections are subject to inherent uncertainty, and the Marsh Analysis could be materially affected if any underlying assumptions, conditions, information, or factors are inaccurate or incomplete or should change. Marsh makes no representation or warranty concerning the application of policy wording or the financial condition or solvency of insurers or reinsurers. Marsh makes no assurances regarding the availability, cost, or terms of insurance coverage. Although Marsh may provide advice and recommendations, all decisions regarding the amount, type or terms of coverage are the ultimate responsibility of the insurance purchaser, who must decide on the specific coverage that is appropriate to its particular circumstances and financial position.

Copyright © 2025 Marsh USA Inc. All rights reserved.