

Property Risk Evaluation Report

[PROPERTY]

[ADDRESS] [POSTAL]

30 Oct 2025

[PROPERTY]	
Location Surveyed	[ADDRESS]
Surveyed By	Ms. Valerie Lai, Consultant, [CONSULTANT] Advisory
Survey Dates	30 October 2025
Date Last Surveyed	First Survey by [CONSULTANT]
Site Contacts / In Attendance	[PROPERTY] Ms. [NAME], Manager Mr. [NAME], Assistant Manager Mr. [NAME], Manager Mr. [NAME], Operations
File Name & Rev.	[PROPERTY] – PRE Report 2025

[CONSULTANT] is part of the family of [CONSULTANT] McLennan Companies, including Guy Carpenter, Mercer, and the Oliver Wyman Group (including Lippincott and NERA Economic Consulting)

This document and any recommendations, analysis, or advice provided by [CONSULTANT] (collectively, the "[CONSULTANT] Analysis") are intended solely for the entity identified as the recipient herein ("you"). This document contains proprietary, confidential information of [CONSULTANT] and may not be shared with any third party, including other insurance producers, without [CONSULTANT]'s prior written consent. Any statements concerning actuarial, tax, accounting, or legal matters are based solely on our experience as insurance brokers and risk consultants and are not to be relied upon as actuarial, accounting, tax, or legal advice, for which you should consult your own professional advisors. Any modeling, analytics, or projections are subject to inherent uncertainty, and the [CONSULTANT] Analysis could be materially affected if any underlying assumptions, conditions, information, or factors are inaccurate or incomplete or should change. The information contained herein is based on sources we believe reliable, but we make no representation or warranty as to its accuracy. [CONSULTANT] shall have no obligation to update the [CONSULTANT] Analysis and shall have no liability to you or any other party with regard to the [CONSULTANT] Analysis or to any services provided by a third party to you or [CONSULTANT]. [CONSULTANT] makes no representation or warranty concerning the application of policy wordings or the financial condition or solvency of insurers or reinsurers. [CONSULTANT] makes no assurances regarding the availability, cost, or terms of insurance coverage. All decisions regarding the amount, type or terms of coverage shall be your ultimate responsibility. While [CONSULTANT] may provide advice and recommendations, you must decide on the specific coverage that is appropriate for your particular circumstances and financial position. By accepting this report, you acknowledge and agree to the terms, conditions, and disclaimers set forth above.

Copyright © 2025 [CONSULTANT] LLC. All rights reserved.

Contents

1. Purpose and Scope	1
2. Executive Summary.....	2
3. Opportunities for Improvement	4
• Risk Assessment Matrix (RAM)	4
• Management Programs	6
• Physical Protection.....	8
4. Risk Quality Ratings and Comments	9
5. Loss Estimates	11
• Values.....	11
• Loss Estimate Definitions	12
• Property – Level I Loss Estimate	13
• Property – Level II Loss Estimate.....	14
• Property – Level III Loss Estimate.....	15
6. Management Programs	17
• Management Program Comments	19
7. Construction	20
• Construction Narrative.....	20
• Construction Table	20
• Compartmentalization and Fire Divisions	20
8. Occupancy, Hazards, and Utilities	21
• Occupancy	21

• Utilities and Infrastructure	23
9. Fire Protection	25
• Automatic Sprinkler Protection	25
• Special Extinguishing Systems	25
• Water Supply Details	25
• Pump Flow Test Data	26
• Manual Firefighting Features	27
• Other Manual Firefighting Comments	27
• Fire Alarm Monitoring	27
10. External Exposures	29
• Location Details	29
• Boundary Exposures	29
• Natural Catastrophe Exposures	30
11. Security	33
12. Business Interruption	35
Appendix A: Site Photos	37

Section 1

Purpose and Scope

The purpose of this PRE report is to assist with the implementation of a Risk Management Strategy to prioritize risk improvements and mitigation strategies for the property, [PROPERTY]. It is made on request by [CONSULTANT] Broking Office. The analysis carried out is based on data provided by a physical review of the location. The report will inform existing and/or prospective insurance markets of physical conditions at this location. This report is based upon conditions and practices observed and information made available to [CONSULTANT] Risk Consulting at the time of our survey. The report should be used for risk management and insurance placement purposes only.

The visit comprised an inspection of main area of the site including the electrical rooms, fire pump room, common areas etc.

Our visits used National Fire Protection Association (NFPA), FM Global and local guidelines as technical references. Each site visit included the following activities:

- Physical tours of occupied spaces to observe storage practices, related property hazards and identify areas not in accordance with the above guidelines.
- A review of existing loss prevention programs, procedures, reports and documentation to verify status in accordance with corporate standards and practices.
- Interview relevant staff to gain a perspective on loss prevention programs and implementation to understand issues facing local management.
- An exit meeting with management to achieve agreement with our conclusions and to develop a recommended action plan.

This survey also included a review of administrative controls such as inspection, testing, and maintenance of fire protection systems and equipment; impairments to these systems; and fire emergency planning.

No physical tests were witnessed during the survey.

Section 2

Executive Summary

[PROPERTY], which was opened in July 2009, is an eight-story premium destination mall located at the gateway of [LOCATION]'s renowned [STREET]. The mall offers a curated selection of popular retail and epicurean options, and an expansive food hall presenting an array of local and international culinary delights. [PROPERTY] is integrated with a 56-storey condominium, The [AREA] Residences and is seamlessly connected to the [AREA] Mass Rapid Transit (MRT) station via a sheltered accessway as well as to other parts of [STREET] via the underground pedestrian link named [PROPERTY] Link.

The buildings are generally constructed from reinforced concrete structures (columns, beams and floor plates) and reinforced concrete flat roof. Internal partition walls are constructed of either dry wall partition or light weight concrete panels. The retail mall exterior wall is mainly constructed of reinforced concrete or glass panels mounted on a steel frame with a fully three-dimensional free form curvilinear glass and metal façade. The residences areas have exterior wall constructed of reinforced concrete or curtain glass mounted on a steel frame. Therefore, the whole building is considered to be of non-combustible construction.

Automatic sprinkler systems are provided from Basement 4 to Level 8, Level 55 and 56 with the exception of electrical equipment rooms and riser compartments. Other means of fire protection include wet chemical suppression system in kitchen hoods for restaurants in the shopping mall, in addition to wet/dry risers, internal fire hoses, portable fire extinguishers and manual break glass call points installed at strategic locations throughout the buildings as per local code requirements. The building is equipped with a dedicated fire alarm system that is monitored centrally at the 24/7-manned fire command centre, via a decentralized alarm monitoring (DECAM) station which have direct connections to the local fire brigade.

There are two diesel generator sets on Level 8. Each of the generator sets have a 1000L day tank. The top up is done manually during the annual servicing if the day tank level is low. The storage of the flammable liquid complies with the Petroleum and Flammable Material Storage License governed under [LOCATION] authority, [LOCATION] Civil Defense Force.

There is 24/7 security presence and CCTV monitoring for both internal and external areas. A high standard of risk management programs has been established, including a mature safety management system, formal procedures, self-inspection programs, comprehensive preventive maintenance program for building utility and fire protection equipment.

Natural catastrophe for the sites are generally low, with the exception of lightning which is adequately addressed via the provision of lightning protection and earthing systems. Building exterior exposures are generally low; facility is situated with good spatial separation provided between site boundaries and neighboring third party properties. Overall risk rating for the site is considered to be good risk of its class.

Opportunities for Improvement were submitted to improve the quality of risk control and loss prevention at the surveyed facilities.

[CONSULTANT] Advisory would like to thank [PROPERTY]'s team for their involvement and assistance in the 1-day survey.

Changes Since Previous Survey

First survey by [CONSULTANT].

Planned Changes / Projects

No planned changes.

Past Losses

On Level 10, where some air conditioning compressors are housed, there is an unsheltered ledge with a 3- to 4-inch kerb with a small drainage point. In December 2024, after heavy rain during nighttime, the entire Level 10 was found to be flooded. The water overflowed into the lift shaft resulting in damage to the lift, such as corrosion of the lift rope, which was subsequently replaced. After investigation, it was found that the flood was caused by the choking of the drainage point. To prevent such issues from recurring, the ledge kerb was raised to 1 foot, and a wire mesh was installed over the drainage point and cleared weekly. The outlet of the drainage pipe was also shortened to ensure that there will be sufficient space for water and debris to drain.

In Sep 2024, the bus duct from the Level 8 transformer to L7 main switch board had a flashover causing the system to trip. A Licensed Electrical Worker (LEW) was called down and arrived within 30 minutes to couple out the main switchboard to another transformer. To resolve the issue, the OEM was engaged to identify the cause of the flashover. However, the result was inconclusive. A potential cause was the temperature difference between the busduct and LT switchroom. To prevent similar issues from recurring, the temperature of the LT switchroom was increased and regular thermal scanning of the busduct will be conducted. The management is currently in discussion on the cyclical replacement of all the busducts.

Section 3

Opportunities for Improvement

Opportunities for Improvement (OFI) are suggested to mitigate risks. They are intended to create value and manage risk exposures while maintaining relevance to your business objectives. The Opportunities for Improvement addresses either specifically identified Risks to ManageSM or they are suggested as general sound risk management to implement at the location.


Prioritization of OFI's are classified in line with the following indicative Risk Assessment Matrix (RAM). The relative risk associated with each OFI is measures the estimated consequences of the damage versus the likelihood of occurrence.

Risk Assessment Matrix (RAM)


Likelihood	Consequences				
	Insignificant	Minor	Moderate	Major	Catastrophic
Almost Certain	Priority 2	Priority 2	Priority 1	Priority 1	Priority 1
Likely	Priority 3	Priority 2	Priority 2	Priority 1	Priority 1
Possible	Priority 4	Priority 3	Priority 2	Priority 1	Priority 1
Unlikely	Priority 4	Priority 4	Priority 3	Priority 2	Priority 1
Very Rare	Priority 4	Priority 4	Priority 3	Priority 2	Priority 2

A graphical summary of the current opportunities for improvement are shown below:


OFI COUNT BY STATUS

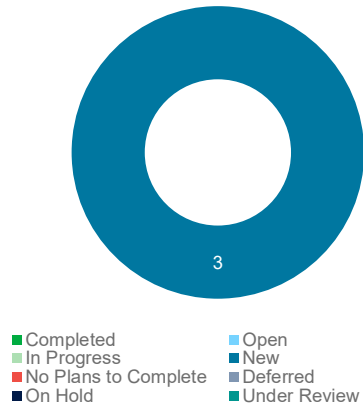


OFI COUNT BY PRIORITY
(NOT INCLUDING COMPLETED)

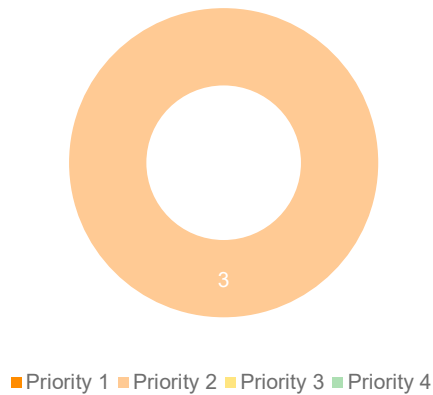

OFI COUNT BY CATEGORY
(NOT INCLUDING COMPLETED)

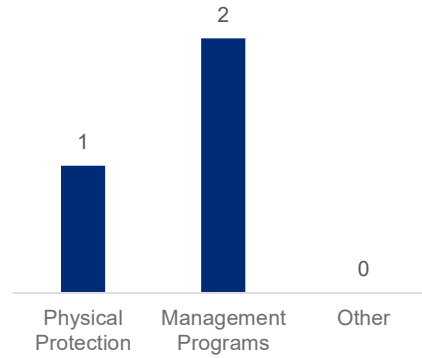

OFI COUNT BY EFFORT OF IMPLEMENTATION
(NOT INCLUDING COMPLETED)

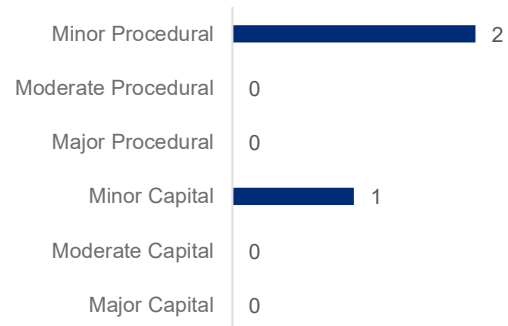

Management Programs

2025-01		Improve Hot Work Permit	
Status	New	Issue Date	30-Oct-2025
Priority	Priority 2	Type	Hot Work Permit
OFI Issued By	[CONSULTANT]		
Description	As per NFPA 51B, the existing hot work permit system can be enhanced by incorporating the following precautions: 1) The permit form should incorporate the requirement for a constant fire watch to be maintained throughout the duration of the hot work, and for at least 30 - 60 minutes after the completion of the hot work. Moreover, the hot work area and its vicinity should be monitored for any sign of fire in its incipient stage for at least 3 hours after the completion of the established fire watch time period.		
Observation	The hot work permit reviewed lacked requirements for fire watch during and post hot work.		
Client Response	As per email received on 27 Feb 2026, the above guidelines will be implemented in the House Rules.		
Effort of Implementation	Minor Procedural		

2025-02	Formalize Fire Protection System Impairment Programme		
Status	New	Issue Date	30-Oct-2025
Priority	Priority 2	Type	Fire Protection System Maintenance and Testing
OFI Issued By	[CONSULTANT]		
Description	To improve the fire protection system impairment management process, consideration should be given to implementing an impairment procedure supported by a formal Impairment Notification permit, in accordance with NFPA 25 Chapter 15. Consideration should include: • Not allowing additional high risk work to be done in the impaired area such as Hot Work to prevent an even higher exposure risk to the site. • Authorisation and supervision of all isolations and deisolations • Completion and forwarding of a Fire Protection System Impairment form to relevant parties (eg. DECAM station, insurance carrier, facility management, security, emergency response team, etc.) • Ensuring that all fire protection systems are reverted back to its normal operating conditions once the impairment works are completed Fire systems isolation may be required due to construction works, repairs, faults of system testing. It is essential that a system is in place for fire systems impairment. Any isolation to the fire protection system should be normalized as soon as possible.		
Observation	There is no formalized fire protection system impairment programme.		
Client's Reponse	As per email on 27 Feb 2026, there is no plan to implement a separate fire protection system impairment programme. The isolation of fire protection system will be tracked via a log book system and all isolations require approval from the Technical Service Team.		
Effort of Implementation	Minor Procedural		

Physical Protection

2025-03	Replacement/Cleaning of Concealed Sprinkler Plates		
Status	New	Issue Date	30-Oct-2025
Priority	Priority 2	Type	Fire Protection System Operation
OFI Issued By	[CONSULTANT]		
Description	Cover plates should not be painted over as this will affect the temperature rating of the cover plate. This may then result in the delayed activation of the sprinklers in times of fire.		
Observation	Concealed sprinkler cover plates were found to be painted over.		
	<i>Sprinkler Cover Plates Painted Over at Retail Area</i>		
Client's Response	As per email on 27 Feb 2026, replacement of the sprinkler cover plates is typically done whenever there is work in the affected areas. There are plans to replace all affect sprinkler cover plates under a one-time exercise within 3 months.		
Effort of Implementation	Minor Capital		


Section 4

Risk Quality Ratings and Comments


Main Category	Current Score	Potential Score
External Exposure	9	9
Fire Protection	8	8
Occupancy Hazards	9	9
Construction	8	8
Water Supply	10	10
Surveillance	8	8
Management Programs	7	8
Location Risk Quality Score	83.0	86.8
Location Risk Quality Rating	B	A

Rating Legend
A: 85 to 100
B: 70 to 84
C: 51 to 69
D: 36 to 50
E: 0 to 35


RQR SCORE BENCHMARKING

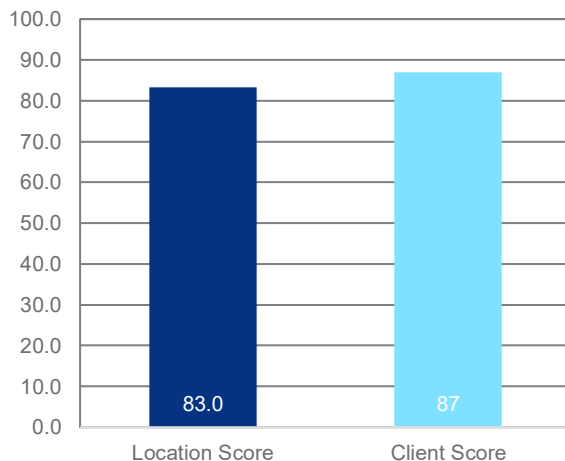

CURRENT RISK QUALITY SCORE VERSUS % POTENTIAL

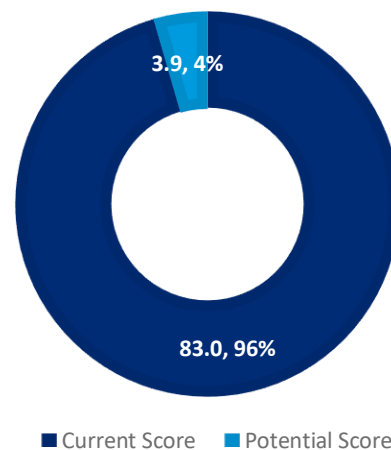

RISK QUALITY RATING CATEGORY SUMMARY

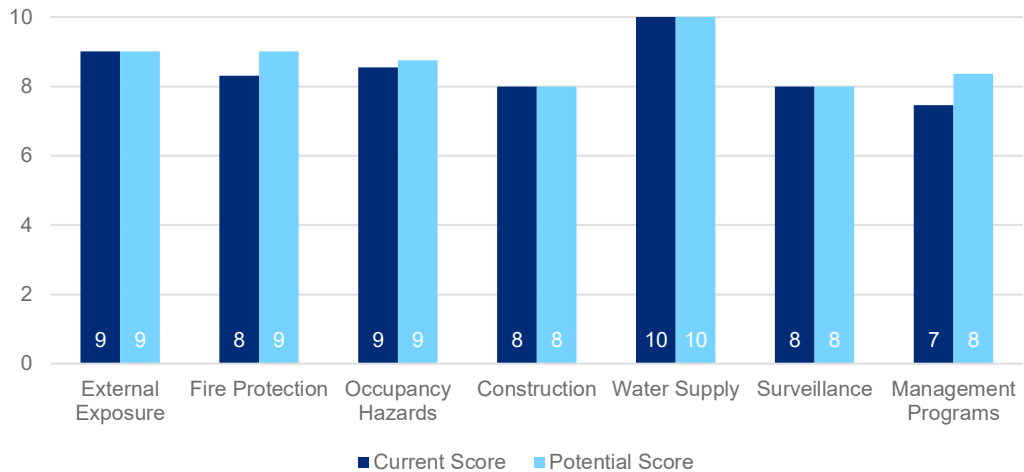

Risk Quality Rating Comments

The positive points which comes out from the visit are following:

- Buildings were constructed of fire resistive construction materials
- The retail mall is provided with automatic sprinkler system and the entire building is provided with a fire alarm system.
- Preventive maintenance programmes are in place for fire protection and detection equipment.
- Good redundancy is available for critical utilities.
- Good housekeeping observed for most areas visited.

Section 5

Loss Estimates

The Loss Estimates presented here are believed to be reasonable, based on industry experience, events postulated, and information provided by the client. The calculation of Loss Expectancies is based on the review of building construction, operations, fire protection systems, and fire protection features at the time of our assessment. The estimates are further based on conditions observed at the time of the visit. By their nature, these estimates contain some element of subjectivity. Accordingly, the estimates cannot be taken as absolutes and could be exceeded due to changes in physical conditions on site, or the initiating event or escalation being more severe than anticipated within the boundaries of the estimate.

All damage and loss potential figures presented pertain exclusively to primary property damage, associated contents damage, and associated business interruption recovery time loss, caused directly by (fire or explosion) as defined in our Loss Estimate.

Values

Date of Values: 2025		Currency: SGD	
Property Damage (PD) Values		Business Interruption (BI) Time Element (TE) Values	
PD Value for Location 1 [[AREA], [PROPERTY], [LOCATION] [POSTAL] (inclusive of Level 55 and 56 of The [AREA] Residences)]	[VALUE]	BI Value for [PROPERTY], [PROPERTY], [LOCATION] [POSTAL] (inclusive of Level 55 and 56 of The [AREA] Residences) <i>Indemnity Period (months)</i>	[VALUE]
PD Value for Location 2 [Throughfare linkway between [PROPERTY] and [PROPERTY]]	[VALUE]	BI Value for Throughfare linkway between [PROPERTY] and [PROPERTY] <i>Indemnity Period (months)</i>	[VALUE]
Total Reported Site PD	[VALUE]		
Total Insurable Values (TIV) / Total Sums Insured (TSI)			[VALUE]

These values are provided by the client unless otherwise specified. Unless stated differently the PD values are assumed to be Replacement Cost Values (RCV), and the financial numbers are deemed to be for a fiscal year.

Loss Estimate Definitions

Level	Definition
Level I	<u>Primary Protection Systems are functioning and manual firefighting available</u> A loss event in which damage is based on the nature of hazards and construction factors, and where: • All fire protection systems are in service and functioning as designed. • Full facility Industrial Fire Brigade (Or Plant Emergency Organization) and Municipal Fire Department response expected. • Credit is given to all properly maintained fire barriers up to their design duration rating • Construction features function as designed.
Level II	<u>Primary Protection Systems are not functioning. Manual firefighting response only</u> A level II Loss Event is one which occurs when: • The fire protection system protection the area with the largest PD / BI potential is impaired or is rendered inoperative or ineffective due to the nature of the event. Adjacent fire protection systems are presumed operational unless rendered inoperative or ineffective due to structural failure. Same applies for the use of special extinguishing systems. • Credit can be given for adequate manual emergency response, defined as: — A responding organization that is trained to address the hazards of the facility being evaluated. — Can arrive on site within a reasonable time of being notified to be effective in reducing or limiting impact. — Has up to date preplans or emergency response plans for the facility. • Credit given to minimum adequately maintained (including fire doors and fire penetrations) 3 hour rated walls where the combustible loading is light to ordinary, structural failure is not expected, and roof assembly is a listed or approved noncombustible. • Combustible roof construction (including combustible or unknown metal deck assemblies) results in a contiguous structure loss. Damage may be limited to the area where the impaired protection system is located and the nearby surroundings or may extend to the nearest adequate separation or properly designed and approved construction cutoffs, depending on site conditions.
Level III	<u>Fire Protection Systems are not functioning and no manual firefighting response</u> A level III Loss Event is one which occurs when: • All fire protection systems throughout the entire site or facility are impaired. • No credit is given for manual emergency response. • Damage is limited only by adequate separation and/or free-standing 4-hours rated firewalls or equivalent. (Equivalencies must be well defined and proven.) • Combustible roof construction (including combustible or unknown metal deck assemblies) results in a contiguous structure loss. The size of this loss can approach the value of the buildings of origin or an entire facility, depending on site layout.

Property – Level I Loss Estimate

Normal Loss Expectancy

Definition	Definition: Primary Protection Systems are functioning and manual firefighting available
Scenario	The NLE scenario is a fire originating from back-of-house storage area of one of the retail store at B4 after operating hours due to fault in electrical fixture/equipment, etc. Fire water damage from automatic sprinklers and manual fire-fighting by emergency responders will be sustained on B4. No structural damages expected due to prompt activation of the sprinkler system and manual response.
Assumptions	Using the sprinkler's area of operation (OH3), direct fire damage area is up to 216m² and some water damage is expected. The PD NLE is estimated to be 0.5% of property damaged sum insured value for the retail mall. It will take about 1 week for clean-up and fire investigation and structural review of the building by local authorities. It will take up to 3 weeks for full reinstatement of the damaged / affected areas. 50% of B4 will not be operational during these 4 weeks.
Limitations	There is no detailed breakdown of PD and BI values.

Property Damage	Value (SGD)	% Damage	Property Damage (SGD)
PD Value for Location 1 [PROPERTY], [PROPERTY], [LOCATION] [POSTAL] (inclusive of Level 55 and 56 of The [AREA] Residences)]	[VALUE]	0.5%	[VALUE]
PD Value for Location 2 [Throughfare linkway between [PROPERTY] and [PROPERTY]]	[VALUE]	0%	[VALUE]
Total Property Damage Loss			3,777,259

Business Interruption	Duration	Duration Units	% Impacted	BI Loss (SGD)
Recovery time	[VALUE]	weeks	50% of B4	[VALUE]
Total Business Interruption Loss				[VALUE]

Business Interruption	Duration	Duration Units	% Impacted	BI Loss (SGD)
-----------------------	----------	----------------	------------	---------------

Total Level I Property Loss Estimate (SGD)
[VALUE]

Property – Level II Loss Estimate

Probable Maximum Loss

Definition	Definition: Primary Protection Systems are not functioning, Manual firefighting response only
Scenario	The PML scenario is a fire originating from back-of-house storage area of one of the retail stores at B4 after operating hours due to fault in electrical fixture/equipment, etc. In the absence of automatic sprinkler system, the fire will reach a fully grown state and spread horizontally throughout B4 via continuity of combustibles and absence of fire compartmentation. Vertical fire spread to upper floors is expected. Fire is expected to then be controlled by CERT and responding fire brigade.
Assumptions	The PD NLE is estimated to be 50% of property damaged sum insured value for the retail mall. It will take about 1 month for clean-up and fire investigation and structural review of the building by local authorities. It will take up to 6 months for full reinstatement of the damaged / affected areas. 50% of the whole retail area will not be operational during this time these 7 months.
Limitations	There is no detailed breakdown of PD and BI values.

Property Damage	Value (SGD)	% Damage	Property Damage (SGD)
PD Value for Location 1 [PROPERTY], [PROPERTY], [LOCATION] [POSTAL] (inclusive of Level 55 and 56 of The [AREA] Residences)]	[VALUE]	50%	[VALUE]
PD Value for Location 2 [Throughfare linkway between [PROPERTY] and [PROPERTY]]	[VALUE]	50%	[VALUE]
Total Property Damage Loss	[VALUE]		

Business Interruption	Duration	Duration Units	% Impacted	BI Loss (SGD)
Recovery time	[VALUE]	months	50% of retail	[VALUE]
Total Business Interruption Loss				[VALUE]
Total Level I Property Loss Estimate (SGD)				[VALUE]

Property – Level III Loss Estimate

Maximum Foreseeable Loss

Definition	Definition: Fire Protection Systems are not functioning and no manual firefighting response
Scenario	The MFL scenario is a fire originating from back-of-house storage area of one of the retail stores at B4 after operating hours due to fault in electrical fixture/equipment, etc. In the absence of sprinkler protection and lack of 3 hour rated fire doors / shutters, the fire will reach a fully grown state and spread throughout the retail area and condominium via the continuity of combustibles and absence of fire compartmentation. As per MFL Loss Estimate definition, fire protection systems for the buildings are impaired and does not give any credit to manual emergency response. However, public fire brigade in [LOCATION] is very reliable and typical respond time is 10 minutes. Instead of no manual emergency response, the local fire brigade is assumed to be severely delayed.
Assumptions	MFL is estimated to be 80% of the sum insured of the whole property. It will take about 2 months for the clean-up, investigation and structural review of the building by local authorities, and up to 16 months for full reinstatement of the damaged areas. The building will not be operable for 18 months.
Limitations	There is no detailed breakdown of PD and BI values.

Property Damage	Value (SGD)	% Damage	Property Damage (SGD)
PD Value for Location 1 [PROPERTY], [PROPERTY], [LOCATION] [POSTAL] (inclusive of Level 55 and 56 of The [AREA] Residences)]	[VALUE]	80%	[VALUE]

Property Damage	Value (SGD)	% Damage	Property Damage (SGD)
PD Value for Location 2 [Throughfare linkway between [PROPERTY] and [PROPERTY]]	[VALUE]	80%	[VALUE]
Total Property Damage Loss			[VALUE]

Business Interruption	Duration	Duration Units	% Impacted	BI Loss (SGD)
Recovery time	[VALUE]	months	100%	[VALUE]
Total Business Interruption Loss				[VALUE]
Total Level III Property Loss Estimate (SGD)				[VALUE]

Section 6

Management Programs

Our site visit, interviews and review of information provided leads us to the following maturity assessment of Management Programs in place to manage the risks at the location.

Program Category	Maturity	Comments
Building Maintenance	Embedded	The buildings were noted to be in good condition. Structural inspection of the buildings will be conducted once every 5 years by appointed professional civil engineer with report submitted to the local authority, BCA.
Electrical Maintenance	Embedded	Planned preventive maintenance programme with predictive elements included. Inspection, testing and maintenance are conducted by third party electrical contractors and Licensed Electrical Workers (LEWs). Maintenance activity includes, but not limited to the following: • Annual IR thermography scanning for LT switchboards, electrical DBs and electrical risers • Annual shutdown maintenance • Annual partial discharge test for transformers and HT switchboards • Annual dissolved gas analysis for transformers • Annual load test of diesel generator sets • Monthly no-load test of diesel generator sets by in-house technicians • Quarterly maintenance of diesel generator sets • Annual lightning protection test
Equipment Maintenance	Embedded	Maintenance of equipment such as air handling units are being carried out by in house contractors as per manufacturer's recommendation.
Fire Protection Impairment Management	Formalized	Fire protection impairment is currently managed via isolation. An OFI has been raised to formalize a fire protection impairment programme.

Fire Protection System Maintenance & Testing	Embedded	A service contract with Chubb is in place for the servicing of fire protection equipment. Detailed inspection, testing and maintenance of fire protection systems as follows: • Annual flow switch test • Monthly fire pump servicing and test run • Monthly testing of smoke detectors (100% covered monthly) • Monthly testing of fire rated roller shutters
Hazardous Materials Handling	Embedded	There are two diesel generator sets on Level 8. Each of the generator sets have a 1000L day tank. The top up is done manually during the annual servicing if the day tank level is low. The storage of the diesel strictly complies with the Petroleum and Flammable Materials License governed by [LOCATION] Authority, [LOCATION] Civil Defence Force (SCDF).
Housekeeping	Embedded	Housekeeping is generally good in most areas inspected.
Hot Work Permit System	Formalized	Hot work permit system is available with relevant documents such as risk assessment and method of statement to be submitted to obtain approval. In the hot work checklist, there is requirement for combustibles to be cleared within 4m of the work area. This is a smaller clearance than recommended in NFPA (11m). However, it was explained that it is due to the space constraints in the stores where hot work typically occurs and additional measures are required such as fire blankets for all hot work. An OFI has been raised to enhance the hot work permit system by including fire watchman after completion of hot work.
Management of Change	Embedded	Management of change usually involves the different stakeholders with risk assessment conducted.
Pre-Emergency Planning	Embedded	Emergency response plans/procedures have been established for various plans/procedures have been established

		for various scenarios including fire, bomb threats and pandemic. A 6-man emergency response team including 1 site management controller, 1 site incident controller and 4 Emergency Response Team (ERT) members comprising of the technicians and security guards is established for both day and night shift. There are 2 fire evacuation drills and tabletop exercises carried out annually.
Self-Inspections	Embedded	A daily inspection is carried out by Executives and Technicians while weekly inspection is carried out management. Findings are sent to the team's WhatsApp group to be tracked and closed.
Smoking Controls	Optimized	Smoking is prohibited on compounds. Smoking control is well implemented with no casually discarded cigarette butts observed during the visit.
Contractor Management	Embedded	All contractors are required to go through a safety briefing to carry out any work.
Business Continuity Planning	Embedded	Business Continuity Plans have been established at corporate level.
Environmental, Social & Governance (ESG)	Optimized	[PROPERTY] obtained Building and Construction Authority (BCA) Green Mark Gold certification.

In assessing the maturity of the Management Programs the following maturity scale was applied:

Maturity Rank	Definition
Undeveloped	Informal actions with little or no systematic procedures.
Formalized	Programs and procedures are established. Full familiarity is uncertain.
Established	Programs and procedures are communicated throughout the organization. Orientation is ongoing.
Embedded	Ownership is established at most or all organizational levels. Training and some exercises is conducted.
Optimized	Full ownership with active program maintenance, testing, exercising and continuous improvement.

Management Program Comments

Overall, based on site discussion and observation, the site has established good management procedures/policy and fulfilling local regulatory requirements.

Section 7

Construction

Construction Narrative

[PROPERTY] which was opened in 2009, is connected to the [AREA] MRT station via a basement connection and to other surrounding shopping malls via the [PROPERTY]. The building has a site area of 21,731 m², gross floor area (GFA) of 125,621 m² and net lettable area (NLA) of 58,340 m². [AREA] Residences has GFA of about 35,000 m².

The buildings are generally constructed from reinforced concrete structures (columns, beams and floor plates), steel structures with fireproofing spray coating (column and beams) and reinforced concrete flat roof. Internal partition walls are constructed of either dry wall partition or light weight concrete panels. The retail mall exterior wall is mainly constructed of reinforced concrete or glass panels mounted on a steel frame with a fully three-dimensional free form curvilinear glass and metal façade. The residences areas have exterior wall constructed of reinforced concrete or curtain glass mounted on a steel frame. Therefore, the whole building is considered to be of non-combustible construction.

Construction Table

A summary of the buildings as follows:

Building	# Stories	Roof Const.	External Wall	Floor Const.	Column	Comb. / Non Comb.	% Sprinklered
Retail	B4 – L4	RC	RC or Steel Frame with Glass Panels	RC	RC, Steel	Non Comb	100%*
Residences	L9 – L54	RC	RC or Steel Frame with Glass Panels	RC	RC	Non Comb	100%*

Bldg – Building, RC – Reinforced Concrete, Comb – combustible, * - excluding electrical rooms and utility risers.

Compartmentalization and Fire Divisions

There is vertical communication throughout Level 1 to Level 5 of the retail mall, thus, Level 1 to 5 can be considered as one fire compartment. The basement levels of the retail mall have 2-hour fire rated fabric fire shutters, which are activated by the fire alarm system, at all the void areas such as the basement atriums and escalators. This makes each basement level of the retail mall one fire compartment, except for the utility rooms.

There are 4-hour fire rated roller shutters at all the entrances to the MRT station as well as at all the connections between the neighbouring malls such as [PROPERTY] and [PROPERTY]. Access to the residences is separated from the retail area with a brick wall, however, it is unknown if that separation is fire rated.

Electrical equipment rooms (high-tension switchgear, low-tension switchgear, transformer, etc.) are fire compartmented via 2-hour fire-rated access doors.

Section 8

Occupancy, Hazards, and Utilities

Occupancy

Overview

[PROPERTY] & The [AREA] Residences, which opened in 2009 and 2010 respectively, is a 56-storey residential and commercial development with 3,000 m² of public event space. The mall has a diverse mix of about 300 international and local brands across the luxury and necessity retail segments while the condominium houses 175 units.

Below table presents some of the key occupancies:

[PROPERTY]	
Floor	Occupancy
Basement 4 – Level 5	Retail Mall
Basement 1	MDF room
Level 1	Fire Command Centre (FCC)
Level 2	Transformer room
Level 3	LT Switchroom
Level 5	Carpark, domestic/Booster pump room
Level 6	Carpark, chiller room, HT switchroom, sprinkler/hosereel pump room, lift motor room, workshop
Level 7	Carpark, LT switchroom, chiller room
Level 8	Carpark, cooling tower, generator set
Level 9	Lift motor room
Level 30	Firewater transfer pump room
Level 9 – 54	[AREA] Residences
Level 55	Restaurant (One Atico), Sprinkler/hosereel pump room, LV switchroom, [PROPERTY]
Level 56	Lift motor room, [PROPERTY]

Key Processes

Activity / Processes	[PROPERTY] is the managing agent for the entire ION property under Management Corporation Strata Title (MCST) No. [VALUE]. The retail area and residences are divided into Sub 1 and Sub 2. Sub 1 is managed by [PROPERTY] Investment Pte Ltd while Sub 2 is managed by [MANAGEMENT] Group Inc.
Employee / Operating Hours	There are 3 property executives and 1 property manager managing [PROPERTY]. The technicians operate in 3 shifts – 7am to 4.30pm, 1pm to 10.30pm and 10pm to 7.30am. For the first two shifts, there are at least 3 technicians, with 1 outsourced. For the night shift, there are at least 4 technicians, with 3 outsourced. The outsourced technicians are engaged from third party company, Evergreen Engineering Pte Ltd.
Tenanted areas	Retail spaces are about 98% occupied.
Common Hazard	Common property hazards for such occupancy include fire arising from faults in electrical equipment / fixtures, and water damage arising from wet-pipe sprinkler actuation or chilled/domestic water pipe leaks/bursts. Most of the common property hazards are well managed. Preventive and predicative electrical maintenance such as IR thermography are conducted by appointed electrical contractors.
Special Hazards	There are two diesel generator sets on Level 8. Each of the generator sets have a 1000L day tank. The top up is done manually during the annual shutdown if the day tank level is low. There is no bulk diesel tank on the property. The storage of the diesel strictly complies with the Petroleum and Flammable Materials License governed by [LOCATION] Authority, [LOCATION] Civil Defence Force (SCDF).
Kitchen Operations	There are multiple F&B establishments throughout [PROPERTY]. The establishments which require exhaust system due to greasy cooking are required to clean the carbon media filter quarterly and send the reports to the tenancy team. Common exhaust ducts and fans are cleaned annually by the contractors appointed by the facility team.

Utilities and Infrastructure

Power

Site Feed	SP PowerGrid substation through 2 incoming feeders								
Incoming Voltage	22kV								
Distribution on Site	Underground cables								
Details	From the incoming 22kV incoming feeders, the power is distributed via the HT switchroom at Level 6. The power is then stepped down by 10 transformers and distributed via the LT switchrooms at Level 3 and Level 7.								
Back-up Power	Backup power for essential services (lifts, fire pumps, FCC equipment) within the development is provided via diesel generator sets to maintain essential and life safety equipment of the property. The details of the generator sets are as below: <table><tr><th>Area Served</th><th>Quantity and Rating</th><th>Model</th><th>Location</th></tr><tr><td>[PROPERTY]</td><td>2 X 880KVA</td><td>EN-SYST EN800P50CQS</td><td>Level 8</td></tr></table>	Area Served	Quantity and Rating	Model	Location	[PROPERTY]	2 X 880KVA	EN-SYST EN800P50CQS	Level 8
Area Served	Quantity and Rating	Model	Location						
[PROPERTY]	2 X 880KVA	EN-SYST EN800P50CQS	Level 8						

Transformer details

There are a total of 10 silicon oil-filled transformers. 7 located outdoors on Level 8 and 3 located in level 2 transformer room. The transformers have estimated load of 25 to 30%.

Location of Transformer	Manufacturer/Type	Rating	Pri/Sec
Level 8	ABB/Silicon Oil filled	4 X 3 MVA	22 kV / 433V
Level 8	ABB/Silicon Oil filled	3 X 2.5 MVA	22 kV / 433V
Level 2 Transformer Room	ABB/Silicon Oil filled	3 X 2.5 MVA	22 kV / 433V

The transformers on Level 2 can back each other up while the transformers on Level 8 can back each other up.

Boilers

No boilers are installed for this property.

Refrigeration / Chillers / Cooling towers

There are 5 X 1000RT and 2 X 500RT chillers located in the chiller room serving the whole building. During the day (after 9am), typically 3 X 1000RT will be running and the peak load is about 2400 – 2600RT. During the night (after 10pm), the chillers are typically not running and will only cut in if the temperature rises above a certain temperature.

There are 7 cooling towers – 5 X 1000RT and 2 X 500RT, supporting the chillers. During the day, 5 X 1000RT will be running at about 50 – 60% capacity while 2 X 500RT will be running during the night. The cooling towers are located at the same area on Level 8.

Fuels and energy supplies

There are two diesel generator sets on Level 8. Each of the generator sets have a 1000L day tank. The top up is done manually during the annual shutdown if the day tank level is low. There is no bulk diesel tank on the property.

Section 9

Fire Protection

Automatic Sprinkler Protection

Automatic sprinklers in [PROPERTY] are installed as follows:

Area Protected	System Type	Design Standard Applied	Assessment
B4 – L8	Wet	CP52: 2004, OH III (30m) (5mm/min, 216 m ²)	Adequate
L55 – L56	Wet	CP52: 2004, OH I (15m) (5mm/min, 72 m ²)	Adequate

Comments

Automatic sprinkler systems are provided from Basement 4 to Level 8, Level 55 and 56 with the exception of electrical equipment rooms and riser compartments. The sprinkler system is primarily designed and installed to local code, CP52:2004 (Code of Practice for Automatic Fire Sprinkler System). Tenanted areas have in room sprinklers as well as sprinklers in the false ceilings.

Special Extinguishing Systems

Wet Chemical Suppression System

The kitchen hoods of F&Bs are protected by kitchen hood fire suppression system (wet chemical suppression system). Maintenance of the system is by the respective tenants. The wet chemical system installed by tenants is not connected to the building's main fire alarm panel.

Water Supply Details

Sprinkler system in [PROPERTY] is supplied by 2 sprinkler pump sets and transfer pumps. The transfer pumps, duty pumps, standby pumps and jockey pumps are electric motor driven and provided with emergency backup power via the building generator set. All fire pumps are PSB listed. Pump capacity and head information were not available at the time of the visit.

Refer to the table below for details of fire pumps:

Fire Pump Room	Area Served	Manufacturer	Pump	Cut in Pressure (psi)	Cut out Pressure (psi)
Level 6 Fire Pump Room	B4 to L8	Allen Gwynnes	Duty Pump	70	Manual
		Allen Gwynnes	Standby Pump	60	Manual
		Grundfos	Jockey Pump	75	80
Level 55 Fire Pump Room	Level 55 to 56	Allen Gwynnes	Duty Pump	35	Manual
		Allen Gwynnes	Standby Pump	30	Manual
		Allen Gwynnes	Jockey Pump	50	70

Refer to the below table for information regarding the fire water tanks:

Sprinkler Tank Location	Area Served	Material	Volume
Level 6 Tank Room	Level 6 Fire Pump Room	Stainless Steel	126 m ³
Level 55 Fire Pump Room	Level 55 Fire Pump Room	Reinforced Concrete	77 m ³

Pump Flow Test Data

Fire pump performance test was not observed during the site survey. However, as part of the annual fire certificate renewal, water proving tests are conducted and results are submitted to local fire authority. Based on water proving test, there are no notable issues noted.

Manual Firefighting Features

Distance to Fire Department	3.0km
Response Time (minutes)	Within 10 minutes
Hydrant Coverage	Public hydrants are available along the main roads at the entrance of the building.
Fire Hydrant Type	Above ground.
Industrial Fire Brigade	No.
Portable Extinguishers	Strategically located through building as per local code.
Hose Stations / Reels	Interior and strategically located through building as per local code.

Other Manual Firefighting Comments

Street hydrants are drawing water directly from the public water supply which is considered as very reliable in [LOCATION].

Fire Alarm Monitoring

- Spot-type smoke detectors are installed in all electrical equipment rooms such as HT and LT rooms and transformer room, electrical risers, telephone/data risers, lift motor rooms, etc.
- Beam detectors are provided at the top of the two void areas on Level 4 retail atrium.
- Manual break glass call points with fire alarm bells are installed at strategic locations throughout the development.
- Building fire alarm systems are monitored 24/7 both locally in a constantly attended central fire command centre and via a decentralized alarm monitoring (DECAM) which is managed by third party company, Chubb.

2) Alarm Signaling Services	The main fire alarm panels are located in the constantly manned Fire Command Centre (FCC) located on Level 1. The fire alarm signal is monitored by appointed third party vendor, known as De-centralised Fire Alarm Monitoring (DECAM) services. The DECAM system is manned by Chubb. Usually within a timeframe of two minutes or shorter, the local fire brigade will be notified via DECAM services if there is no response by the local site on any fire alarm signal received.			
Fire Panel Model / Manufacturer	Algo-Tec 6500/Protec – Addressable Fire Alarm Panel			
Alarm Signals Monitored	☒ Water-flow	☒ Valve Tamper	☐ Building Temp	☐ DPV Supervisory
	☒ Smoke Detection	☒ Pull Stations	☐ Heat Detection	☐ Special Ext. Sys.
	☒ Pump Running	☒ Pump Trouble	☒ Tank Level	☐ Tank Temperature
	☐ Intrusion	☐ Other		

Section 10

External Exposures

Location Details

Latitude	
Longitude	
Point where geo coding was taken	Google Earth
Ground Elevation (above mean sea level)	46m
Ground Elevation Source	Munich Re's NATHAN
Building Finished Floor Elevation (above mean sea level)	0.5m higher than public road based on site observation

Boundary Exposures

Direction	Exposure Rating	Distance	Comments
North	Light	10m	Shopping Mall ([PROPERTY]) connected via underground pedestrian link
East	Light	10m	Shopping Mall ([PROPERTY]) connected via underground pedestrian link
South	Light	10m	[AREA] MRT Station (underground) connected via underground pedestrian link
West	Light	10m	Shopping Mall ([PROPERTY]) connected via underground pedestrian link

Natural Catastrophe Exposures

Based on Munich Re's Risk Suite (NATHAN – Natural Hazard)

NATHAN Hazards	Score	Low Hazard	High Hazard
 Earthquake	● Zone 0 MM V and below	0	
 Volcanoes	● No Hazard	-1	
 Tsunami	● No Hazard	-1	
 Tropical Cyclone	● No Hazard	-1	
 Extratropical Storm	● No Hazard	-1	
 Hail	● Zone 2		2
 Tornado	● Zone 1 0.1 – 0.5 (per 10.000 km ² and year)	1	
 Lightning	● Zone 5 20.1 – 40.0 (per km ² and year)		5
 River Flood (Defended)	● Zone 0 minimal flood risk	0	
 Flash Flood	● Zone 4		4
 Storm Surge (Defended)	● No Hazard	-1	
 Wildfire	● No Hazard	-1	

Peril	Source	Exposure Rating	Comments
Pluvial Flood (Heavy Rain / Flash Flood)	MunichRe NATHAN	Low	Moderate exposure per Munich Re's NATHAN risk suite. Localized flash flooding due to heavy rainfall and storm water accumulation is a possibility, with the site situated within a NATHAN flash flood hazard Zone 4 (zones range from 1 to 6, with 6 being the most severe). The building is expected to be compliant with local codes/regulations with regards to flood

Peril	Source	Exposure Rating	Comments
			mitigation and not listed as floor prone area.
			[PROPERTY] entrance is elevated from ground level. Sump pumps are available at the basement levels and flood barriers are installed at the ground level of the ION Link to Tangs. Flood sensors are also provided at [PROPERTY] Link to alert the command centre once the water level has reached a critical level. Testing for the flood barriers and flood sensors is carried out annually together with PUB. Based on the above, the exposure is considered low.
Hail	MunichRe NATHAN	Low	Per Munich Re's NATHAN risk suite, a low frequency and intensity of hailstorms is anticipated at the site.
Tornado	MunichRe NATHAN	Low	Buildings are of robust (reinforced concrete) construction which is expected to provide for wind loading.
Tropical Cyclone	MunichRe NATHAN	No Hazard	
Extra-Tropical Storm	MunichRe NATHAN	No Hazard	
River (Inland) Flood	MunichRe NATHAN	Low	The nearest river ([LOCATION] River) is located about 1.3km away. The exposure to river flood is expected to be low.
Storm Surge / Coastal Flooding	MunichRe NATHAN	No Hazard	
Tsunami	MunichRe NATHAN	No Hazard	
Lightning	MunichRe NATHAN	Moderate	As per Munich Re's NATHAN risk suite, there is a moderate to high exposure to lightning with 20.1 to 40.0 lightning strokes per sq. km. per year. Lightning presents a source of ignition and can cause electrical power surges which may damage and disrupt power supply

Peril	Source	Exposure Rating	Comments
			systems. The building is provided with an extensive lightning protection system.
Earthquake	MunichRe NATHAN	Low	[LOCATION] is not situated near any major tectonic plate boundaries, resulting in low exposure to earthquake. However, [LOCATION] do occasionally experience tremors due to earthquakes that happens in the region. Per Munich Re's NATHAN risk suite, the site is situated within an area with a probable maximum earthquake intensity of Modified Mercalli Intensity (MMI) V and below based on a return period of 475 years for medium subsoil conditions.
Volcanic	MunichRe NATHAN	No Hazard	
Wild Fire	MunichRe NATHAN	No Hazard	
Other	MunichRe NATHAN	Low	For underground soil condition, it is classified as stiff soil and there are no signs of soil subsidence at the time of the visit.

Section 11

Security

Site Perimeter

Vehicle Access	Yes, retail carpark is accessible by public.
Perimeter Fencing	No, accessible by public.
Entry Provisions Posted	Yes, at restricted areas.
No Trespassing Signage	Yes, at restricted areas.
Fencing Height	Not applicable.
Exterior Lighting	Generally provided via external lamp/light posts and access road streetlamps throughout the site compounds; these are activated during the night.

Building Physical Features

Ground Level Windows Secure	NA
Lock and Key Control	Critically utility rooms such as fire pump rooms and transformer rooms are secured by lock and key control and RFID card access.

Security Staff / Guards

On-Site Guards	Guards, provided by in-house security team and accredited security company, Prosegur [LOCATION] Pte Ltd. Guards are unarmed and work in 3 shifts – 7.30am to 7.30pm, 7.30pm to 7.30am and 10pm to 8am. For the 7.30am to 7.30pm and 7.30pm to 7.30am shift, there are 2 unarmed guards. For the 10pm to 8am shift, there are 5 unarmed guards. Serviced residences ([AREA] Residences) have their own security team. Information was not available at the time of the visit.
Visiting Patrols	Regular patrol is expected to be conducted by [LOCATION] Police Force (SPF) in the vicinity.
Police Surveillance	No
Recorded Rounds	Yes.
Rounds Frequency	1 round per night shift. 1 virtual round and 1 physical round around the carpark per day shift.

Security Staff / Guards

CCTV	About 500 fixed CCTV cameras, including 10 PTZ CCTVs around the mall perimeter, installed with recordings kept for at least 45 days. The CCTVs have video analytics installed which traces movement of identified personnel using facial recognition. There is also intrusion alerts installed at three entrances – 24hr walkway at Basement 2, MRT entrance at Basement 1 and office entrance. Information regarding CCTV installed at residence side was not available at the time of the visit.
-------------	--

Intruder Detection

Motion Sensors	No.
Door Contacts	Yes. Alarm for EM locks at critical utility rooms and staircases will be sent to the security room if doors are left open for a set period of time.
Access Monitored	Yes, all contractors need to register before entry. After mall operation hours (10am – 10pm), all the entrances will be closed via physical locks and entry will only be allowed through the loading bay or the L1 lobby B. The contractors will need to go to the command centre and have their name registered in the in the PTW system before being allowed to carry out any works.
ID Cards / Badges	Yes, ID cards are required to enter facility.

Other Security Programs / Controls

Emergency Response	Documented emergency response plan has been established. A 6-man emergency response team including 1 site management controller, 1 site incident controller and 4 Emergency Response Team (ERT) members comprising of the technicians and security guards is established for both day and night shift. There are 2 fire evacuation drills and tabletop exercises carried out annually.
Employee Screening	Yes, conducted as part of the employment process.
Safe / Vaults	No safe / vaults available.
Mobile Equipment Storage	Not expected.
Bomb Threat	Detailed instructions are expected to be covered in the security plan. Exercise mock tests are carried out annually.
Cash / Check Management	Not expected.

Section 12

Business Interruption

Site

Business Features	Retail operations
Rebuilding Time	It will take about 18 months to rebuild the whole building.
Available Alternatives	N.A.
Denial of Access	No.

Operations, Plant & Processes

Operational Features	Refer to Section 8 Occupancy
Seasonality of Operations	N.A.
Bottlenecks	N.A.
Available Alternatives	N.A.
Critical Spares	Most critical spare parts are expected to be available. Else, vendors for critical equipment can be contacted for emergencies.
Subcontracting Options	N.A.
Special Licensing Issues	Not evaluated.
Research & Development	N.A.
Utilities, Infrastructure & Services	Critical utilities such as electricity and water supply are considered reliable.
IT / Communications Systems	N.A.
Critical Suppliers	N.A.
Key Customers	N.A.
Contractual Penalties	Not evaluated.

Business Continuity / Disaster Recovery Planning


Emergency Response Procedures	In the event of business interruption, there is a crisis communication plan and business continuity plan in place from
--------------------------------------	--

Business Continuity / Disaster Recovery Planning


	corporate. There are SOPs developed to outline actions to be taken for certain scenarios such as transformer breakdown or flood events.
Business Continuity Plans available?	Yes.
Scope / Strategy / Scenarios Covered	Business continuity strategies look into potential disruption within the premises.
Last Reviewed / Updated	Expected to be done annually
Last Tested / Exercised	TBA

Appendix A


Site Photos




Model of [PROPERTY]




Beam detectors at L4 Void Area




Beam detectors at L4 Void Area




Main Fire Alarm Panel




EV Charger Lots




EV E-stop button




L7 LT Switchroom




L6 Chiller Plant




L6 HT Switchroom




L6 Fire Pump Room




L8 Transformer Area




L3 LT Switchroom




L55 Fire Pump Room




Fire Sprinkler Pump Control Panel




L8 Diesel Generator Set



L8 Cooling Tower



L2 Transformer Room



L56 Lift Motor room



This document and any recommendations, analysis, or advice provided by [CONSULTANT] (collectively, the "[CONSULTANT] Analysis") are not intended to be taken as advice regarding any individual situation and should not be relied upon as such. The information contained herein is based on sources we believe reliable, but we make no representation or warranty as to its accuracy. [CONSULTANT] shall have no obligation to update the [CONSULTANT] Analysis and shall have no liability to you or any other party arising out of this publication or any matter contained herein. Any statements concerning actuarial, tax, accounting, or legal matters are based solely on our experience as insurance brokers and risk consultants and are not to be relied upon as actuarial, tax, accounting, or legal advice, for which you should consult your own professional advisors. Any modeling, analytics, or projections are subject to inherent uncertainty, and the [CONSULTANT] Analysis could be materially affected if any underlying assumptions, conditions, information, or factors are inaccurate or incomplete or should change. [CONSULTANT] makes no representation or warranty concerning the application of policy wording or the financial condition or solvency of insurers or reinsurers. [CONSULTANT] makes no assurances regarding the availability, cost, or terms of insurance coverage. Although [CONSULTANT] may provide advice and recommendations, all decisions regarding the amount, type or terms of coverage are the ultimate responsibility of the insurance purchaser, who must decide on the specific coverage that is appropriate to its particular circumstances and financial position.

Copyright © 2025 [CONSULTANT] USA Inc. All rights reserved.