



Confidential Inspection Report

LOCATED AT:
139 S. Edinburg Ave.
Los Angeles, California 90048

PREPARED EXCLUSIVELY FOR:
Eli Levy

INSPECTED ON:
Tuesday, May 13, 2025



Inspector, Jerry Holt
Brooke and Sons Inspections



Executive Summary

This is a summary review of the inspectors' findings during this inspection. However, it does not contain every detailed observation. This is provided as an additional service to our client, and is presented in the form of a listing of the items which, in the opinion of your inspector, merit further attention, investigation, or improvement. Some of these conditions are of such a nature as to require repair or modification by a skilled craftsman, technician, or specialist. Others can be easily handled by a homeowner such as yourself.

Often, following the inspector's advice will result in improved performance and/or extended life of the component(s) in question. In listing these items, your inspector is not offering any opinion as to who, among the parties to this transaction, should take responsibility for addressing any of these concerns. As with most of the facets of your transaction, we recommend consultation with your Real Estate Professional for further advice with regards to the following items:

PLUMBING SYSTEM - OTHER PLUMBING

FIRE SPRINKLERS


s-54: Yes - There is a fire sprinkler system installed. It is recommended that it be checked by a professional with appropriate experience.



PLUMBING SYSTEM - GAS SERVICE

CONDITION

s-72: Excessive rust and corrosion noted to portions of the gas line piping. Recommend that rust be cleaned off and gas pipe be painted. Gas lines should be protected from any form of damage or corrosion.


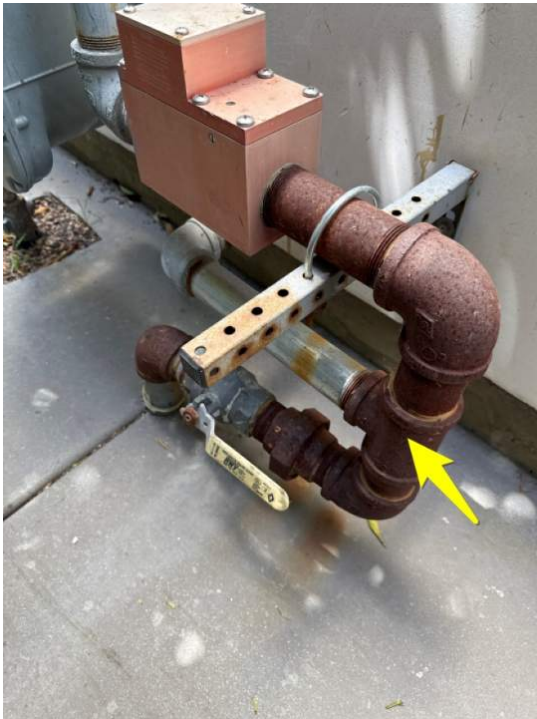


HEATING, VENTILATION & AIR CONDITIONING

HVAC 1 Downstairs

CONDENSATE LINE

s-115: Attention needed: Unit lacks a properly installed P trap and vent. Have technician conduct corrections.

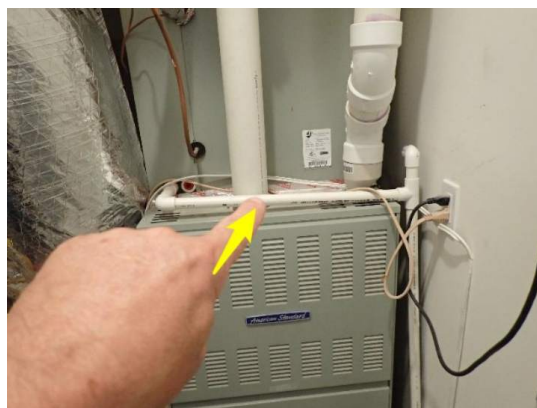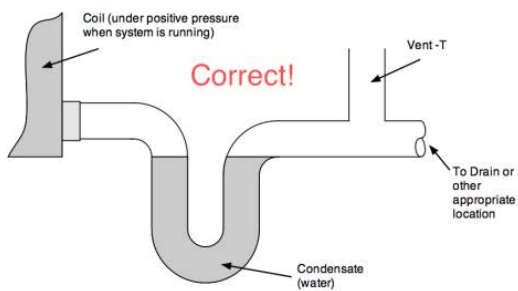

DUCTS CONDITION

s-116: Duct work in the crawl area is resting onto the soil. Duct work should be elevated at least 4 inches above dirt to prevent corrosion.



INTERIORS - FLOORS

TYPE/CONDITION

s-169: Attention needed: There are notable scratch marks and wear seen throughout areas of wood flooring. Refinishing may be needed



BATHROOM

BATHROOM 6

FAUCET

s-264: Attention needed: Sink fixtures hard to operate.
Adjustments needed.



NOTE

s-277: Attention needed: Some water staining noted under a few of the bathroom sink cabinets. Maintenance needed to insure plumbing drain lines are tightened and free from leaks to prevent possible water damage to cabinets.





SITE - SITE

TREES

s-295: Some trees and/or shrubs on the site need to be trimmed.



SITE - FENCES & GATES

GATES

s-306: Attention Needed - The gate or latch hardware needs repair to function as intended.



POOL, SPA & EQUIPMENT - LIGHT(S)

CONDITION

s-311: Pool light switch was not located during the inspection. Have the sellers demonstrate the proper operation of the pool light.

POOL, SPA & EQUIPMENT - PUMPING EQUIPMENT

CONDITION

s-313: Satisfactory however vegetation and debris removal around equipment needed



POOL, SPA & EQUIPMENT - POOL ENCLOSURE

CONDITION

s-327: Pool enclosure does not meet today's standards.

Those features are listed below. In California, the swimming pool or spa must be equipped with at least two of the following seven drowning-prevention safety features:

1. an enclosure that isolates the swimming pool or spa from the private single-family home;
2. removable mesh fencing that meets American Society for Testing and Materials (ASTM) Specification F2286 standards in conjunction with a gate that is self-closing and self-latching and can accommodate a key-lockable device;
3. an approved safety pool cover;
4. **exit alarms on the private single-family home's doors that provide direct access to the swimming pool or spa. The exit alarm may cause either an alarm noise or a verbal warning, such as a repeating notification that the door to the pool is open ;**
5. a self-closing, self-latching device with a release mechanism placed no lower than 54 inches above the floor on the private single-family home's doors, providing direct access to the swimming pool or spa;
6. an alarm that, when placed in a swimming pool or spa, will sound upon detection of accidental or unauthorized entrance into the water. The alarm shall meet and be independently certified to the ASTM Standard F2208 Standard Safety Specification for Residential Pool Alarms, which includes surface motion, pressure, sonar, laser, and infrared type alarms. A swimming protection alarm feature designed for individual use, including an alarm feature designed for individual use, including an alarm attached to a child that sounds when the child exceeds a certain distance or becomes submerged in water, is not a qualifying drowning prevention safety feature; and
7. other means of protection, if the degree of protection afforded is equal to or greater than that afforded by any of the features set forth above and has been independently verified by an approved testing laboratory as meeting standards for those features established by the ASTM or the American Society of Mechanical Engineers (ASME).



4. 5. 6. 7. Private Pools: All private pools shall be provided with a pool enclosure. To comply with the intent and the spirit of LABC Sections 3109 and 3119B, all new pool enclosures shall be a minimum of 5 feet in height and shall comply with the construction requirements of this section.

Additionally, for private swimming pools located at single-family homes, the construction of a new swimming pool or spa or the remodeling of an existing swimming pool or spa shall be equipped with at least two of the seven drowning prevention safety features as listed under Section 3109.2 of the LABC. Buildings (dwelling or accessory buildings) on the subject lot may be used as part of, or located within the pool enclosure, provided that at least (2) of the drowning prevention safety features specified under Section 3109.2 are provided for each building. Public Pools: All public pools shall provide a pool enclosure a minimum of 5 feet in height, which complies with the requirements of LABC Section 3119B and with the fence construction requirements of this bulletin. Construction Requirements: The fence shall meet all of the following requirements. a. The minimum fence height is measured on the side of the fence which faces away from the swimming pool as depicted in Figures 31B-4 and 31B-5 of the LABC for both public and private pools. Gates a. The maximum vertical clearance from the ground to the bottom of the fence shall be limited to two inches, measured on the side of the fence which faces away from the swimming pool. The outside surface of a fence shall be free of protrusions, cavities, or other physical characteristics that would serve as handholds or footholds, which renders the fence easily climbable for children 5 years of age and younger. Gaps or voids in the fence shall not allow the passage of a sphere equal to or greater than 4 inches in diameter. Where the fence is composed of horizontal and vertical members and the distance between the top of the horizontal members is less than 45 inches, the horizontal members shall be located on the swimming pool side of the fence. Spacing between vertical members shall not exceed 1¾ inches. Where there are decorative cutouts within vertical members, spacing within cutouts shall not exceed 1¾ inches in width. Where the fence is composed of horizontal and vertical members and the distance between the top of the horizontal members is 45 inches or more, spacing between vertical members shall not exceed 4 inches. Where there are decorative cutouts within vertical members, spacing within the cutouts shall not exceed 1¾ inches in width. Where the fence is composed of diagonal members, such as a lattice fence, the maximum opening formed by the diagonal members shall be no more than 1¾ inches. Construction of Gates: The method of construction for gates shall comply with Subsection 6 above. As a covered entity under Title II of the Americans with Disabilities Act, the City of Los Angeles does not discriminate on the basis of disability and, upon request, will provide reasonable accommodation to ensure equal access to its programs, services and activities. Angeles does not discriminate on the basis of disability and, upon request, will provide reasonable accommodation to ensure equal access to its programs, services and activities. For efficient handling of information internally and in the internet, conversion to this new format of code related and administrative information bulletins including MGD and RGA that were previously issued will allow flexibility and timely distribution of information to the public. Page 6 of 10 P/BC 2023-014 b. c. d. 8. Private

Pools: All access gates through the enclosure shall open away from the swimming pool and shall be self-closing with a self-latching device placed no lower than **60 inches above the ground**.

Driveway Gates: Driveway Gates are those gates across driveways. The Department may approve the use of Driveway Gates on a case-by-case modification, provided the following conditions are met: i. ii. iii. iv. v. The driveway gate shall be equipped with an electric gate operating device that is approved by a recognized electrical testing agency. The electric gate operating devices shall be provided with a safety mechanism to interrupt and recycle the device, should the gate become blocked. The electric gate operating devices shall be provided with a time delay closing device, which is set and maintained to activate a maximum of 20 seconds after the gate has been opened. No manual control or override mechanism shall be installed on or in connection with the gate operating device. The driveway gate shall open outward away from the pool or shall be a sliding gate.

Public Pools: All gates shall be equipped with self-closing and self-latching devices. The self-latching device shall be designed to keep the gate securely closed. Gates shall open outward away from the pool. Hand activated gate opening hardware shall be located at least 42 inches above the deck or walkway. All public pools shall provide a five-foot high pool enclosure, which complies with the requirements of LABC Section 3119B and with the fence construction requirements of Subsection 6 of Section IV of this bulletin.

Exit Alarm for Private Pool: The term Exit Alarm shall mean an approved device that makes audible, continuous alarm sounds when any door that permits access from the residence to the pool area, and is without any intervening enclosure, is opened or is left ajar. Exit alarms may be battery operated or may be connected to the electrical wiring of the building. All exit alarms shall be permanently attached to the door at a minimum height of 54 inches above the floor. Exit alarms shall not be permitted when they are attached to the door in a manner where it may be easily removed without the use of tools. The use of Velcro Alarms shall not be allowed. Velcro Alarms are those exit alarms attached to the door by use of velcro or selfadhesive. Exception: Exit alarms need not be required when the following conditions are met (unless the alarm is being used as (1) of the (2) required safety features per 3109.2): i. ii. Doors providing direct access from a building to the swimming pool are equipped with self-closing, self-latching devices with a release mechanism placed no lower than 54 inches above the floor, or The pool is equipped with an approved safety pool cover which is manually or power-operated and meets all of the performance standards of ASTM F 1346.

Tuesday, May 13, 2025
Eli Levy
139 S. Edinburg Ave.
Los Angeles, California 90048

Dear Eli Levy,

We have enclosed the report for the property inspection we conducted for you on Tuesday, May 13, 2025 at:

139 S. Edinburg Ave.
Los Angeles, California 90048

Our report is designed to be clear, easy to understand, and helpful. Please take the time to review it carefully. If there is anything you would like us to explain, or if there is other information you would like, please feel free to call us. We would be happy to answer any questions you may have.

We thank you for the opportunity to be of service to you.

Sincerely,



Inspector, Jerry Holt
Brooke and Sons Inspections





RECEIPT
139 S. Edinburg Ave.
Los Angeles, California 90048

iamelilevy@gmail.com

Client: Eli Levy

Receipt Number: 403218089

Receipt Date: Tuesday, May 13, 2025

Quantity	Description	Unit Price	Amount
1	Price is SF X .25 (4242sf)	\$1,060.50	\$1,060.50
1	pool	\$250.00	\$250.00
1	Preferred Agent Discount	(\$210.50)	(\$210.50)
		Subtotal:	\$1,100.00
		Venmo:	(\$1,100.00)

Change Due

\$0.00

Brooke and Sons Inspections • (909) 499-2051 • brookeandsonsinc@gmail.com

Thank you for your business!

Please send payment to:

19508 Leadwell Street

Reseda, Ca. 91335

Table of Contents

Executive Summary.....	2
Introduction.....	15
GENERAL INFORMATION.....	16
SUMMARY.....	21
STRUCTURE.....	22
PLUMBING SYSTEM.....	25
ELECTRICAL SYSTEMS.....	35
HEATING, VENTILATION & AIR CONDITIONING.....	40
ROOF & ATTIC.....	50
GARAGE.....	51
INTERIORS.....	53
KITCHEN.....	56
LAUNDRY.....	59
BATHROOM.....	60
FOUNDATION.....	71
SITE.....	73
POOL, SPA & EQUIPMENT.....	76
Environmental Concerns.....	85

Introduction

We have inspected the major structural components and mechanical systems for signs of significant non-performance, excessive or unusual wear and general state of repair. The following report is an overview of the conditions observed.

In the report, there may be specific references to areas and items that were inaccessible. We can make no representations regarding conditions that may be present but were concealed or inaccessible for review. With access and an opportunity for inspection, reportable conditions may be discovered. Inspection of the inaccessible areas will be performed upon arrangement and at additional cost after access is provided.

We do not review plans, permits, recall lists, and/or government or local municipality documents. Information regarding recalled appliances, fixtures and any other items in this property can be found on the Consumer Product Safety website. These items may be present but are not reviewed

Our recommendations are not intended as criticisms of the building, but as professional opinions regarding conditions present. As a courtesy, the inspector may list items that they feel have priority in the Executive Summary portion of the report. Although the items listed in this section may be of higher priority in the opinion of the inspector, it is ultimately the client's responsibility to review the entire report. If the client has questions regarding any of the items listed, please contact the inspector for further consultation.

Lower priority conditions contained in the body of the report that are neglected may become higher priority conditions. Do not equate low cost with low priority. Cost should not be the primary motivation for performing repairs. All repair and upgrade recommendations are important and need attention.

This report is a "snapshot" of the property on the date of the inspection. The structure and all related components will continue to deteriorate/wear out with time and may not be in the same condition at the close of escrow.

Anywhere in the report that the inspector recommends further review, it is strongly recommended that this be done PRIOR TO THE CLOSE OF ESCROW. This report is not intended for use by anyone other than the client named herein. No other persons should rely upon the information in this report. Client agrees to indemnify, defend and hold inspector harmless from any third party claims arising out of client's unauthorized distribution of the inspection report.

By accepting this inspection report, you acknowledge that you have reviewed and are in agreement with all of the terms contained in the standard contract provided by the inspector who prepared this report.

GENERAL INFORMATION

REPORT LIMITATIONS *This report is intended only as a general guide to help the client make his own evaluation of the overall condition of the home, and is not intended to reflect the value of the premises, nor make any representation as to the advisability of purchase. The report expresses the personal opinions of the inspector, based upon his visual impressions of the conditions that existed at the time of the inspection only. The inspection and report are not intended to be technically exhaustive, or to imply that every component was inspected, or that every possible defect was discovered. No disassembly of equipment, opening of walls, moving of furniture, appliances or stored items, or excavation was performed. All components and conditions which by the nature of their location are concealed, camouflaged or difficult to inspect are excluded from the report. The inspection is performed in compliance with generally accepted standards of practice, (a copy of which is available upon request). Systems and conditions which are not within the scope of the inspection include, but are not limited to: mold, fungus, formaldehyde, lead paint, asbestos, toxic or flammable materials, and other environmental hazards; pest infestation, playground equipment, efficiency measurement of insulation or heating and cooling equipment, internal or underground drainage or plumbing, any systems which are shut down or otherwise secured; water wells (water quality and quantity) zoning ordinances; intercoms; security systems; heat sensors; cosmetics or building code conformity. Any general comments about these systems and conditions are informational only and do not represent an inspection. The inspection report should not be construed as a compliance inspection of any governmental or non governmental codes or regulations. The report is not intended to be a warranty or guarantee of the present or future adequacy or performance of the structure, its systems, or their component parts. This report does not constitute any express or implied warranty of merchantability or fitness for use regarding the condition of the property and it should not be relied upon as such. Any opinions expressed regarding adequacy, capacity, or expected life of components are general estimates based on information about similar components and occasional wide variations are to be expected between such estimates and actual experience. We certify that our inspectors have no interest, present or contemplated, in this property or its improvement and no involvement with tradespeople or benefits derived from any sales or improvements. To the best of our knowledge and belief, all statements and information in this report are true and correct. Should any disagreement or dispute arise as a result of this inspection or report, it shall be decided by arbitration and shall be submitted for binding, non-appealable arbitration to the American Arbitration Association in accordance with its Construction Industry Arbitration Rules (then obtaining), unless the parties mutually agree otherwise. In the event of a claim, the Client will allow the Inspection Company to inspect the claim prior to any repairs or waive the right to make the claim. Client agrees not to disturb or repair or have repaired anything which may constitute evidence relating to the complaint, except in the case of an emergency.*

CLIENT INFORMATION

INSPECTION DATE

1: May 13, 2025

TIME

2: 2:00 P.M.

OCCUPIED?

3: Client should understand that there are many stored items throughout the interiors restricting access and view to certain, components, systems and general interiors. Some issues, such as and not limited to defects, stains and cracks may go unnoted in this report that were not in view at the time of the inspection

INSPECTOR

4: Jerry Holt

PEOPLE PRESENT

5: Listing agent, Purchaser and Buyers agent

COMMENTS

6: The illustrations in this report are intended to help client have a visual understanding of what is being commented in the report.

BUILDING**MAIN ENTRY FACES**

7: East

BUILDING TYPE

8: 1 family

STORIES

9: Two story

SPACE BELOW GRADE

10: Crawl space

CLIMATIC CONDITIONS**OUTSIDE TEMPERATURE (F)**

11: 70-80

UTILITY SERVICES**WATER SOURCE**

12: Public

SEWAGE DISPOSAL

13: Public

ELECTRIC

14: Municipal

FUEL

15: Natural Gas. Supplied by local utility company

UTILITIES STATUS

16: All utilities on

DEFINITION OF TERMS

DEFENATION OF TERMS

17: EXPLANATION OF TERMS

This report was prepared and written with the age and type of structure taken into consideration. Below is an explanation of the terms used in the report

FUNCTIONAL: Items marked Functional appear to be in serviceable condition using normal operating controls. There were no visible indication of failure at the time the services were performed.

SATISFACTORY: Items marked Satisfactory appear to be in serviceable condition using normal operating controls. There were no visible indications of failure at the time the services were performed. Items that need minor service that do not significantly affect an item's use may be classified as satisfactory.

ATTENTION: Items marked Attention appear to be in need of preventive maintenance or service. Attention may also indicate an item that the inspector would recommend gaining further information from a third party immediately in order to provide additional clarification and/or insight into the item's condition.

UNSATISFACORY: This term indicates that there is an unsafe condition or that the system, component or unit is in a state of disrepair and is in need of immediate attention by a qualified licensed professional. It is the clients responsibility to ensure that all additional inspections and further evaluations be conducted during the inspection contingency period.

MAINTENANCE: Items marked Maintenance are in need of repair or replacement in order to make the item functional and/or prevent further deterioration.

ACTION REQUIRED: Items marked Action Required appear to be in need of immediate repair or replacement. Delay in repair or replacement may result in a dramatic shortening of the life expectancy of the item, have immediate effect on the item, system, structure, other related items, or present a potential health and/or safety hazard.

PRESENT: Items marked Present were visible at the time the services were performed and were not tested or inspected due to either the type of device or access limitations.

NOT INSPECTED: Items marked Not Inspected may be present at the time the services were performed and were not inspected due to obstruction, weather condition or the inspection of the item is not within the scope of the services performed.

N/A: Items marked N/A are not included in the report. The item may not be present, not included, not accessible, not available, not addressed, not applicable, not appropriate, and/or not examined.

SUMMARY

Client should be aware that during the course of further evaluation by recommended specialist other issues may come up during the course of their inspection that is not noted in this report. The specialist or contractor is conducting a more detailed investigation than our limited general visual inspection. We are not conducting a punch list type inspection so do not limit the evaluation of recommended specialist or contractor to items we simply noted in our report. The purpose in further evaluations is for the specialist to examine the entirety of the component and/or system. Normally when one or two items are not correct the chances are there are more items in that component or system. Client should also not limit the reading of the report to this summary. Please read the report in its entirety. Having a summary does not limit or negate other items that Need Attention in the body of the report. All noted items that require further inspection need to be done during the inspection contingency prior to the close of escrow. Not after you move in.

INTERIORS

INSPECTOR COMMENT

18: Be aware that we are conducting a precursory inspection of the interiors. So as to not overlook any major deficiency with the major systems that could affect life and safety issues we conduct a nonexhaustive inspection of the interior components and only touch on relevant conditions as they exist at the time of inspection. Any cosmetic anomalies should be gone over during your walk through inspection

ELECTRICAL

INSPECTORS COMMENT

19: Some repairs and further evaluation is needed. All electrical repairs, no matter how simple, should only be attempted by licensed and insured electrician.

ADDITIONAL COMMENTS

INSPECTOR COMMENT

20: Child safety devices not to standards.

Close parental supervision of children with access to swimming pools is essential to providing pool safety for children. Barriers, such as those required pursuant to section 115922 of the Health and Safety Code, can help deter young children from gaining unsupervised access to pools. Further evaluation by licensed pool enclosure professional

STRUCTURE

While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. During the course of the inspection, the inspector does not enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely affect the health of the inspector or other persons.

STRUCTURE

TYPE OF CONSTRUCTION

21: Conventional wood framing With stucco cladding.



OBSERVATIONS

22: Satisfactory - The siding is in serviceable condition.

SOFIT & EAVES

23: The soffit/eaves appear to be in satisfactory condition and show only signs of normal wear.

PAINT SURFACE

24: Satisfactory - The finish or exposed painted surfaces are satisfactory

DOORS & WINDOWS

EXTERIOR DOORS

25: The exterior door(s) is/are satisfactory.

WINDOWS CONDITION

26: The window framing and glass are in a satisfactory condition.

FRAMING

FRAMING MEMBERS.

27: The exposed percentages of wall framing members is minimal. Therefore, no assumption should be made as to the condition of the unexposed framing members. This is only a comment on the visible portions of the wall framing.

FLOOR/CEILING FRAMING

28: The inspection only refers to the exposed ceiling/floor framing members. This is only a visual inspection and does not comment on unexposed framing members.

INTERIOR FINISHES

WALL COVERING

29: The wall covering material is predominantly sheetrock

CEILING MATERIAL

30: The ceiling covering material is predominantly sheetrock

COMMENTS

31: Interior walls and ceilings are in good repair. No visible deficiencies.

FIREPLACE/CHIMNEY

FIREPLACE LOCATION

32: Living room



TYPE

33: Direct vent Gas fired appliance.

CONDITION

34: The exterior stack is in satisfactory condition.



COMBUSTION AIR

35: Outside air is used for combustion. This is the most efficient system.

FUEL TYPE

36: Gas - The fireplace is designed to use gas fuel only.

FIREBOX CONDITION

37: There is a set of glass doors installed. Used correctly, these will help minimize heat loss when the fireplace is not in use. They also eliminate burning embers from flying into the room during a fire and reduce the volume of room air sucked up the chimney.

PLUMBING SYSTEM

Water quality or hazardous materials (lead) testing is available from local testing labs, and not included in this inspection. All underground piping related to water supply, waste, or sprinkler use are excluded from this inspection. Leakage or corrosion in underground piping cannot be detected by a visual inspection, nor can the presence of mineral build-up that may gradually restrict their inner diameter and reduce water volume. Plumbing components such as gas pipes, potable water pipes, drain and vent pipes, and shut-off valves are not generally tested if not in daily use. The inspector cannot state the effectiveness or operation of any anti-siphon devices, automatic safety controls, water conditioning equipment, fire and lawn sprinkler systems, on-site water quality and quantity, on-site waste disposal systems, foundation irrigation systems, spa and swimming pool equipment, solar water heating equipment, or observe the system for proper sizing, design, or use of materials. The water pressure within pipes is commonly confused with water volume, but whereas high water volume is good high water pressure is not. Therefore a regulator is recommended whenever street pressure exceeds 80 psi. However, regardless of pressure, leaks will occur in any system, and particularly in one with older galvanized pipes, or one in which the regulator fails and high pressure begins to stress washers and diaphragms within various components. Waste and drainpipes pipe condition is usually directly related to their age. Older ones are subject to damage through decay and root movement, whereas the more modern ABS ones are virtually impervious to damage, although some rare batches have been alleged to be defective. Older homes with galvanized or cast iron supply or waste lines can be obstructed and barely working during an inspection but later fail under heavy use. If the water is turned off or not used for periods of time (such as a vacant house waiting for closing), rust or deposits within the piping can further clog the piping system. However, inasmuch as significant portions of drainpipes are concealed, we can only infer their condition by observing the draw at drains at the time of inspection. Nonetheless, blockages will still occur in the life of any system. Be aware that the inspector can not detect gas leaks and is only commenting on visual portions of the gas lines. We do not operate gas valves nor light pilots to appliances that are off at the time of the inspection. Much of the gas lines, such as to any pool heater or BBQ are below grade and therefore not visible as mentioned above and can not be located or viewed for inspecting. Inspector is also not performing any calculations as to pipe sizing for certain appliances or adequacy and efficiency of flow and pressure. This can only be done by qualified licensed professional plumbing contractor with the use of special gauges and instruments.

WATER SUPPLY

SOURCE

38: City/Municipal.

Meter is located at Front parkway

Shut valve is located at front of building

39: Meter is located at Front parkway



40: Shut off valve is located at left side of building



TYPE/CONDITION

41: Supply line appears to be in satisfactory condition.

42: Water pipe seen coming ground is Copper

BUILDING WATER SUPPLY

PIPE SIZE

43: The interior water supply piping is 1/2" to 3/4" in diameter.

WATER PRESSURE

44: Water pressure from 40 to 80 pounds per square inch is considered within normal/acceptable range.

MATERIAL & CONDITION

45: By testing multiple fixtures at one time, functional flow of the water supply was verified.

46: Only 10% of the water supply system is visible to the inspector. Most of the water pipes are within walls, into common areas and below grade and therefore can not be viewed.

47: The interior supply piping in the structure is predominantly plastic.




48: There are also some interior copper water lines installed.



EXTERIOR HOSE BIBS

49: There are no backflow preventer valves installed. Under current standards, backflow preventer valves are required. It would be a good investment to have them installed.

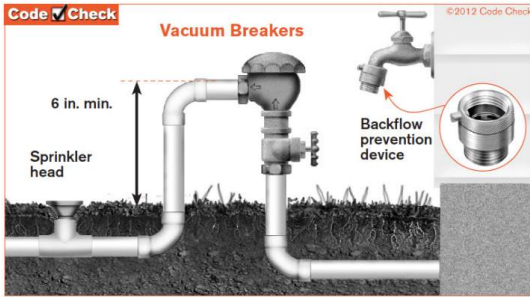

WASTE DISPOSAL

SEWAGE DISPOSAL TYPE

50: Client should understand that the sewer line from the dwelling to the street sewer is not visible in this type of general visual inspection. Inspector can not determine condition or adequacy of this waste pipe. We always recommend contracting with a qualified sewer line inspector who uses a scope and camera to view the system and render a report as to its condition

MATERIAL & CONDITION

51: Visible portions of waste lines seem to be in satisfactory condition and functioned as intended

52: The predominant waste line material is plastic.

LOCATION OF CLEANOUTS

53: Left side of house



OTHER PLUMBING

FIRE SPRINKLERS

54: Yes - There is a fire sprinkler system installed. It is recommended that it be checked by a professional with appropriate experience.



55: The inspector does not perform any evaluation or testing of the existing fire sprinkler system. The only information noted is the presence of the system.

LAWN SPRINKLERS

56: The inspection of the installed lawn sprinkler is beyond the scope of this inspection. Recommend further inspection by a licensed plumber or lawn sprinkler company.

WATER HEATER

LOCATION

57: Exterior right wall



AGE

58: 1 years old 199,000 btu natural gas fired Average life span of a water heater is 12 to 15 years.



CONDITION

59: Unit was working at time of inspection

DRIP LEG?

60: Yes - There is a drip leg installed on the incoming gas line to the water heater.

GAS VALVE

61: There is a gas valve cutoff installed adjacent to the hot water tank.

VENT PIPE CONDITION

62: The exhaust flue appears to be correctly installed.

WATER PIPES

63: Satisfactory

FILL VALVE?

64: Yes - There is a fill valve installed on the incoming water line. This valve can be used to cut off the water supply to the water heater.

TEMPERATURE CONTROL

65: Not operated or tested

DRAIN VALVE?

66: Yes - There is a drain valve installed on the lower side of the water heater.

TPRV

67: The temperature and pressure relief valve is installed and it has a drain tube that terminates to approved location

GAS SERVICE

METER LOCATION

68: Left side



69: An automatic seismic gas shut off valve is installed



GAS SUPPLY TYPE


70: Natural Gas.

PIPE MATERIAL USED

71: Black Iron Pipe.

CONDITION

72: Excessive rust and corrosion noted to portions of the gas line piping. Recommend that rust be cleaned off and gas pipe be painted. Gas lines should be protected from any form of damage or corrosion.

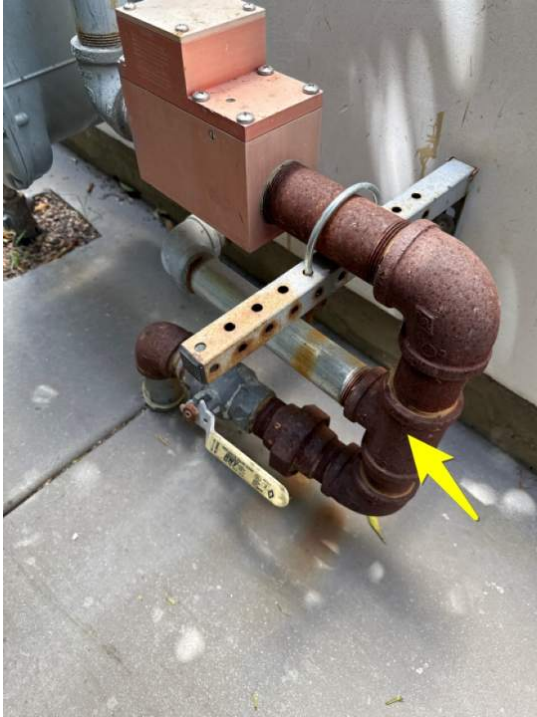

ELECTRICAL SYSTEMS

We are not electricians and in accordance with the standards of practice we only test a representative number of switches and outlets and do not perform load-calculations to determine if the supply meets the demand. However, every electrical deficiency or recommended upgrade should be regarded as a latent hazard that should be serviced as soon as possible, along with evaluation and certification of the entire system as safe by a licensed contractor. Therefore, it is essential that any recommendations that we may make for service or upgrades should be completed before the close of escrow or during inspection contingency period, because an electrician could reveal additional deficiencies or recommend additional upgrades for which we disclaim any responsibility. Any electrical repairs or upgrades should be made by a licensed electrician. Aluminum wiring requires periodic inspection and maintenance by a licensed electrician. Smoke Alarms should be installed within 15 feet of all bedroom doors, and tested regularly. Operation of time clock motors is not verified. Inoperative light fixtures often lack bulbs or have dead bulbs installed. The inspector is not required to insert any tool, probe, or testing device inside the panels, test or operate any over-current device except for ground fault interrupters, nor dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels. Any ancillary wiring or system that is not part of the primary electrical distribution system is not part of this inspection but may be mentioned for informational purposes only, including but not limited to low voltage systems, security system devices, heat detectors, carbon monoxide detectors, telephone, security, cable TV, intercoms, and built in vacuum equipment.

PRIMARY POWER SOURCE

SERVICE VOLTAGE

73: The incoming electrical service to this structure is 120/240 volts.

74: 400 amp

SERVICE TYPE & CONDITION

75: An overhead service entrance cable used. It comes from local utility pole and attaches to a mast head which is attached to the structure



MAIN PANEL


MAIN PANEL / SERVICE DISCONNECTS LOCATION

76: Exterior left side



SERVICE CABLE TYPE

77: A combination of copper cables and aluminum ground wire cables were used.

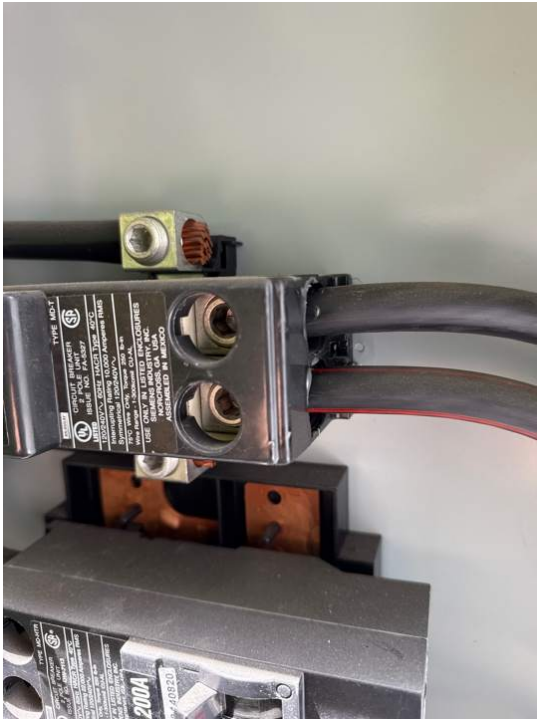

SUB PANELS

LOCATION

78: Laundry area 125 amp panel



79: Exterior right side 200 amp panel



SERVICE CABLE TYPE

80: Aluminum

PANEL ACCESSIBLE?

81: Yes - The electrical panel is in a location that makes it readily accessible.

PANEL TYPE & CONDITION

82: Breakers - The structure is equipped with a breaker type main power panel. This is the desirable type; when a breaker trips off, it can easily be reset. Caution: If a breaker is reset and trips back off, this is an indication that there is a short or weakened condition in the circuit. Call a qualified licensed electrician for analysis of the existing problem.

BREAKER/FUSE

83: The breakers/fuses in the main power panel appear to be appropriately matched to the circuit wire gauge.

WIRING TYPE & CONDITION

WIRING TYPE & CONDITION

84: The exposed wiring appears to be in satisfactory condition including connections, routing, fasteners, and insulation.

85: Less than 5% is visible to inspector. Wiring is mostly concealed within walls and therefore not visible for inspection. Inspector can not make any reliable comment to areas which can not be viewed for inspection.

86: Copper - The structure is wired using plastic insulated copper single conductor.

OUTLETS & SWITCHES

RECEPTACLES

87: A representative sampling of receptacles was achieved. These tested appeared to be operating properly.

LIGHTING

88: A representative sampling of lighting was achieved. These tested appeared to be operating properly.

GROUND FAULT CIRCUIT INTERRUPTERS

89: Satisfactory

SWITCHES

90: A representative sampling of switches was achieved. These tested appeared to be operating properly.

SMOKE DETECTORS

91: Disclaimer - The existing smoke detectors were not tested, but they are only noted as to presence. We do not test the smoke detectors because they may work today but not work when you need them to work. This is why it is important for you to test them on a regular basis, monthly at least.

HEATING, VENTILATION & AIR CONDITIONING

The inspector can only readily open access panels provided by the manufacturer or installer for routine homeowner maintenance, and will not operate components when weather conditions or other circumstances apply that may cause equipment damage. The inspector does not light pilot lights or ignite or extinguish solid fuel fires, nor are safety devices tested by the inspector. The inspector is not equipped to inspect furnace heat exchangers for evidence of cracks or holes, or inspect concealed portions of evaporator and condensing coils, heat exchanger or firebox, electronic air filters, humidifiers and de-humidifiers, ducts and in-line duct motors or dampers, as this can only be done by dismantling the unit. This is beyond the scope of this inspection. Thermostats are not checked for calibration or timed functions. Adequacy, efficiency or the even distribution of air throughout a building cannot be addressed by a visual inspection. Have these systems evaluated by a qualified individual. The inspector does not perform pressure tests on coolant systems, therefore no representation is made regarding coolant charge or line integrity. We perform a conscientious evaluation of the system, but we are not specialists. Please note that even modern heating systems can produce carbon monoxide, which in a poorly ventilated room can result in sickness and even death. Therefore, it is essential that any recommendations we make for service or further evaluation be scheduled before the close of escrow, because a specialist could reveal additional defects or recommend further upgrades that could affect your evaluation of the property, and our service does not include any form or warranty or guarantee. Normal service and maintenance is recommended on a yearly basis. Determining the presence of asbestos materials commonly used in heating systems can ONLY be preformed by laboratory testing and is beyond the scope of this inspection. Determining the condition of oil tanks, whether exposed or buried, is beyond the scope of this inspection. Leaking oil tanks represent an environmental hazard which is sometimes costly to remedy.

HVAC 1 Downstairs

HVAC

92: A forced air furnace is installed as the primary source of heat.




HEATING ELEMENT LOCATION

93: Garage

APPROXIMATE AGE

94: (2014) 11 years old 100,000btu natural gas fired. The typical service life for a forced air natural gas furnace is 18 - 20 years.

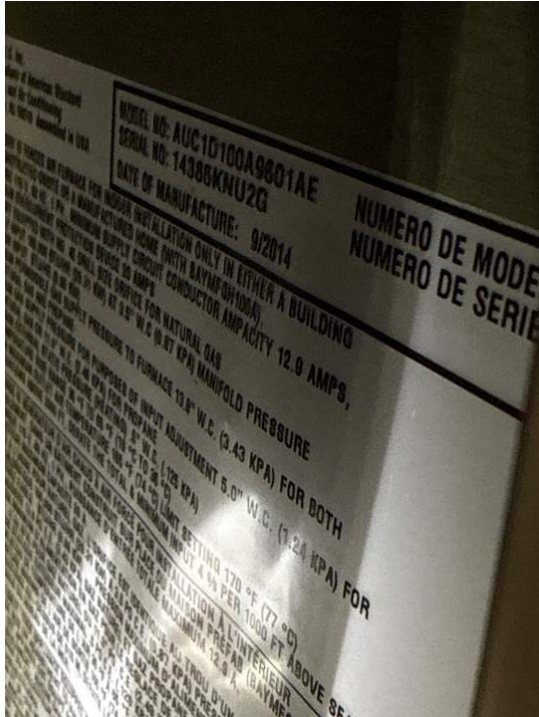

FLUES, VENTS, PLENUM

95: The visible portions of the flue/vent system appear to be installed correctly and appear to be functional.

GENERAL OPERATION & CABINET

96: Unit was operational at the time of inspection. General condition appears serviceable

BURNERS / HEAT EXCHANGERS

97: Burner Flame(s) appear typical

INTERIOR FAN COIL/AIR HANDLER

98: General condition appears serviceable

AIR FILTERS

99: Attention needed: Filter dirty and needs changing. It is recommended that the filter(s) be changed or cleaned every 30 to 45 days for best performance..

DUCT INSULATION IN UNHEATED SPACES

100: Exposed ductwork in unheated spaces is insulated adding to the efficiency of the heating and air conditioning systems.

DOES EACH HABITABLE ROOM HAVE A HEAT SOURCE?

101: Yes

NORMAL CONTROLS

102: General condition appears serviceable

103: Thermostat is located in the Hallway

AIR CONDITIONING

104: Split system

LOCATION

105: Roof top



MODEL/ SERIAL NUMBER/ SIZE

106: 11 years old, 5 ton. The typical service life for an AC unit is 12 - 15 years. Each ton provides conditioning for approximately 500-600 square feet of area.



UNIT TESTED

107: Yes

108: The scope of this inspection does not include the effectiveness or adequacy of the system.

INSULATION WRAP ON THE SUCTION LINE

109: Insulation wrap is functional, without significant damage.

CONDENSER CLEAR OF OBSTRUCTION

110: Clearance appears adequate

CONDENSER CABINET LEVEL

111: Cabinet is basically level.

CONDITION

112: Operational

SERVICE DISCONNECT



113: The installed service disconnect is located within sight of the condensing coil cabinet and not more than 50 feet from the unit.

CONDENSATE LINE

114: Interior fan coils lack a secondary condensation drain or safety shut off. The purpose of a secondary drain or safety shut off is to prevent any potential water damage to the ceiling or interiors in the event that the primary condensation drain is clogged.



115: Attention needed: Unit lacks a properly installed P trap and vent. Have technician conduct corrections.

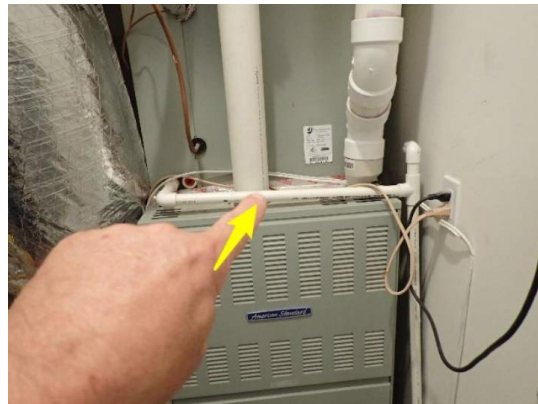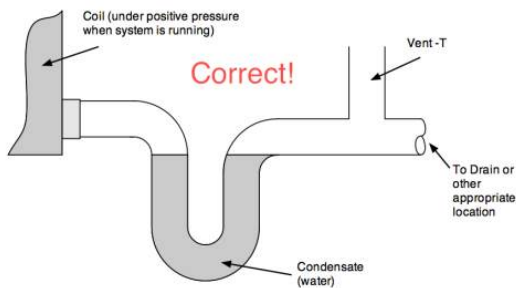

DUCTS CONDITION

116: Duct work in the crawl area is resting onto the soil. Duct work should be elevated at least 4 inches above dirt to prevent corrosion.



HVAC 2 Upper Floor

HVAC

117: A forced air furnace is installed as the primary source of heat.


HEATING ELEMENT LOCATION

118: Rooftop



APPROXIMATE AGE

119: 11 years old 96,000btu natural gas fired. The typical service life for a forced air natural gas furnace is 18 - 20 years.

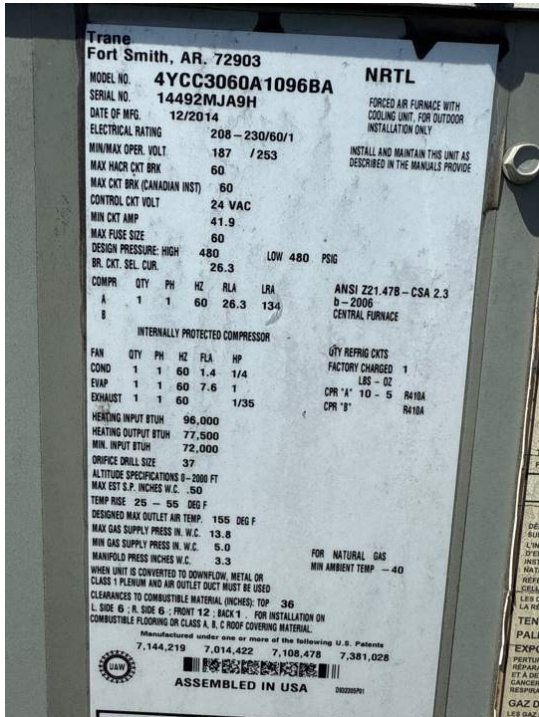

120: Although operational at the time of the inspection, the age and/or condition of this unit is such that you may need to replace it in the near future.

121: Data plate was illegible and this is an educated guess as to its correct size 50,000BTU 30+ years old

FLUES, VENTS, PLENUM

122: The visible portions of the flue/vent system appear to be installed correctly and appear to be functional.

GENERAL OPERATION & CABINET

123: Unit was operational at the time of inspection.

BURNERS / HEAT EXCHANGERS

124: Closed System - Unable to inspect

INTERIOR FAN COIL/AIR HANDLER

125: General condition appears serviceable

DUCT INSULATION IN UNHEATED SPACES

126: Exposed ductwork in unheated spaces is insulated adding to the efficiency of the heating and air conditioning systems.

DOES EACH HABITABLE ROOM HAVE A HEAT SOURCE?

127: Yes

NORMAL CONTROLS

128: General condition appears serviceable

129: Thermostat is located in the Hallway

AIR CONDITIONING

130: Package unit

LOCATION

131: Roof top



MODEL/ SERIAL NUMBER/ SIZE

132: 11 years old, 5 ton. The typical service life for an AC unit is 12 - 15 years.

Each ton provides conditioning for approximately 500-600 square feet of area.



UNIT TESTED

133: Yes

134: The scope of this inspection does not include the effectiveness or adequacy of the system.

CONDENSER CLEAR OF OBSTRUCTION

135: Clearance appears adequate

CONDENSER CABINET LEVEL

136: Cabinet is basically level.

CONDITION

137: Operational

SERVICE DISCONNECT

138: The installed service disconnect is located within sight of the condensing coil cabinet and not more than 50 feet from the unit.

CONDENSATE LINE

139: The condensate drain line appears to be adequately installed. Periodic checking to make sure that the line is clear will help to maintain the system.

EVIDENCE OF MAINTENANCE

140: For optimum performance, the air conditioning system should be serviced annually prior to the cooling season. It is recommended that the filter(s) be changed or cleaned every 30 to 45 days for best performance.

DUCTS CONDITION

141: The ductwork is enclosed and largely inaccessible. It could not be viewed directly; however, good airflow indicates no significant leaks are present.

ROOF & ATTIC

Roof systems require periodic maintenance, such as checking the seals around flashings, removing foliage and cleaning out gutters. The inspector does not certify the roof system or determine how well it performs under extreme weather conditions. Inspector does not perform any roof structure calculations, leak test or determine efficiency and actual R value of any insulation. Inspector can not comment on attic framing or roof structures that do not have an accessible attic space nor can inspector determine integrity of roof deck as it is covered by roof material when inspected.

ROOFING

ROOF TYPE

142: Flat

143: Rolled Asphalt. Rolled roofing material is a cellulose mat impregnated with asphalt and colored fiber surface. It is 36 inches wide rolled horizontally with at least a 2" overlap. It is installed over a 15# felt paper and generally covered with a granular surface to retard ultraviolet deterioration.

144: The roof covering was inspected by walking on the roof.

LAYERS

145: The roof covering on the main structure appears to be the first covering.

ROOF CONDITION

146: The roof covering material is in a condition that is consistent with its age and method of installation.

FLASHING

147: Satisfactory

ROOF DRAINAGE

GUTTERS & DOWNSPOUTS

148: Satisfactory

GARAGE

Determining the heat resistance rating of firewalls is beyond the scope of this inspection. Flammable materials should not be stored within closed garage areas. Garage door openings are not standard, so you may wish to measure the opening to ensure that there is sufficient clearance to accommodate your vehicles. It is not uncommon for moisture to penetrate garages, particularly with slabs on-grade construction, and this may be apparent in the form of efflorescence or salt crystal formations on the concrete. You may want to have any living space above the garage evaluated further by a structural engineer, as it may be seismically vulnerable.

GARAGE

TYPE

149: The garage is attached.

SIZE

150: Two car garage.

OVERHEAD DOORS

NUMBER OF DOORS

151: There is a single overhead door.

152: The doors are made of either solid wood or wood fiber.

CONDITION

153: The overhead door is in satisfactory condition, and it is functional.

AUTOMATIC GARAGE DOOR

154: Satisfactory

ENTRY DOOR

155: Satisfactory

GARAGE INTERIORS

FLOOR SLAB

156: The garage floor is in satisfactory condition.

WALLS

157: Satisfactory

GARAGE EXTERIORS

TYPE OF CONSTRUCTION

158: Same as house

SIDING

159: Stucco.

CONDITION

160: Satisfactory - The siding is in serviceable condition.

TRIM CONDITION

161: Satisfactory - The trim is intact and satisfactory.

SOFIT & EAVES

162: Satisfactory - The soffit/eaves appear to be in satisfactory condition and show only signs of normal wear.

PAINT SURFACE

163: Satisfactory - The finish or exposed painted surfaces are satisfactory

UTILITIES

ELECTRICAL

164: Satisfactory - The electrical outlets in the garage tested as correctly grounded.

INTERIORS

The inspector does not move furniture or items, if present, when conducting the inspection. The interiors are conducting a precursory examination. The inspector will mostly note issues that may be a sign of something more serious, such as movement cracks, water stains. Stains on flooring or worn flooring may be noted though these are usually cosmetic issues and do not affect use unless noted otherwise. The inspector will conduct a representative sampling of doors and windows to base his opinion. Client should come to their own conclusion as regards to cosmetic repairs that may be desired. We are not qualified to perform a mold inspection. This should only be done by qualified environmental agency. Other substances that are not tested are and not limited to fungus, asbestos and lead paint. We are not doing air samplings nor testing for radon. Again this is only done by a qualified environmental agency. So please do not ask the inspector other than to seek advise on whether or not you should have further testing. More than likely he will suggest that you do.

DOORS

EXIT DOORS

165: A representative sampling of exterior doors was achieved. Those operated were in serviceable condition

INTERIOR DOORS

166: A representative sampling of doors was achieved. Those operated were in serviceable condition.

WINDOWS

TYPE & CONDITION

167: A representative sampling of testing windows was achieved. Those tested were in operational condition

168: Windows are: Aluminum double pane.

FLOORS

TYPE/CONDITION

169: Attention needed: There are notable scratch marks and wear seen throughout areas of wood flooring. Refinishing may be needed



170: Wood and tile used as finish

STAIRS

CONDITION


171: Satisfactory



DETECTORS

NOTE

172: Smoke detectors are usually required, depending on the municipality, in each sleeping area, hallways outside sleeping areas and kitchen or basements. Consult a retrofitting specialist as to your area. Carbon monoxide detectors are required in hall areas of both upper and lower floors.

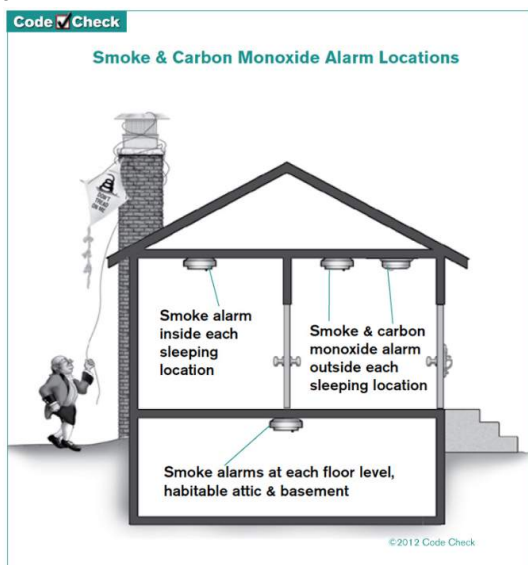

KITCHEN

Clothes washers and dryers are not inspected. Inspector will only operate, if at all, a dishwasher in one cycle. Efficiency and quality of operation is not verified. Be aware that water fill lines for refrigerator ice makers are not fully visible to inspect and inspector will not move a refrigerator to examine this device. Clothes washers and dryers are not inspected. Inspector will only operate, if at all, a dishwasher in one cycle. Efficiency and quality of operation is not verified. Be aware that water fill lines for refrigerator ice makers are not fully visible to inspect and inspector will not move a refrigerator to examine this device.

KITCHEN

LOCATION

173: Main level rear of house



FIXTURES

FAUCET

174: Faucets and supply lines appear satisfactory with no leaks noted.

SINK & DRAIN

175: The sink and drainage lines appear to be satisfactory.

CAULKING

176: The caulking in water contact areas appears to be satisfactory.

WALLS & CEILING

CONDITION

177: The walls and ceiling in the kitchen appear to be satisfactory.

FLOORS

CONDITION & TYPE

178: The flooring in the kitchen is satisfactory.

COUNTER TOPS & CABINETY

CABINETY

179: The cabinets, doors, and drawers are satisfactory in both appearance and function.

COUNTER TOPS

180: The countertops in the kitchen are satisfactory.

ELECTRICAL

LIGHTING

181: The ceiling lights in the kitchen are in satisfactory condition.

RECEPTACLES

182: Satisfactory

APPLIANCES

DISPOSAL

183: The food waste disposal appears to be functional. No food was ground up in this inspection. The inspector was unable to determine if the unit will grind food waste adequately.

DISHWASHER

184: Operational at time of inspection. Operated on one cycle only.



185: Adequacy of the dishwasher is disclaimed. This inspection only verifies that the unit is installed properly and that it activates using normal controls.

RANGE HOOD

186: The range hood and exhaust fan appeared to work correctly on one or both speeds. There is a filter installed, and it will require periodic cleaning.



RANGE/OVEN

187: Built-in - There is a built-in gas range top and electric oven. They appeared to function correctly at the time of the inspection. The timers and temperature settings were not tested and are not a part of this inspection.



MICROWAVE OVEN

188: Built-in - There is a built-in microwave oven. The unit functioned as intended.

LAUNDRY

LAUNDRY

LOCATION

189: Upper hall



WASHER HOOK UPS

190: There is a connection box installed in the wall with both hot and cold water and a drain pipe. The drain pipe was not flood tested.

DRYER EXHAUST

191: Satisfactory - The dryer ventilation as installed appears adequate. The vent hood outside is clean, and the flapper is functional.



DRYER HOOK UPS

192: There is a gas line provided for a gas dryer. If you have an electric clothes dryer, you will need to have additional electrical circuitry installed or get a gas dryer.

AREA VENTILATION

193: Satisfactory - The area ventilation seems adequate.

LAUNDRY BASIN

194: There is a laundry basin installed. The unit is functional. No leaks were noted.

BATHROOM

Shower pans are not tested by this inspection agency as this should only be done by a pest control operator who is licensed by the state of California. Efficiency of hot water flow to fixtures is not part of this inspection and inspector does not comment on whether or not temperature of hot water is adequate. Client should have a licensed plumber set water heater thermostat to desired hot water setting. When away for long periods be sure to set your water heater thermostat to vacation mode. Functional drainage flow is only judged as seen while running water under normal conditions. Excessive use of improper use can always cause back ups.

BATHROOM 1

LOCATION

195: Lower left bedroom



VANITY CABINET

196: The vanity cabinet and top in this bathroom are satisfactory.

FAUCET

197: Faucets and supply lines appear satisfactory.

SINK & DRAIN

198: Satisfactory

TOILET

199: The toilet in this bathroom appears to be functional.

SHOWER FIXTURES

200: The shower, shower head, and mixing valves are all performing as required.

TUB

201: Satisfactory

WALLS

202: The walls in this bathroom are satisfactory.

FLOOR

203: Flooring in this bathroom is satisfactory.

ENCLOSURE

204: Satisfactory

LIGHTING

205: The ceiling light and fixture in this bathroom are in satisfactory condition.

EXHAUST FAN

206: There is an exhaust fan installed in this bathroom, and it is performing satisfactorily.

HEAT SOURCE

207: There is a heat source in this room.

GFCI(S)

208: There is a functional Ground Fault Circuit Interrupt outlet installed in the area of the bathroom vanity.

BATHROOM 2

LOCATION

209: Hall right



VANITY CABINET

210: The vanity cabinet and top in this bathroom are satisfactory.

FAUCET

211: Faucets and supply lines appear satisfactory.

SINK & DRAIN

212: Satisfactory

TOILET

213: The toilet in this bathroom appears to be functional.

WALLS

214: The walls in this bathroom are satisfactory.

FLOOR

215: Flooring in this bathroom is satisfactory.

LIGHTING

216: The ceiling light and fixture in this bathroom are in satisfactory condition.

EXHAUST FAN

217: There is an exhaust fan installed in this bathroom, and it is performing satisfactorily.

HEAT SOURCE

218: There is a heat source in this room.

GFCI(S)

219: There is a functional Ground Fault Circuit Interrupt outlet installed in the area of the bathroom vanity.

BATHROOM 3

LOCATION

220: Upper front right Bedroom



VANITY CABINET

221: The vanity cabinet and top in this bathroom are satisfactory.

FAUCET

222: Faucets and supply lines appear satisfactory.

SINK & DRAIN

223: Satisfactory

TOILET

224: The toilet in this bathroom appears to be functional.

SHOWER FIXTURES

225: The shower, shower head, and mixing valves are all performing as required.

TUB

226: Satisfactory

WALLS

227: The walls in this bathroom are satisfactory.

FLOOR

228: Flooring in this bathroom is satisfactory.

ENCLOSURE

229: Satisfactory

LIGHTING

230: The ceiling light and fixture in this bathroom are in satisfactory condition.

EXHAUST FAN

231: There is an exhaust fan installed in this bathroom, and it is performing satisfactorily.

HEAT SOURCE

232: There is a heat source in this room.

GFCI(S)

233: There is a functional Ground Fault Circuit Interrupt outlet installed in the area of the bathroom vanity.

BATHROOM 4

LOCATION

234: Upper front left bedroom



VANITY CABINET

235: The vanity cabinet and top in this bathroom are satisfactory.

FAUCET

236: Faucets and supply lines appear satisfactory.

SINK & DRAIN

237: Satisfactory

TOILET

238: The toilet in this bathroom appears to be functional.

SHOWER FIXTURES

239: The shower, shower head, and mixing valves are all performing as required.

TUB

240: Satisfactory

WALLS

241: The walls in this bathroom are satisfactory.

FLOOR

242: Flooring in this bathroom is satisfactory.

ENCLOSURE

243: Satisfactory

LIGHTING

244: The ceiling light and fixture in this bathroom are in satisfactory condition.

EXHAUST FAN

245: There is an exhaust fan installed in this bathroom, and it is performing satisfactorily.

HEAT SOURCE

246: There is a heat source in this room.

GFCI(S)

247: There is a functional Ground Fault Circuit Interrupt outlet installed in the area of the bathroom vanity.

BATHROOM 5

LOCATION

248: Upper middle right bedroom



VANITY CABINET

249: The vanity cabinet and top in this bathroom are satisfactory.

FAUCET

250: Faucets and supply lines appear satisfactory.

SINK & DRAIN

251: Satisfactory

TOILET

252: The toilet in this bathroom appears to be functional.

SHOWER FIXTURES

253: The shower, shower head, and mixing valves are all performing as required.

SHOWER PAN

254: Disclaimed - This is a visual inspection of the readily accessible portions of the shower stall and was not invasive. Therefore, it is a limited inspection and may not have noted any hidden defects. Flood testing of the shower pan was not included as part of this inspection.

WALLS

255: The walls in this bathroom are satisfactory.

FLOOR

256: Flooring in this bathroom is satisfactory.

ENCLOSURE

257: Satisfactory

LIGHTING

258: The ceiling light and fixture in this bathroom are in satisfactory condition.

EXHAUST FAN

259: There is an exhaust fan installed in this bathroom, and it is performing satisfactorily.

HEAT SOURCE

260: There is a heat source in this room.

GFCI(S)

261: There is a functional Ground Fault Circuit Interrupt outlet installed in the area of the bathroom vanity.

BATHROOM 6

LOCATION

262: Main bedroom



VANITY CABINET

263: The vanity cabinet and top in this bathroom are satisfactory.

FAUCET

264: Attention needed: Sink fixtures hard to operate.
Adjustments needed.



SINK & DRAIN

265: Satisfactory

TOILET

266: The toilet in this bathroom appears to be functional.

SHOWER FIXTURES

267: The shower, shower head, and mixing valves are all performing as required.

TUB

268: Satisfactory

SHOWER PAN

269: Disclaimed - This is a visual inspection of the readily accessible portions of the shower stall and was not invasive. Therefore, it is a limited inspection and may not have noted any hidden defects. Flood testing of the shower pan was not included as part of this inspection.

WALLS

270: The walls in this bathroom are satisfactory.

FLOOR

271: Flooring in this bathroom is satisfactory.

ENCLOSURE

272: Satisfactory

LIGHTING

273: The ceiling light and fixture in this bathroom are in satisfactory condition.

EXHAUST FAN

274: There is an exhaust fan installed in this bathroom, and it is performing satisfactorily.

HEAT SOURCE

275: There is a heat source in this room.

GFCI(S)

276: There is a functional Ground Fault Circuit Interrupt outlet installed in the area of the bathroom vanity.

NOTE

277: Attention needed: Some water staining noted under a few of the bathroom sink cabinets. Maintenance needed to insure plumbing drain lines are tightened and free from leaks to prevent possible water damage to cabinets.



FOUNDATION

All structures are dependent on the soil beneath them for support, but soils are not uniform. Some that appear to be firm and solid can become unstable during seismic activity or may expand with the influx of water, moving structures with relative ease and fracturing slabs and other hard surfaces. In accordance with our standards of practice, we identify foundation types and look for any evidence of structural deficiencies. However, minor cracks or deteriorated surfaces are common in many foundations and most do not represent a structural problem. If major cracks are present along with bowing, we routinely recommend further evaluation be made by a qualified structural engineer. All exterior grades should allow for surface and roof water to flow away from the foundation. All concrete floor slabs experience some degree of cracking due to shrinkage in the curing process. In most instances floor coverings prevent recognition of cracks or settlement in all but the most severe cases. Where carpeting and other floor coverings are installed, the materials and condition of the flooring underneath cannot be determined. Areas hidden from view by finished walls or stored items cannot be judged and are not a part of this inspection. We will certainly alert you to any suspicious cracks if they are clearly visible. However, we are not specialists, and in the absence of any major defects, we may not recommend that you consult with a foundation contractor, a structural engineer, or a geologist, but this should not deter you from seeking the opinion of any such expert. We also routinely recommend that inquiry be made with the seller about knowledge of any prior foundation or structural repairs.

FOUNDATION

TYPE

278: Raised Foundation with a crawlspace - Refers to a foundation wall with a footer below without a finished floor.

MATERIALS

279: Poured in place concrete

CONDITION

280: The foundation is performing the job it was intended to do in supporting the structure.

ADJACENT GRADE

281: Satisfactory - The drainage around the perimeter of the foundation appears to have adequate ground slope to remove run - off water from the immediate area.

FOUNDATION ANCHORED?

282: Yes - This inspection noted the presence of foundation bolts correctly used to secure the framing to the foundation. There was only a random look at these bolts or brackets, and no warranty as to their performance is given.

CRAWLSPACE

ENTRANCE

283: Satisfactory - The crawlspace entrance is adequately sized.

METHOD OF INSPECTION

284: The crawlspace was inspected by entering and crawling through.

ENTRANCE LOCATION

285: Exterior

CONDITION

286: Satisfactory

VENTILATION

287: Satisfactory - The cross - ventilation in the crawlspace appears to be adequate.

FOUNDATION FRAMING

SUB FRAMING

288: Satisfactory

BEAMS

289: Satisfactory

SUPPORT POST

290: Satisfactory



PIER MATERIAL

291: Exposed concrete piers at least 8" in diameter are visible in the crawlspace.

CONDITION OF PIERS

292: Satisfactory - The piers as installed appear to be adequate. No engineering analysis was completed.

SITE

This inspection is not intended to address or include any geological conditions or site stability information. We do not comment on coatings or cosmetic deficiencies and the wear and tear associated with the passage of time, which would be apparent to the average person. However, cracks in hard surfaces can imply the presence of expansive soils that can result in continuous movement, but this can only be confirmed by a geological evaluation of the soil. Any reference to grade is limited to only areas around the exterior of the exposed areas of foundation or exterior walls. We cannot determine drainage performance of the site or the condition of any underground piping, including subterranean drainage systems and municipal water and sewer service piping or septic systems. Decks and porches are often built close to the ground, where no viewing or access is possible. Any areas too low to enter or not accessible are excluded from the inspection. We do not evaluate any detached structures such as storage sheds and stables, nor mechanical or remotely controlled components such as driveway gates. We do not evaluate or move landscape components such as trees, shrubs, fountains, ponds, statuary, pottery, fire pits, patio fans, heat lamps, and decorative or low-voltage lighting. Any such mention of these items is informational only and not to be construed as inspected.

SITE

SITE

293: Aerial




SITE DRAINAGE

294: Inspector can not fully determine adequacy of drainage. Consult seller or pertinent party as to any known problems with site drainage.

TREES

295: Some trees and/or shrubs on the site need to be trimmed.

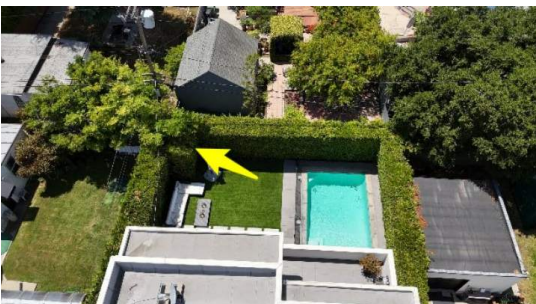

MAIL BOX?

296: Yes - There is a mailbox on-site.

PAVING CONDITION

MATERIAL

297: Concrete.

DRIVEWAY CONDITION

298: Satisfactory - The driveway surface material is in satisfactory condition with only normal deterioration noted.

WALKWAYS

299: Satisfactory - The walkway surface material is in satisfactory condition with only normal deterioration noted.

ENTRY STOOP

300: Satisfactory - The entry way stoop is in functional condition.

PATIO/DECK

MATERIALS

301: Tile.



CONDITION

302: Satisfactory

FENCES & GATES

MATERIALS

303: Wood materials used for fencing. The fence is constructed using 6 - foot boards.

304: Fencing is generally shared with neighboring property. Neighbors would need to be consulted prior to repairs. Any comment made related to fencing is done out of courtesy. Inspector is not conducting a survey to determine where property line actually is located. This can only be done by qualified surveyor.

CONDITION

305: Satisfactory - The fencing materials appear to be in satisfactory condition.

GATES

306: Attention Needed - The gate or latch hardware needs repair to function as intended.



POOL, SPA & EQUIPMENT

Never have the pool maintenance/cleaner conduct any pool repairs or conduct any inspection unless he is a licensed and insured pool contractor. All electrical repairs need to be conducted by a licensed and insured electrician. Inspector does not perform a leak test and can not determine whether or not inspected pool is leak free. Nor does the inspector comment on rapidity of water evaporation. All pools have a certain amount of water that will evaporate thus require the pool to be filled periodically. We do not conduct a chemical balance test. All pool equipment is operated using normal operating controls. We do not operate remote systems or tamper with timers. Pool safety enclosure is important. Gates need to be periodically tested to ensure they self close and practice child safety.

POOL SURFACE


TYPE

307: Cement Plaster



CONDITION

308: Pool surface is only fair in appearance due to age and wear. Expect replastering in the not to distant future.

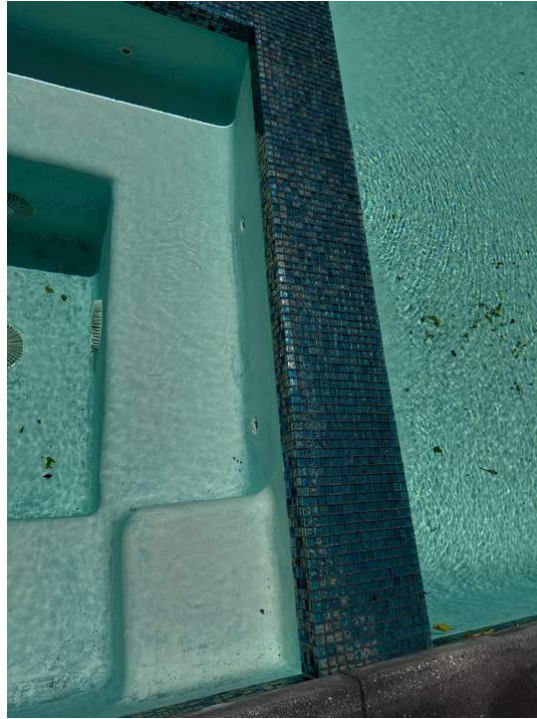

COPING

309: Satisfactory

SKIMMER & BASKET

CONDITION

310: Satisfactory

LIGHT(S)

CONDITION

311: Pool light switch was not located during the inspection. Have the sellers demonstrate the proper operation of the pool light.

PUMPING EQUIPMENT

TYPE

312: Variable

CONDITION

313: Satisfactory however vegetation and debris removal around equipment needed



FILTER TYPE

314: Diatomaceous earth

FILTER CONDITION

315: Serviceable

VISIBLE PLUMBING LINES

CONDITION

316: Satisfactory

HEATER

TYPE

317: Natural gas

CONDITION

318: Satisfactory



ELECTRICAL CONTROLS

TIMERS

319: Serviceable

CONDITION

320: Satisfactory

SUB PANEL

321: Serviceable

POOL DECKING

TYPE

322: Concrete

CONDITION

323: Satisfactory

SPA/HOT TUB

SURFACE

324: Same as pool

OPERATION

325: Operational using normal operating controls



POOL ENCLOSURE

CONDITION

326: "Close parental supervision of children with access to swimming pools is essential to providing pool safety for children. Barriers, such as those required pursuant to section 115922 of the Health and Safety Code, can help deter young children from gaining unsupervised access to pools.

327: Pool enclosure does not meet today's standards.

Those features are listed below. In California, the swimming pool or spa must be equipped with at least two of the following seven drowning-prevention safety features:

1. an enclosure that isolates the swimming pool or spa from the private single-family home;
2. removable mesh fencing that meets American Society for Testing and Materials (ASTM) Specification F2286 standards in conjunction with a gate that is self-closing and self-latching and can accommodate a key-lockable device;
3. an approved safety pool cover;
4. **exit alarms on the private single-family home's doors that provide direct access to the swimming pool or spa. The exit alarm may cause either an alarm noise or a verbal warning, such as a repeating notification that the door to the pool is open ;**
5. a self-closing, self-latching device with a release mechanism placed no lower than 54 inches above the floor on the private single-family home's doors, providing direct access to the swimming pool or spa;
6. an alarm that, when placed in a swimming pool or spa, will sound upon detection of accidental or unauthorized entrance into the water. The alarm shall meet and be independently certified to the ASTM Standard F2208 Standard Safety Specification for Residential Pool Alarms, which includes surface motion, pressure, sonar, laser, and infrared type alarms. A swimming protection alarm feature designed for individual use, including an alarm feature designed for individual use, including an alarm attached to a child that sounds when the child exceeds a certain distance or becomes submerged in water, is not a qualifying drowning prevention safety feature; and
7. other means of protection, if the degree of protection afforded is equal to or greater than that afforded by any of the features set forth above and has been independently verified by an approved testing laboratory as meeting standards for those features established by the ASTM or the American Society of Mechanical Engineers (ASME).



328: INFORMATION BULLETIN / PUBLIC -
BUILDING CODE REFERENCE NO.: LABC Section 3109,
Effective: 1/1/2023
Ch. 31B
DOCUMENT NO.: P/BC 2023-014
Previously Issued As: P/BC 2020-014

4. 5. 6. 7. Private Pools: All private pools shall be provided with a pool enclosure. To comply with the intent and the spirit of LABC Sections 3109 and 3119B, all new pool enclosures shall be a minimum of 5 feet in height and shall comply with the construction requirements of this section.

Additionally, for private swimming pools located at single-family homes, the construction of a new swimming pool or spa or the remodeling of an existing swimming pool or spa shall be equipped with at least two of the seven drowning prevention safety features as listed under Section 3109.2 of the LABC. Buildings (dwelling or accessory buildings) on the subject lot may be used as part of, or located within the pool enclosure, provided that at least (2) of the drowning prevention safety features specified under Section 3109.2 are provided for each building. Public Pools: All public pools shall provide a pool enclosure a minimum of 5 feet in height, which complies with the requirements of LABC Section 3119B and with the fence construction requirements of this bulletin. Construction Requirements: The fence shall meet all of the following requirements. a. The minimum fence height is measured on the side of the fence which faces away from the swimming pool as depicted in Figures 31B-4 and 31B-5 of the LABC for both public and private pools. Gates a. The maximum vertical clearance from the ground to the bottom of the fence shall be limited to two inches, measured on the side of the fence which faces away from the swimming pool. The outside surface of a fence shall be free of protrusions, cavities, or other physical characteristics that would serve as handholds or footholds, which renders the fence easily climbable for children 5 years of age and younger. Gaps or voids in the fence shall not allow the passage of a sphere equal to or greater than 4 inches in diameter. Where the fence is composed of horizontal and vertical members and the distance between the top of the horizontal members is less than 45 inches, the horizontal members shall be located on the swimming pool side of the fence. Spacing between vertical members shall not exceed 1¾ inches. Where there are decorative cutouts within vertical members, spacing within cutouts shall not exceed 1¾ inches in width. Where the fence is composed of horizontal and vertical members and the distance between the top of the horizontal members is 45 inches or more, spacing between vertical members shall not exceed 4 inches. Where there are decorative cutouts within vertical members, spacing within the cutouts shall not exceed 1¾ inches in width. Where the fence is composed of diagonal members, such as a lattice fence, the maximum opening formed by the diagonal members shall be no more than 1¾ inches. Construction of Gates: The method of construction for gates shall comply with Subsection 6 above. As a covered entity under Title II of the Americans with Disabilities Act, the City of Los Angeles does not discriminate on the basis of disability and, upon request, will provide reasonable accommodation to ensure equal access to its programs, services and activities. Angeles does not discriminate on the basis of disability and, upon request, will provide reasonable accommodation to ensure equal access to its programs, services and activities. For efficient handling of information internally and in the internet, conversion to this new format of code related and administrative information bulletins including MGD and RGA that were previously issued will allow flexibility and

timely distribution of information to the public. Page 6 of 10 P/BC 2023-014 b. c. d. 8. Private Pools: All access gates through the enclosure shall open away from the swimming pool and shall be self-closing with a self-latching device placed no lower than **60 inches above the ground**. Driveway Gates: Driveway Gates are those gates across driveways. The Department may approve the use of Driveway Gates on a case-by-case modification, provided the following conditions are met: i. ii. iii. iv. v. The driveway gate shall be equipped with an electric gate operating device that is approved by a recognized electrical testing agency. The electric gate operating devices shall be provided with a safety mechanism to interrupt and recycle the device, should the gate become blocked. The electric gate operating devices shall be provided with a time delay closing device, which is set and maintained to activate a maximum of 20 seconds after the gate has been opened. No manual control or override mechanism shall be installed on or in connection with the gate operating device. The driveway gate shall open outward away from the pool or shall be a sliding gate. Public Pools: All gates shall be equipped with self-closing and self-latching devices. The self-latching device shall be designed to keep the gate securely closed. Gates shall open outward away from the pool. Hand activated gate opening hardware shall be located at least 42 inches above the deck or walkway. All public pools shall provide a five-foot high pool enclosure, which complies with the requirements of LABC Section 3119B and with the fence construction requirements of Subsection 6 of Section IV of this bulletin. Exit Alarm for Private Pool: The term Exit Alarm shall mean an approved device that makes audible, continuous alarm sounds when any door that permits access from the residence to the pool area, and is without any intervening enclosure, is opened or is left ajar. Exit alarms may be battery operated or may be connected to the electrical wiring of the building. All exit alarms shall be permanently attached to the door at a minimum height of 54 inches above the floor. Exit alarms shall not be permitted when they are attached to the door in a manner where it may be easily removed without the use of tools. The use of Velcro Alarms shall not be allowed. Velcro Alarms are those exit alarms attached to the door by use of velcro or selfadhesive. Exception: Exit alarms need not be required when the following conditions are met (unless the alarm is being used as (1) of the (2) required safety features per 3109.2): i. ii. Doors providing direct access from a building to the swimming pool are equipped with self-closing, self-latching devices with a release mechanism placed no lower than 54 inches above the floor, or The pool is equipped with an approved safety pool cover which is manually or power-operated and meets all of the performance standards of ASTM F 1346.

329: Conditions noted: Enclosure does not meet the 5 feet high rule. Exit doors do not have alarms informing entry to pool area. Please see city requirements listed in above comments.

Environmental Concerns

Environmental issues include but are not limited to radon, fungi/mold, asbestos, lead paint, lead contamination, toxic waste, formaldehyde, electromagnetic radiation, buried fuel oil tanks, ground water contamination and soil contamination. We are not trained or licensed to recognize or discuss any of these materials. We may make reference to one of more of these materials in this report when we recognize one of the common forms of these substances. If further study or analysis seems prudent, the advice and services of the appropriate specialists are advised.