
1) Code Programming ON



2) USB COM Port Emulation




3) Enable QR Code

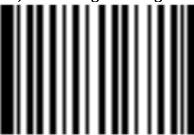

4) Enable Baud Rate 57600



5) No Parity Check

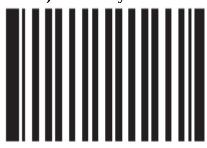

6) Disable Hardware Auto Flow Control



7) 8 Data Bits



8) 1 Stop Bits



