

2) USB COM Port Emulation



3) Enable QR Code



4) Enable Baud Rate 57600



5) No Parity Check




6) Disable Hardware Auto Flow Control



7) 8 Data Bits



8) 1 Stop Bits

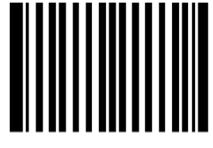

9) Code Programming O..

