EXTERIOR

CONTENTS

GENERAL 2	WASHER TANK AND HOSES6	
Outline of Change 2	INTERCOOLER & RADIATOR WATER	
SPECIAL TOOL2		
FRONT BUMPER 2	MARKS 8	
AFRO PARTS 4		

GENERAL

OUTLINE OF CHANGE

As the following changes had been made, the service procedures for the relating components have been newly established.

- Front bumper and aero parts changed
- Front and rear window washer tank relocated to the luggage compartment
- Intercooler & radiator water spray system changed
- Marks changed

SPECIAL TOOL


Tool	Number	Name	Use
	MB990784	Ornament remover	Removal of front bumper
B990784			

FRONT BUMPER


REMOVAL AND INSTALLATION

Pre-removal and Post-installation Operations

• Front Turn Signal Lamp Removal and Installation

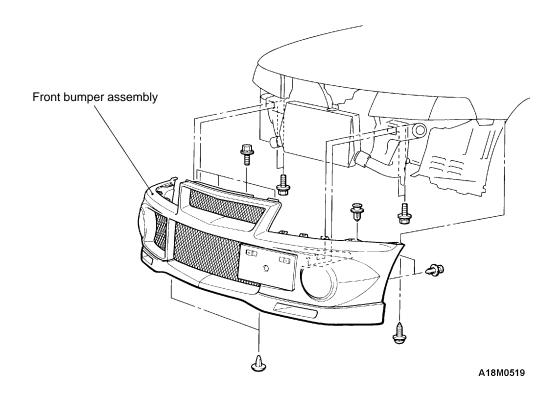

DISASSEMBLY AND REASSEMBLY

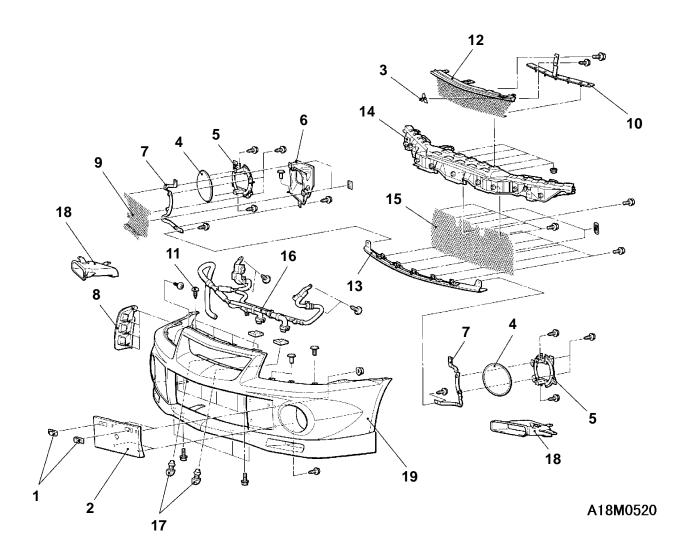

Disassembly steps

- Front airdam (Refer to P.51-4)
 Licence plate bracket
 Licence plate garnish
 Three-diamond mark


- 4. Front fog lamp cover 5. Front fog lamp plate 6. Oil cooler duct

- 7. Bumper side stay
 8. Air outlet garnish (R.H. side only)
 9. Bumper side net
 10. Bumper bolt plate

- 12. Bumper upper reinforcement assembly13. Bumper lower reinforcement14. Bumper reinforcement15. Bumper center net

- 16. Water spray hose assembly
 17. Water spray nozzle
 18. Air blow duct
- 19. Bumper face

11. Clip

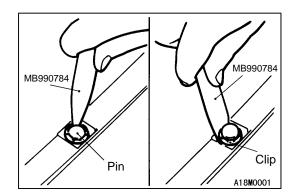


DISASSEMBLY SERVICE POINT

▲A► CLIP REMOVAL

- 1. Use the special tool to pull up the center pin in the clip.
- 2. Remove the clip.

AERO PARTS
REMOVAL AND INSTALLATION

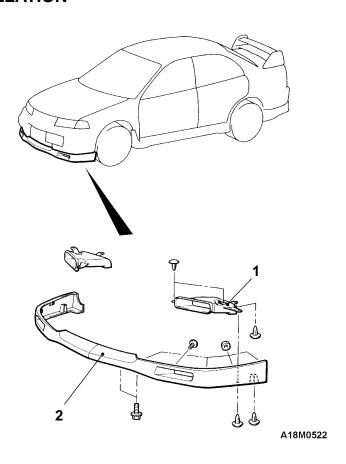

Front airdam removal steps


1. Air blow duct




2. Front airdam

NOTE

The removal and installation service points for the new model are the same as those for the preceding models.

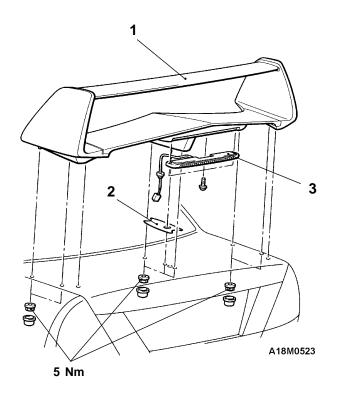

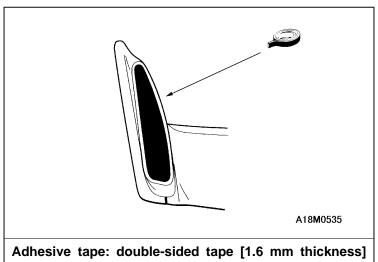

Rear spoiler removal steps


- Rear spoiler
 Packing
 High-mount stop lamp

WASHER TANK AND HOSES

REMOVAL AND INSTALLATION

Pre-removal and Post-installation Operations

- Washer Fluid Draining and Pouring Trunk Side Trim (L.H.) Removal and Installation <GSR>

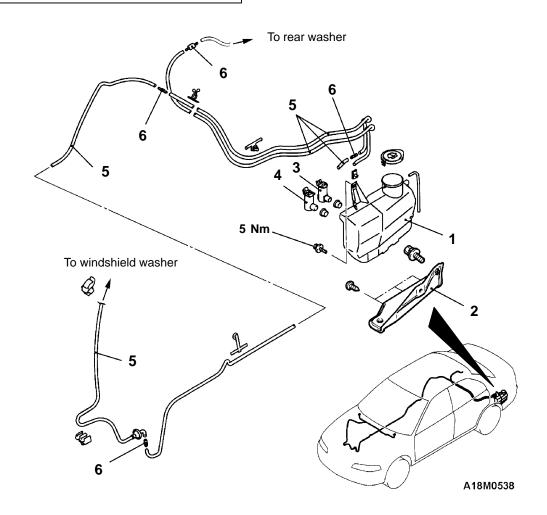

Washer tank removal steps


- 1. Washer tank assembly
- 2. Washer tank bracket



- A 3. Washer motor (rear)A 4. Washer motor (front)

Washer hose removal steps

- Front seat and rear seat
- Floor carpet
- 5. Washer hose
- 6. Joint

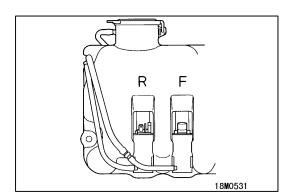

INSTALLATION SERVICE POINT

▶A ■ WASHER MOTOR (FRONT) / WASHER MOTOR (REAR) INSTALLATION


When installing the washer motors, pay special attention to the following:

- 1. Connector shape (front: 2-pole round connector, rear: 2-pole square connector)
- 2. Connection of washer tubes

INTERCOOLER & RADIATOR WATER SPRAY SYSTEM

REMOVAL AND INSTALLATION

Pre-removal and Post-installation OperationsFront Bumper Removal and Installation (Refer to P.51-2)

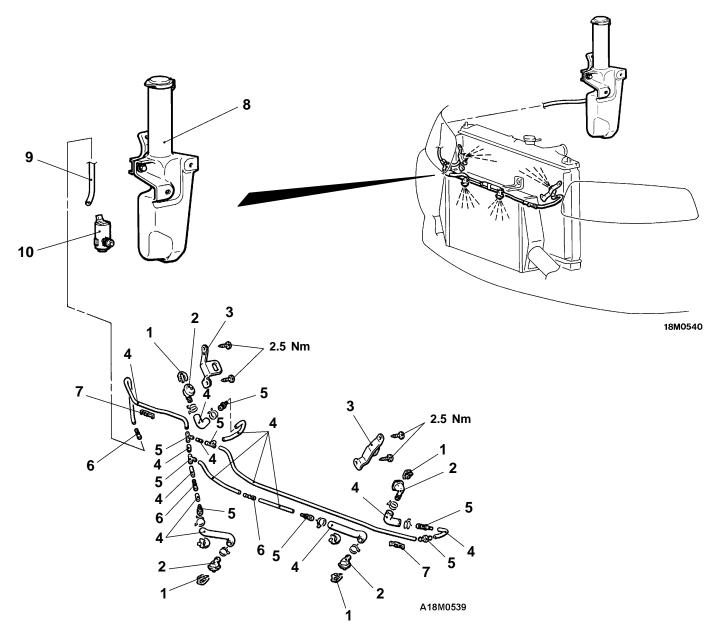

- 1. Clamp
- 2. Water spray nozzle
- 3. Water spray nozzle bracket
- **►**A
- 4. Water spray hose
- 5. Joint
- 6. Stop valve
- **►A** 7. Clip

Water spray motor removal steps


- 8. Water spray tank
- 9. Water spray hose
- 10. Water spray tank

NOTE

- (1) The installation service points for the new model are the same as those for preceding models.
- (2) The water spray switch can be serviced in the same procedure as for the preceding models.

MARKS

REMOVAL AND INSTALLATION

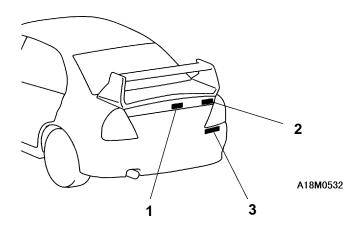


A ■ 1. Three-diamond markA ■ 2. EVOLUTION-VI markA ■ 3. LANCER mark

INSTALLATION SERVICE POINT


►A MARK INSTALLATION

Mounting Positions


1. Three-diamond mark

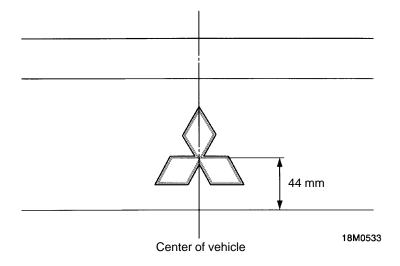

2. EVOLUTION-VI mark

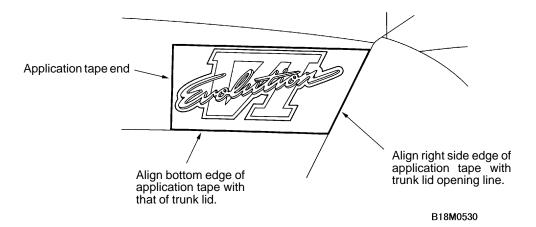

3. LANCER mark

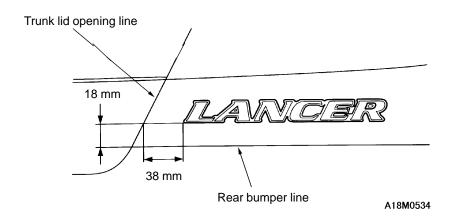

INSTALLATION

- 1. Clean the mark installation surfaces on the body with unleaded petrol.
- 2. Peel off the backing paper from the reverse side of the marks, and then attach the marks to the vehicle body so that they fit properly into position.

Caution

- (1) When attaching the marks, the surrounding temperature should be 20 38°C and the air should be completely free from dust.
- (2) If the surrounding temperature is lower than 20° C, the marks and the places on the body where the marks are to be attached should be heated to $20 30^{\circ}$ C.
- (3) After sticking, press the marks strongly against the body panels. Neglecting this could cause peeled off marks.

NOTES