



Left Arm

Joint configuration

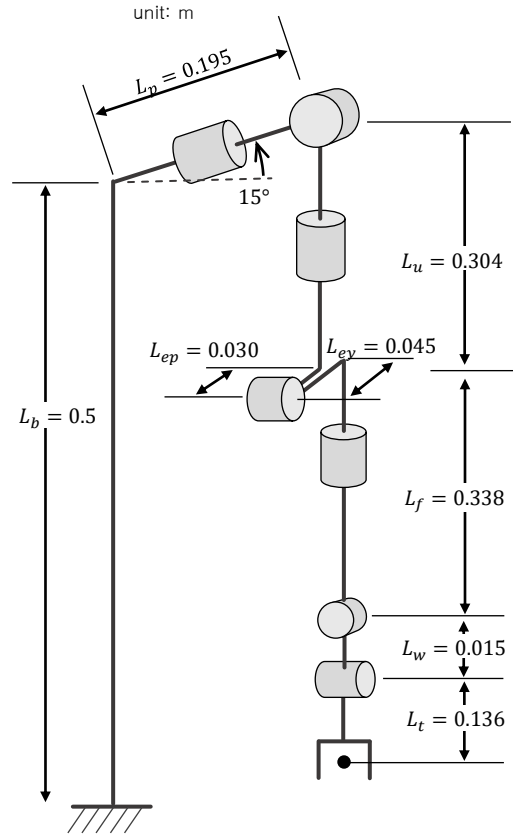

Link & joint numbering
Axes and coordinates

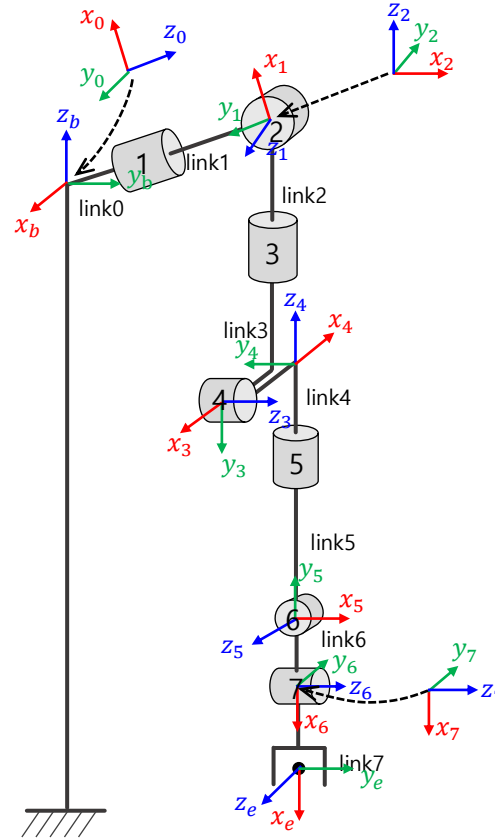


DH parameter

HT	θ_i	d_i	A_i	α_i
0T_1	q_1	L_p	0	-90°
1T_2	$q_2 - 105^\circ$	0	0	-90°
2T_3	$q_3 - 90^\circ$	$-L_u$	L_{ep}	-90°
3T_4	$q_4 + 180^\circ$	0	L_{ey}	-90°
4T_5	$q_5 - 90^\circ$	$-L_f$	0	90°
5T_6	$q_6 - 90^\circ$	0	$-L_w$	-90°
6T_7	q_7	0	L_t	0


$${}^bT_0 = \begin{bmatrix} 0 & 1 & 0 & 0 \\ -\sin(15^\circ) & 0 & \cos(15^\circ) & 0 \\ \cos(15^\circ) & 0 & \sin(15^\circ) & L_b \\ 0 & 0 & 0 & 1 \end{bmatrix}$$

$${}^7T_e = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 0 & -1 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$


Right Arm

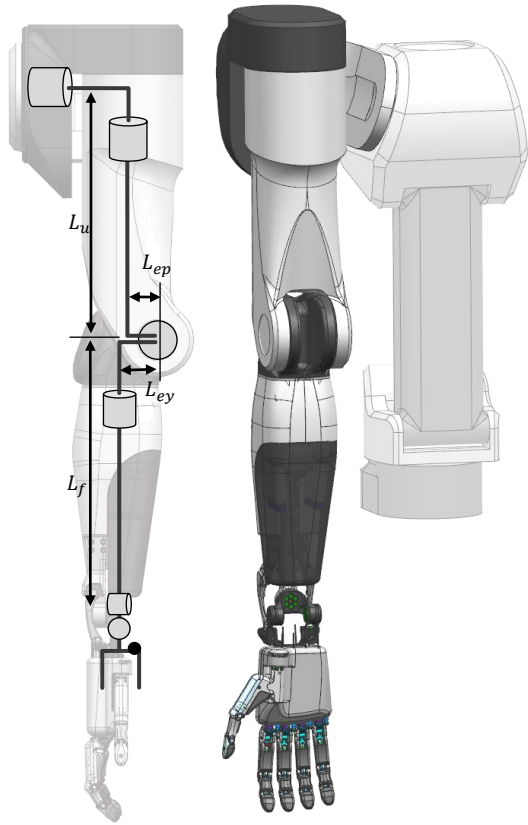

Joint configuration

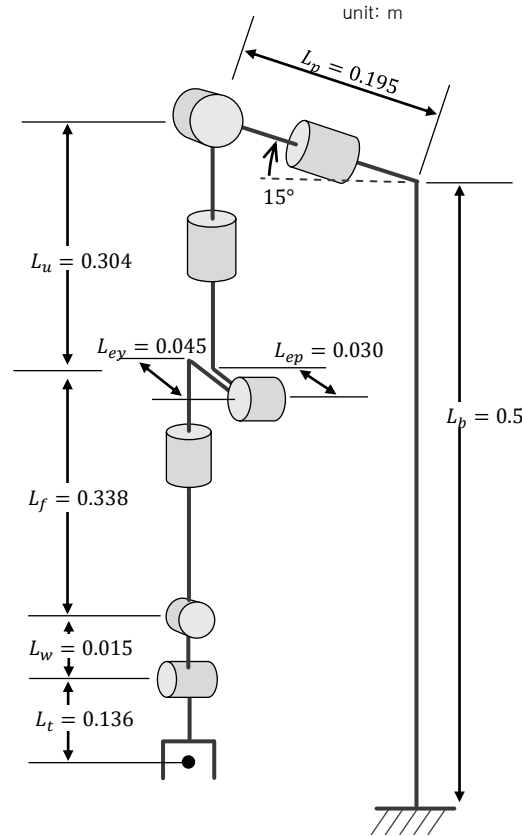

Link & joint numbering
Axes and coordinates

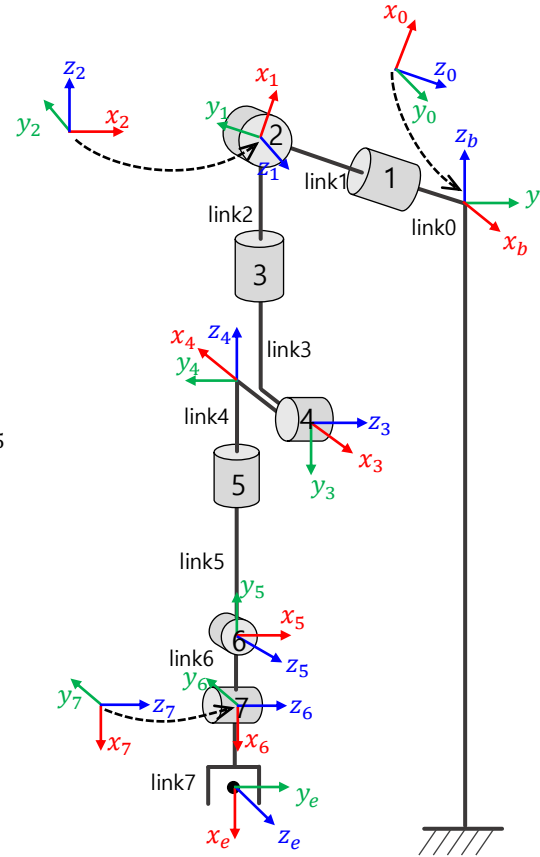

DH parameter

HT	θ_i	d_i	A_i	α_i
0T_1	q_1	$-L_p$	0	-90°
1T_2	$q_2 - 75^\circ$	0	0	-90°
2T_3	$q_3 - 90^\circ$	$-L_u$	L_{ep}	-90°
3T_4	$q_4 + 180^\circ$	0	L_{ey}	-90°
4T_5	$q_5 - 90^\circ$	$-L_f$	0	90°
5T_6	$q_6 - 90^\circ$	0	$-L_w$	-90°
6T_7	q_7	0	L_t	0

$${}^bT_0 = \begin{bmatrix} 0 & 1 & 0 & 0 \\ \sin(15^\circ) & 0 & \cos(15^\circ) & 0 \\ \cos(15^\circ) & 0 & -\sin(15^\circ) & L_b \\ 0 & 0 & 0 & 1 \end{bmatrix}$$

$${}^7T_e = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 0 & -1 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$