

Australian Government

Department of Agriculture, Water and the Environment

Australian Antarctic Division

Asbestos Register
Mawson Station

File [RM8] Ref: CD14/43 [v5]	**Responsible Officer**: Infrastructure Engineer	**Authorising Officer**: General Manager Support and Operations	**Authorisation Date**: 07/12/2018
Version Number: 5			**Reviewed Date**: 16/06/2021
Location of Hard Copies/Points of Use: Antarctic Infrastructure Kingston, Mawson Station			

Contents

1. Asbestos at Mawson 1
2. What is the asbestos register? 1
3. Asbestos Management Plan 1
4. Limitations of the asbestos register 1
5. Disturbing or changing buildings 1
6. What to do before commencing work which may involve asbestos 1
7. Sample information 2
8. Risk assessment criteria 2
9. Asbestos free buildings and structures 3
10. Buildings and structures where asbestos has not been identified 4
11. Buildings and structures which contain asbestos 5
12. Vehicles and machinery which contain asbestos 6
13. Inspection record 6
14. Further information 6
15. Asbestos register table 7
16. Photos 18

1. Asbestos at Mawson

Asbestos was used as a building product at Mawson from 1954 through to the late 1980s. It is still present in a number of the current station buildings, field huts, vehicles, machinery and in the old tip site. Australia has now banned the use of asbestos but existing asbestos must be managed to ensure that it does not become a health risk. The AAD's Antarctic Infrastructure section is responsible for managing asbestos in Antarctica and at Macquarie Island. The station trades team, supported by head office, carries out maintenance and management activities to safely manage the asbestos at Mawson.

Materials which can contain asbestos include cement sheet floors and walls or roof cladding, gaskets, and vinyl tiles. Heritage items, for example old electronic equipment may also contain asbestos.

2. What is the asbestos register?

This asbestos register is a list of all of the known asbestos containing material or material which is presumed to contain asbestos at the station and in the station operating area. This includes station buildings and infrastructure, field huts, heritage sites, vehicles, machinery and abandoned tip sites. The register contains information about the location and condition of asbestos containing material. The register is used to help people at the station work safely around asbestos and is also used to help ensure that asbestos is safely managed and maintained.

3. Asbestos Management Plan

The Asbestos Management Plan is a comprehensive source of information which defines the AAD's methods and practices for safely managing asbestos in Antarctica and the subantarctic. Any work which involves asbestos must follow the requirements and procedures contained in the Asbestos Management Plan.

4. Limitations of the asbestos register

The asbestos register lists known and presumed asbestos containing material. The station has been inspected to identify asbestos, however it is possible that there is asbestos which does not appear in the register. The absence of an entry in the register is not a guarantee that a building or area is free from asbestos.

5. Disturbing or changing buildings

Precautions need to be taken when doing any work on a building. Work on buildings may only be carried out by authorised personnel. Details of precautions and authorisations are covered in the AAD standard operating procedure *Changing or Disturbing the Fabric of a Building*.

6. What to do before commencing work which may involve asbestos

All work which involves asbestos must be carried out in accordance with the procedures outlined in the Asbestos Management Plan. You should read the relevant sections of the plan and ensure that you assess the risks and comply with the requirements.

7. Sample information

This asbestos register has been prepared based upon inspections and upon analysis of asbestos samples. Information on samples and results is kept by the Antarctic Infrastructure section and is available on request to the Infrastructure Engineer at Kingston. Samples which test negative for asbestos are useful in determining whether asbestos precautions are required when working on a building. These sample results are not presented in this register however they are available on request to the Antarctic Infrastructure section.

8. Risk assessment criteria

The following criteria are used to rate asbestos risk in this register.

Condition Assessment

- **Good** – Asbestos or asbestos containing material in a stable matrix, sealed or firmly bonded to substrate. Undamaged. The material is not considered vulnerable to damage, degradation, or uncontrolled fibre release.
- **Fair** – Asbestos or asbestos containing material shows evidence of exposure, damage or deterioration to small areas. Further damage not likely. Inadvertent exposure to asbestos fibres is possible but unlikely. More frequent monitoring of the condition of these materials is recommended.
- **Poor** – Asbestos or asbestos containing materials that is exposed, damaged or deteriorating. Although fibre exposure may not be occurring, remedial action is recommended to prevent inadvertent exposure or uncontrolled fibre release.
- **Unknown** – Asbestos or asbestos containing materials are suspected to be present however the area is inaccessible or the material cannot be sampled without unacceptable damage e.g. interior or fire door.

Friability

- **Bonded** – Bonded asbestos material is any asbestos containing material other than friable asbestos material.
- **Friable** – Any material that contains asbestos and is in a form of a powder or can be crumbed, pulverised or reduced to powder by hand pressure when dry.
- **Damaged** - The material or its covering has become damaged, deteriorated or delaminated due to factors such as changes in building use, changes in operation and maintenance practices, changes in occupancy, or recurrent damage.
- **Weathered** – Continued exposure to weather and to acid rain results in particles and fibres being dispersed into air and water.

Disturbance Potential

- **Low** – Material is in good condition, non-friable and well-encapsulated e.g. painted soffit, wall/ceiling lining. Minimal likelihood of damage or disturbance to occur under normal conditions. Potential for fibre exposure and/or transfer of fibres to other areas is unlikely unless the material is damaged or disturbed during maintenance, refurbishment, renovation or demolition.
- **Medium** – Material is non-friable and in fair condition. Material is in an exposed location having potential for disturbance. No evidence or <10% area damage. There is potential for further damage or disturbance to occur under normal conditions, or potential for fibre exposure and/or transfer of fibres to other areas.
- **High** – Material is in poor condition or friable. Likelihood exists of further damage or disturbance to materials under normal conditions. Fibre exposure and/or transfer of fibres to other areas is likely.

Risk Rating

- **Risk Rating 1** – High, immediate rectification required.
  Asbestos materials are damaged or subject to continual disturbance and are unstable. There is an increased potential for fibre exposure and/or transfer of fibres to other areas. Prompt abatement required.
- **Risk Rating 2** – Medium risk potential.
  Asbestos is unstable and there is a potential for disturbance, or material is accessible and when disturbed may present a short-term exposure risk, or disturbance due to maintenance, refurbishment, renovation, demolition is likely to occur, or disturbance of asbestos cement debris at soil surface in accessible areas is likely to occur. Control measures to be taken at earliest possible time.
- **Risk Rating 3** – Low risk, potential hazard during refurbishment.
  Friable asbestos is stable and has low disturbance potential, or non-friable asbestos with no or <10% area damage and no exposure risk unless disturbed, or loose cement debris in low access area. Defer action unless disturbance is possible due to maintenance, refurbishment, renovation or demolition.
- **Risk Rating 4** – Negligible risk.
  Non-friable asbestos material is stable. Low potential for disturbance and does not present a risk unless cut, drilled, sanded or abraded. Defer action unless disturbance due to maintenance, refurbishment or demolition.

9. Asbestos free buildings and structures

These buildings are asbestos free. They have been constructed entirely from asbestos free materials.

Building or Structure	Maximo Number
ANARESAT Radome	L1186
ARPANSA Building	L1889
Batching Plant Fuel Tank	L3252
Beche Melon (Sleeping)	L4208
Carpenters Workshop (Rosella)	L1190
Colbeck Hut	L1353
Container (Diesos Storage)	L1881
Container (Drum Storage)	L1880
Container (Emergency Food Store)	L1778
Container (Fuel Spill Kit No.1)	L1882
Container (Fuel Spill Kit No.2)	L1883
Container (Incinerator General Storage)	L1879
Container (Load Bank)	L1892
Container (Recyclables)	L1781
Detonator Magazine	L1930
Dog Lines	L1779
Explosives Magazine	L1785
Field Store	L1770
Fuel Tank (Incinerator)	L1222
Fuel Tank (Water Supply Building)	L1223
Gas Storage Platform	L1193
Hazardous Goods Store	L1415
Helipads	L1214

Incoll Hut	L1232
Meteorology Theodolite Hut	L1225
Mt Parsons Comms Repeater	L1368
Receiver Antenna Farm	L1184
Remote Receiver Hut	L1183
Ring Main Unit No. 1	L1165
Ring Main Unit No. 2	L1166
Ring Main Unit No. 3	L1167
Ring Main Unit No. 4	L1168
Ring Main Unit No. 5	L1169
Rock Crushing Plant	L1219
Transceiver Hut	L1187
Transmitter Antenna Farm	L1182
Waste Treatment Building	L1209
Wharf	L1212
Wind Turbine Generator No. 1	L1170
Wind Turbine Generator No. 2	L1171
Workshop	L1188

10. Buildings and structures where asbestos has not been identified

The following buildings and structures have been inspected and no asbestos has been found. They are not listed as asbestos free buildings because there is a possibility that they may contain asbestos which has not been discovered. Many of these buildings are old and there may be uncertainty around the types of materials which were used in their construction. All work which may disturb the fabric of these buildings must still consider the risk of asbestos.

Building or Structure	Maximo Number
Balloon Release Building	L1226
Beche Googie (Laboratory)	L4209
Beche Googie (Sleeping)	L4207
Beche Storage Container	
Cemetery West Arm	L1780
Clean Air Laboratory	L1224
Concrete Batching Plant	L1218
Container (AGSO Storage)	L1198
Container (Boating Store)	L1197
Container (Carpenters Timber Store)	L1196
Container (Carpenters Tool Store)	L1195
Container (Flour Cold Store)	L1204
Container (Food Storage)	L1199
Container (Plumbers Store)	L1203
Container (Potato Cold Store)	L1205
Container (Riggers Store)	L1201
Container (Unistrut Bolt Store)	L1202
Container (Vegetable Store)	L1200
Electrical Store (Old Station)	L1786
Emergency Vehicle Shelter	L1210

Fang Hut	L1355
Glacio Hut (Old Station)	L1875
Hydroponics	L1175
Isocyanates Container	L1234
Ledingham Depot Hut	L1356
Macey Island Hut	L1357
Magnetic Absolute Hut	L1233
Magnetic Variometer Building	L1227
Mount Henderson Hut	L1358
Old Explosives Hut	L1194
Old Incinerator	L1215
Operations Building	L1180
RMIT Van	L1179
Rumdoodle Hut	L1359
Scullin Monolith Refuge	L1360
Sheet Metal Workshop (Surgery Old Station)	L1951
Site Services	L1211
Site Services Hut	L1192
Smokers Hut	L1176
Weddell (Old Station)	L1243

11. Buildings and structures which contain asbestos

The following buildings and structures contain or are presumed to contain asbestos. This table is intended as a summary. Details are given in the asbestos register table.

Building or Structure	Maximo Number
Aeronomy Building	L1228
ANARESAT Equipment Building	L1185
Biscoe (Old Station)	L1238
Cosray Building	L1230
Dog Hut (Old Station)	L1874
Dovers (Old Station)	L1241
East Arm Old Tip Site	
Electricians Workshop (Old Station)	L1189
Emergency Powerhouse	L1164
Fuel Settling Tank (MPH/EPH)	L1220
Green Store	L1191
Hangar (Old Station)	L1213
Incinerator Building	L1208
Living Quarters	L1172
Lower Fuel Farm	L1217
Main Powerhouse (sub-floor dust tested in 2020; not asbestos found)	L1163
PID Van (Old Station)	L1239
Science Building (Wombat)	L1231
Shackleton (Old Station)	L1242
Sleeping and Medical Quarters	L1173
Tankhouse	L1207

Transmitter Building	L1181
Upper Fuel Farm	L1216
Water Supply Building	L1206
Wilkins (Old Station)	L1244

12. Vehicles and machinery which contain asbestos

The following vehicles and items of machinery contain or are presumed to contain asbestos. This table is intended as a summary. Details are given in the asbestos register table.

Building or Machine	Maximo Number
GAAM Fire Pump P-69 (Fire Hagg Pump)	E3923
GAAM Fire Pump P-25 (Frame-mounted Transfer Pump)	E3886

13. Inspection record

The following asbestos inspections have been carried out.

Inspection Details (Maximo work order number)	Person	Date
Initial inspection, sampling and preparation of asbestos register.	C. Langley	March 2005
Condition inspection.	G. Freeman	September 2008
Condition inspection.	M. Bartulovic, T. Clarke, L. Sice	October 2009
Condition inspection.	J. Milne	February 2010
Condition inspection.	C. Wilson	June 2011
Condition inspection (WM469420).	P. Layt	January 2016
Condition inspection (WM472980).	C. Hill, B. Sambrooks	February 2017
Condition inspection (WM478837).	P. Layt	January 2018
Condition inspection (WM481606).	M. Slaven	January 2019
Condition inspection (WM487466).	C .George	January 2020
Condition inspection (WM492185).	W. O'Brien	February 2021
Condition inspection (WM517112).	J. Herman	April 2026

14. Further information

If you have questions about asbestos or you are unsure how to interpret the information in this register, please contact you station Engineering or Building Services Supervisor, the AAD's Work Health and Safety Manager or the Infrastructure Engineer at Kingston.

- Infrastructure Engineer – Sara Pearce, ph: (03) 6232 3476
- WHS Manager – (TBA) ph: (03) 6232 3341

15. Asbestos register table

Location & Maximo Number	Item	Sample Number	Date Identified	Condition	Friability	Disturbance Potential	Risk Rating	Comments	Action Required	Inspection Notes
Aeronomy Building L1228	Cement sheet underfloor in old section (under Aeronomy Lab) (photos L122801/ 02/ 03).	301020	12/08/1992	Good	Bonded	Low	4	Foam covers the majority of the asbestos sheets.	Check label and re-inspect annually.	Condition – Good
Aeronomy Building L1228	Plant room fire door.	Not sampled	06/05/2016	Good	Bonded	Low	4		Check label and re-inspect annually.	Condition – Good
Aeronomy Building L1228	Cement sheet formwork, outside under rear stairs.	M17-6	31/01/2018	Poor	De-laminating	Low	4	Remaining asbestos has been encapsulated with Emer Proof and Aquabarrier.	Re-inspect encapsulation annually. Apply more Emer Proof if required.	Condition - Unknown Covered with snow
Anaresat Equipment Building L1185	Wall cladding cement sheeting in the entry cold porch and main building (photo L118501).	M068/09 L118501	09/06/2009	Good	Bonded	Low	4	Painted cement sheet. Paint is in excellent condition.	Check label and re-inspect annually. Keep painted.	Condition – Good Sheeting has been patched with prior work, still needs to be re-painted
Anaresat Equipment Building L1185	Floor (photo L118502).	Not sampled	01/09/2008	Unknown	Bonded	Low	4	Cement sheet covered with ply wood and vinyl sheeting. Assume positive.	Check label and re-inspect annually.	Tear in vinyl at joint Either seal exposed flooring or tape over joint
~~**Biscoe (Old Station) L1238**~~	~~Entrance to hut from laundry area, cement sheet on northern ceiling (photo L123801).~~	~~7381/210~~	~~18/04/2005~~	**Removed**	~~Bonded~~	~~Low~~	~~4~~	~~Unpainted chrysotile cement sheet. (Note asbestos wall sheet is now removed).~~	~~Check label and re-inspect annually. Consider painting or plan for removal.~~	**N/A**

Location & Maximo Number	Item	Sample Number	Date Identified	Condition	Friability	Disturbance Potential	Risk Rating	Comments	Action Required	Inspection Notes
Biscoe (Old Station) L1238	Laundry Ceiling (Photo L123801)	Not sampled	02/02/2021	Good	Bonded	Low	4	Cement sheet ceiling in good condition.	Check label and re-inspect annually.	Condition – Good Re-labelled as needed.
Cosray Building L1230	Internal cement sheet wall lining adjacent to cold porch (photo L123001).	Not sampled	01/03/2005	Good	Bonded	Low	4	Assume positive from visual inspection. Painted cement sheet.	Check label and re-inspect annually. Keep painted.	Condition – Good
Cosray Building L1230	Cold porch internal cement sheet wall lining (photo L123002).	Not sampled	01/03/2005	Good	Bonded	Low	4	Assume positive from visual inspection. Painted cement sheet.	Check label and re-inspect annually. Keep painted.	Condition – Good
Cosray Building L1230	Vault rooms cement sheet lining (photo L123003).	M063/09 M068/09 L123001	27/05/2009	Good	Bonded	Low	4	Painted cement sheet.	Check label and re-inspect annually. Keep painted.	Condition - Unknown Haven't had access into vault as of 4/26
Cosray Building L1230	Formwork around exterior footings (photo L123004).	M17-3	2/2/2017	Poor	Bonded Weathered	Low	4	Remaining asbestos has been encapsulated with Emer Proof and Aquabarrier.	Re-inspect encapsulation annually. Apply more Emer Proof if required.	Condition - Unknown Covered with snow
Dog Hut (Old Station) L1874	External cladding (photo L187401).	L187401	11/03/2010	Poor	Bonded Weathered	High	3	External cement sheet is badly weathered. Exclusion zone – access restricted to infrastructure personnel only for essential tasks.	Check labels and signs and re-inspect annually. **Plan for removal.**	Condition – Same
Dog Hut (Old Station) L1874	Interior lining (photo L187402/ 03).	L187402	11/03/2010	Fair	Damaged	Medium	3	Cement sheet. Some damaged areas. Exclusion zone.	Check label and re-inspect annually. **Plan for removal.**	Condition – Same

Location & Maximo Number	Item	Sample Number	Date Identified	Condition	Friability	Disturbance Potential	Risk Rating	Comments	Action Required	Inspection Notes
Dovers (Old Station) L1241	Internal cement sheet partitions (photo L124101).	7381/224	18/04/2005	Fair	Bonded	Medium	3	Painted cement sheet.	Check label and re-inspect annually. Keep painted.	Condition – Same
East Arm	Old tip site (photo EastArm01).	M063/09	27/05/2009	Poor	Weathered	Low	3	Asbestos cement sheet pieces are present in tip debris.	**Continue clean up.**	No clean up has been done as of 4/26
Electricians Workshop (Old Station) L1189	Old tarboard switch board (photo L118901).	Not sampled	01/03/2005	Fair	Bonded	Low	4	Assume positive.	Check label and re-inspect annually.	Condition – Same
Emergency Powerhouse L1164	Gaskets on diesel generator, exhaust and heating hot water system (photos L116401/ 02).	M17-16 M17-17 M17-18 M17-19	01/03/2005	Fair	Bonded	Medium	3	Labels for gaskets should be specific to avoid confusion.	Check label and re-inspect annually. Assume all gaskets contain asbestos unless proven otherwise by testing and observe asbestos precautions if there is any doubt.	No work has been undertaken as of 4/26
Fuel Settling Tank (MPH/ EPH) L1220	Gaskets in tank access hatch covers.	Not sampled	11/05/2017	Good	Bonded	Low	4	Gaskets may contain asbestos. Take precautions when handling gaskets.	Inspect when hatch lids are removed.	**Annual inspection is not required.**
GAAM Fire Pump P-69 E3923	Fire hagg pump gasket.	M17-8	31/01/2018	Good	Bonded	Medium	3	Stored in the emergency vehicle shelter (EVS). Fire Hagg change out 2020 with new Hagg. Labels for gaskets should be specific to avoid confusion	Check label and re-inspect annually.	No work has been undertaken as of 4/26

Location & Maximo Number	Item	Sample Number	Date Identified	Condition	Friability	Disturbance Potential	Risk Rating	Comments	Action Required	Inspection Notes
GAAM Fire Pump P-42 E3897	Transfer pump gasket.	Not sampled	31/01/18	Good	Bonded	Medium	3	Stored in the emergency vehicle shelter (EVS). Labels for gaskets should be specific to avoid confusion.	Check label and re-inspect annually.	No work has been undertaken as of 4/26
Green Store L1191	Gym mezzanine cement sheet floor (photo L119101).	7381/243	18/04/2005	Good	Bonded	Low	4	Chrysotile cement sheet. Edges are painted. Plywood infill was installed in 2019 between the underside of the gym and the top of the freezer below.	Check label and re-inspect annually.	Condition – Good
Hangar (Old Station) L1213	Old tarboard switch board (photo L121301).	Not sampled	01/03/2005	Good	Bonded	Low	4	Assume positive	Check label and re-inspect annually. Consider removal.	Condition - Unknown No access with snowed in entrance
Incinerator Building L1208	Old tarboard switch board (photo L120801).	Not sampled	01/03/2005	Unable to view	Bonded	Low	4	Assume positive.	Check label and re-inspect annually.	Condition – Same
Living Quarters L1172	Gaskets around pipe work in plant room (photo L117201).	M-9 M-10 M-11	31/01/2018	Good	Bonded	Medium	3	Assume all gaskets are positive. Labels for gaskets should be specific to avoid confusion.	Check label and re-inspect annually. Assume all gaskets contain asbestos unless proven otherwise by testing and observe asbestos precautions if there is any doubt.	Condition – Good Re-labelled as needed

Location & Maximo Number	Item	Sample Number	Date Identified	Condition	Friability	Disturbance Potential	Risk Rating	Comments	Action Required	Inspection Notes
Living Quarters L1172	Fire doors to basement from mess	Not sampled	09/01/2020	Good	Bonded	Low	4	Assume positive	Planning to replace doors in conjunction with the Red Shed Refurbishment	Condition – Good
Lower Fuel Farm L1217	Gaskets in tank access hatch covers.	Not sampled	11/05/2017	Good	Bonded	Low	4	Gaskets may contain asbestos. Take precautions when handling gaskets.	Inspect when hatch lids are removed.	**Annual inspection is not required.**
Main Powerhouse L1163	Cement sheet flooring (photo L116301/ 02).	301017	12/08/1992	Good	Bonded	Low	4	Unpainted cement sheet floor. Tiles cover floor in engine and control room. Unpainted underside is accessible from the basement. Samples of dust from purlins and top of cable tray tested in 2019 – no asbestos found.	Check label and re-inspect annually.	Condition – Good
Main Powerhouse L1163	Internal wall cladding cement sheet dado wall (photo L116303/ 04/ 05).	Not sampled	09/07/1991	Good	Bonded	Low	4	Internal wall cladding to dado height (1800 mm) is asbestos.	Check label and re-inspect annually.	Condition – Good
Main Powerhouse L1163	Diesel generator sets 1 to 4, various gaskets.	Not sampled	01/03/2005	Unable to view	Bonded	Low	4	All gaskets have been inspected (2017) and no asbestos containing gaskets were found. Labels fitted to the alternator box as it is the most suitable position on the unit to place it.	Check label and re-inspect annually. This register entry remains current – treat gaskets with caution and observe asbestos precautions if there is any doubt.	No work has been undertaken as of 4/26

Location & Maximo Number	Item	Sample Number	Date Identified	Condition	Friability	Disturbance Potential	Risk Rating	Comments	Action Required	Inspection Notes
PID Van (on Dog Platform Old Station) L1239	Exterior cladding cement sheet (photo L123901/ 02).	L123901	11/03/2010	Very poor	Bonded Weathered	High	3	External cement sheet is badly weathered. Internally clad with Masonite. Exclusion zone – access restricted to infrastructure personnel only for essential tasks.	Check labels and signs and re-inspect annually. **Plan for removal.**	Condition – Same
Science Building (Wombat) L1231	External cement sheet cladding (photo L123101/ 02).	7318/246	18/04/2005	Poor	Weathered	High	2	Cement sheet. Edges of cladding exposed & protective coating weathered. External cladding has been patched many times. Paint missing which has exposed asbestos sheet beneath. Paint was patched summer 16/17.	Check label and re-inspect annually. Continue to monitor and touch up paint as required. **Plan for removal of this building.**	Condition – Same
Science Building (Wombat) L1231	Cement sheet underfloor.	Not sampled	18/04/2005	Fair	Bonded	Low	4	Unpainted cement sheet. Assume positive from visual inspection.	Check label and re-inspect annually.	Condition – Same
Science Building (Wombat) L1231	Cold porch internal wall cladding around door (photo L123103).	7381/214	18/04/2005	Good	Bonded	Low	4	Painted cement sheet. Paint is in excellent condition.	Check label and re-inspect annually. Keep painted.	Condition – Same
Science Building (Wombat) L1231	Plant room (hot water) floor (photo L123104).	7381/213	18/04/2005	Fair	Bonded	Low	4	Painted cement sheet.	Check label and re-inspect annually. Keep painted.	Condition – Same

Location & Maximo Number	Item	Sample Number	Date Identified	Condition	Friability	Disturbance Potential	Risk Rating	Comments	Action Required	Inspection Notes
Science Building (Wombat) L1231	Internal cladding on all external walls (profiled cement sheet & polystyrene sandwich) (photo L123105).	7381/216	18/04/2005	Good	Bonded	Low	4	Painted cement sheet. Internal partitions appear to be painted plasterboard.	Check label and re-inspect annually. Keep painted.	Condition – Same
Science Building (Wombat) L1231	Lining inside fire door into plant room (photo L123106).	Not sampled	18/04/2005	Door good	Friable	Low	3	Assume positive until sampling proves otherwise.	Check label and re-inspect annually.	Condition – Same
Shackleton (Old Station) L1242	Internal cement sheet walls in common areas, bedrooms etc (photo L124201).	7381/223	18/04/2005	Fair	Bonded	Medium	3	Painted cement sheet with numerous patches. Paint in common area peeling. NB Some areas have plaster, plywood etc over original asbestos sheeting.	Check label and re-inspect annually. Consider painting walls which are peeling.	Condition – Same
Shackleton (Old Station) L1242	Old tarboard switch board, (photo L124202).	Not sampled	18/04/2005	Fair	Bonded	Low	4	Assume positive.	Check label and re-inspect annually.	Condition – Same

Location & Maximo Number	Item	Sample Number	Date Identified	Condition	Friability	Disturbance Potential	Risk Rating	Comments	Action Required	Inspection Notes
Sleeping and Medical Quarters L1173	Cement sheet floor on ground floor. Accessible from subfloor (photo L117301/ 02/ 03).	301021 7381/230	12/08/1992	Good	Bonded	Low	3	Floor coverings laid on top of sheet. Underside of unpainted sheet accessible in subfloor. Asbestos precautions required for subfloor access. Nally bins with PPE located below sub floor hatches.	Check label and re-inspect annually. Lots of floor penetrations require sealing (fire collars) in subfloor. Visible dust beneath floor penetrations, requires removal with asbestos vacuum. Planning required WM469511.	Condition – Good Re-stocked Nally bin as needed
Sleeping and Medical Quarters L1173	Fire doors on ground and first floors (photo L117304/ 09/ 10).	M031/10	09/03/2010	Good	Bonded	Low	4	There are 18 asbestos fire doors on the ground floor, 11 on the first floor. Some doors have been replaced with non-asbestos doors. See attached plan.	Check label and re-inspect annually.	Condition – Good Doors no. 5, 6, 11, 17 and 18 have been replaced on the ground floor
~~**Sleeping and Medical Quarters L1173**~~	~~Medical fume cupboard baffle (photo L117305).~~	~~7381/200~~	~~18/04/2005~~	**Removed**	~~Bonded~~	~~Low~~	~~4~~	~~Painted cement sheet.~~	~~Check label and re-inspect annually.~~	**N/A**
~~**Sleeping and Medical Quarters L1173**~~	~~Medical fume cupboard front fascia (photo L117306).~~	~~7381/219~~	~~18/04/2005~~	**Removed**	~~Bonded~~	~~Low~~	~~4~~	~~Painted cement sheet.~~	~~Check label and re-inspect annually.~~	**N/A**

Location & Maximo Number	Item	Sample Number	Date Identified	Condition	Friability	Disturbance Potential	Risk Rating	Comments	Action Required	Inspection Notes
~~**Sleeping and Medical Quarters L1173**~~	~~Medical fume cupboard throat (photo L117307).~~	~~7381/218~~	~~18/04/2005~~	**Removed**	~~Bonded~~	~~Low~~	~~4~~	~~Painted cement sheet. Electricians may require to access behind this panel each year. Use appropriate PPE for this task.~~	~~Check label and re-inspect annually~~.	**N/A**
Sleeping and Medical Quarters L1173	Laundry splashbacks behind tiles (photo L117308).	Not sampled	01/09/2008	Good	Bonded	Low	4	Assume positive from visual inspection.	Check label and re-inspect annually.	Condition – Good
Sleeping and Medical Quarters L1173	Behind tiled areas in the medical suite.	Not sampled	01/09/2008	Good	Bonded	Low	4	Assume positive from visual inspection.	Check label and re-inspect annually.	Condition – Good Has exposed edges from work, needs to be sealed
Sleeping Medical Quarters L1173	Old formwork on stair landings	Not sampled	09/01/2020	Good	Bonded	Low	4	The majority of this has been removed and encapsulated.	Comment on how the encapsulating product is holding up to the weather.	Condition - Unknown Covered with snow
Tankhouse L1207	Formwork outside around concrete base of building.	M17-15	31/01/2018	Fair	Bonded	Low	4	Remaining asbestos has been encapsulated with Emer Proof and Aquabarrier.	Re-inspect encapsulation annually. Apply more Emer Proof if required. Small section under east facing stars was identified as exposed and needs encapsulating.	Condition - Unknown Covered with snow

Location & Maximo Number	Item	Sample Number	Date Identified	Condition	Friability	Disturbance Potential	Risk Rating	Comments	Action Required	Inspection Notes
Transmitter Building L1181	External cement sheet cladding (photo L118101).	Not sampled	18/04/2005	Poor	Weathered	High	2	Assume positive from visual inspection. Edges of cladding exposed & coating weathered. Painted finish is worn and patched.	Check label and re-inspect annually. **Schedule for removal.**	Condition – Same
Transmitter Building L1181	Cement sheet underfloor (photo L118102).	7381/247	18/04/2005	Fair	Bonded	Low	4	Unpainted cement sheet.	Check label and re-inspect annually.	Condition – Same
Transmitter Building L1181	Internal cladding on all external walls (profiled cement sheet sandwich filled with polystyrene) (photo L118103).	7381/216	18/04/2005	Good	Bonded	Low	4	Painted cement sheet. Paint is in good condition. Internal partitions appear to be painted plasterboard.	Check label and re-inspect annually. Keep painted.	Condition – Same
Upper Fuel Farm L1216	Gaskets in tank access hatch covers.	M17-4 M17-5	11/05/2017	Good	Bonded	Low	4	Two gaskets were sampled and contain asbestos. Treat all gaskets as potential asbestos and observe handling precautions.	Inspect when hatch lids are removed.	**Annual inspection is not required.**
Water Supply Building L1206	Formwork around concrete base of building (photo L120601).	7381/229	18/04/2005	Poor	Bonded	Medium	3	Remaining asbestos has been encapsulated with Emer Proof and Aquabarrier.	Re-inspect encapsulation annually. Apply more Emer Proof if required.	Condition - Unknown Covered with snow
Water Supply Building L1206	Formwork on old fuel storage bund across from water supply building. (Photo L120604)	Not sampled	21/12/2017	Fair	Bonded	Low	4	Remaining asbestos has been encapsulated with Emer Proof and Aquabarrier.	Re-inspect encapsulation annually. Apply more Emer Proof if required.	Condition - Unknown Covered with snow

Location & Maximo Number	Item	Sample Number	Date Identified	Condition	Friability	Disturbance Potential	Risk Rating	Comments	Action Required	Inspection Notes
~~**Water Supply Building L1206**~~	~~Pump, various gaskets (photo L120602).~~	~~Not sampled~~	~~18/04/2005~~	Removed	~~Bonded~~	~~Low~~	~~4~~	~~Various manufacturers e.g. Klinger.~~ ~~Some gaskets are stamped with asbestos warnings.~~ ~~Difficult to label, signage may be required.~~	~~Assume all gaskets contain asbestos unless proven otherwise by testing.~~ ~~Check label and re-inspect annually.~~ ~~Organise full survey of gaskets and labelling, replacement and management as appropriate.~~	All gaskets have been removed and replaced with non-asbestos gaskets as of 4/26
Water Supply Building L1206	Old tarboard switch board, (photo L120603).	Not sampled	18/04/2005	Fair	Bonded	Low	4	Assume positive. Not accessible for sampling.	Check label and re-inspect annually.	Condition – Good Relabelled as required
Wilkins (Old Station) L1244	Internal cement sheet partitions (photo L124401/ 02).	301018	12/08/1992	Fair	Bonded	Medium	3	Painted cement sheet with numerous patches.	Check label and re-inspect annually.	Condition – Same

16. Photos

Note that photos are representative of location and are to be used to aid identification of the asbestos items on station. They are not updated each year and are not intended to be a tool for condition assessment.

Photo Number	Location	Photo
L122801	Aeronomy Building underfloor.	
L122802	Aeronomy Building underfloor.	

L122803	Aeronomy Building floor.	
L118501	Anaresat Building cold porch.	
L118502	Anaresat Building floor (inside).	

L123801	Biscoe Hut laundry ceiling.	
L123001	Cosray Building internal wall lining adjacent to cold porch.	
L123002	Cosray Building cold porch wall lining.	

L123003	Cosray Building vault room lining.	
L123004	Cosray Building exterior foundations. *Note, there are several footings under Cosray with encapsulated asbestos.	
L187401	Dog Hut external cladding.	


L187402	Dog Hut interior lining.	
L187403	Dog Hut interior lining.	

L124101	Dovers internal cement sheet walls.	
EastArm 01	East Arm old tip site.	
L118901	Electricians Workshop (Old Station) switch board.	

L116401	Emergency Power House diesel generator gaskets.	
L116402	Emergency Power House diesel generator gaskets.	
L119101	Green Store mezzanine cement sheet.	

L121301	Hangar (Old Station) old switch board.	
L120801	Incinerator Building switch board.	
L117201	Living Quarters plant room gaskets.	

L116301	Main Powerhouse cement sheet floor (photo taken in basement looking up).	
L116302	Main Powerhouse cement sheet floor (photo taken in basement looking up).	
L116303	Main Powerhouse cement sheet internal wall cladding to 1800mm high.	

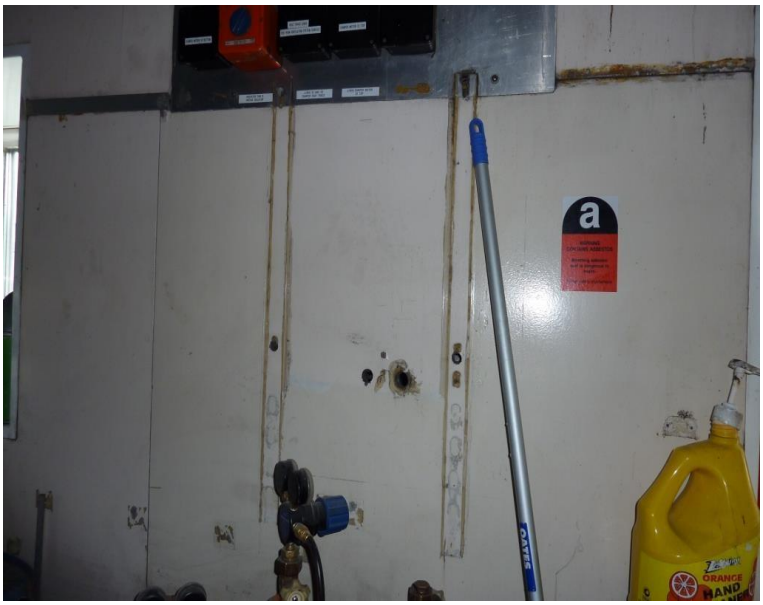L116304	Main Powerhouse cement sheet internal wall cladding to 1800mm high.	
L116305	Main Powerhouse cement sheet internal wall cladding to 1800mm high.	
L123901	PID Van (on dog platform) exterior cladding.	

L123902	PID Van (on dog platform) exterior cladding.	
L123101	Science Building (Wombat) external cement sheet cladding.	

L123102	Science Building (Wombat) external cement sheet cladding.	
L123103	Science Building (Wombat) cold porch internal wall cladding around door.	
L123104	Science Building (Wombat) plant room (hot water) floor.	

L123105	Science Building (Wombat) internal cladding on all external walls (profiled cement sheet & polystyrene sandwich).	
L123106	Science Building (Wombat) lining inside fire door into plant room.	


L124201	Shackleton (Old Station) internal cement sheet walls in common areas, bedrooms etc.	
L124202	Shackleton (Old Station) old switch board.	

L117301	Sleeping and Medical Quarters subfloor cement sheet.	
L117302	Sleeping and Medical Quarters subfloor cement sheet.	
L117303	Sleeping and Medical Quarters subfloor cement sheet.	


L117304	Sleeping and Medical Quarters fire doors. *Fire doors are being replaced with maximo jobs.	
~~L117305~~	~~Sleeping and Medical Quarters fume cupboard baffle.~~ Removed	
~~L117306~~	~~Sleeping and Medical Quarters fume cupboard fascia.~~ Removed	

~~L117307~~	~~Sleeping and Medical Quarters fume cupboard throat.~~ Removed	
L117308	Sleeping and Medical Quarters laundry splashbacks behind tiles.	

L117309	Sleeping and Medical Quarters ground floor fire doors.

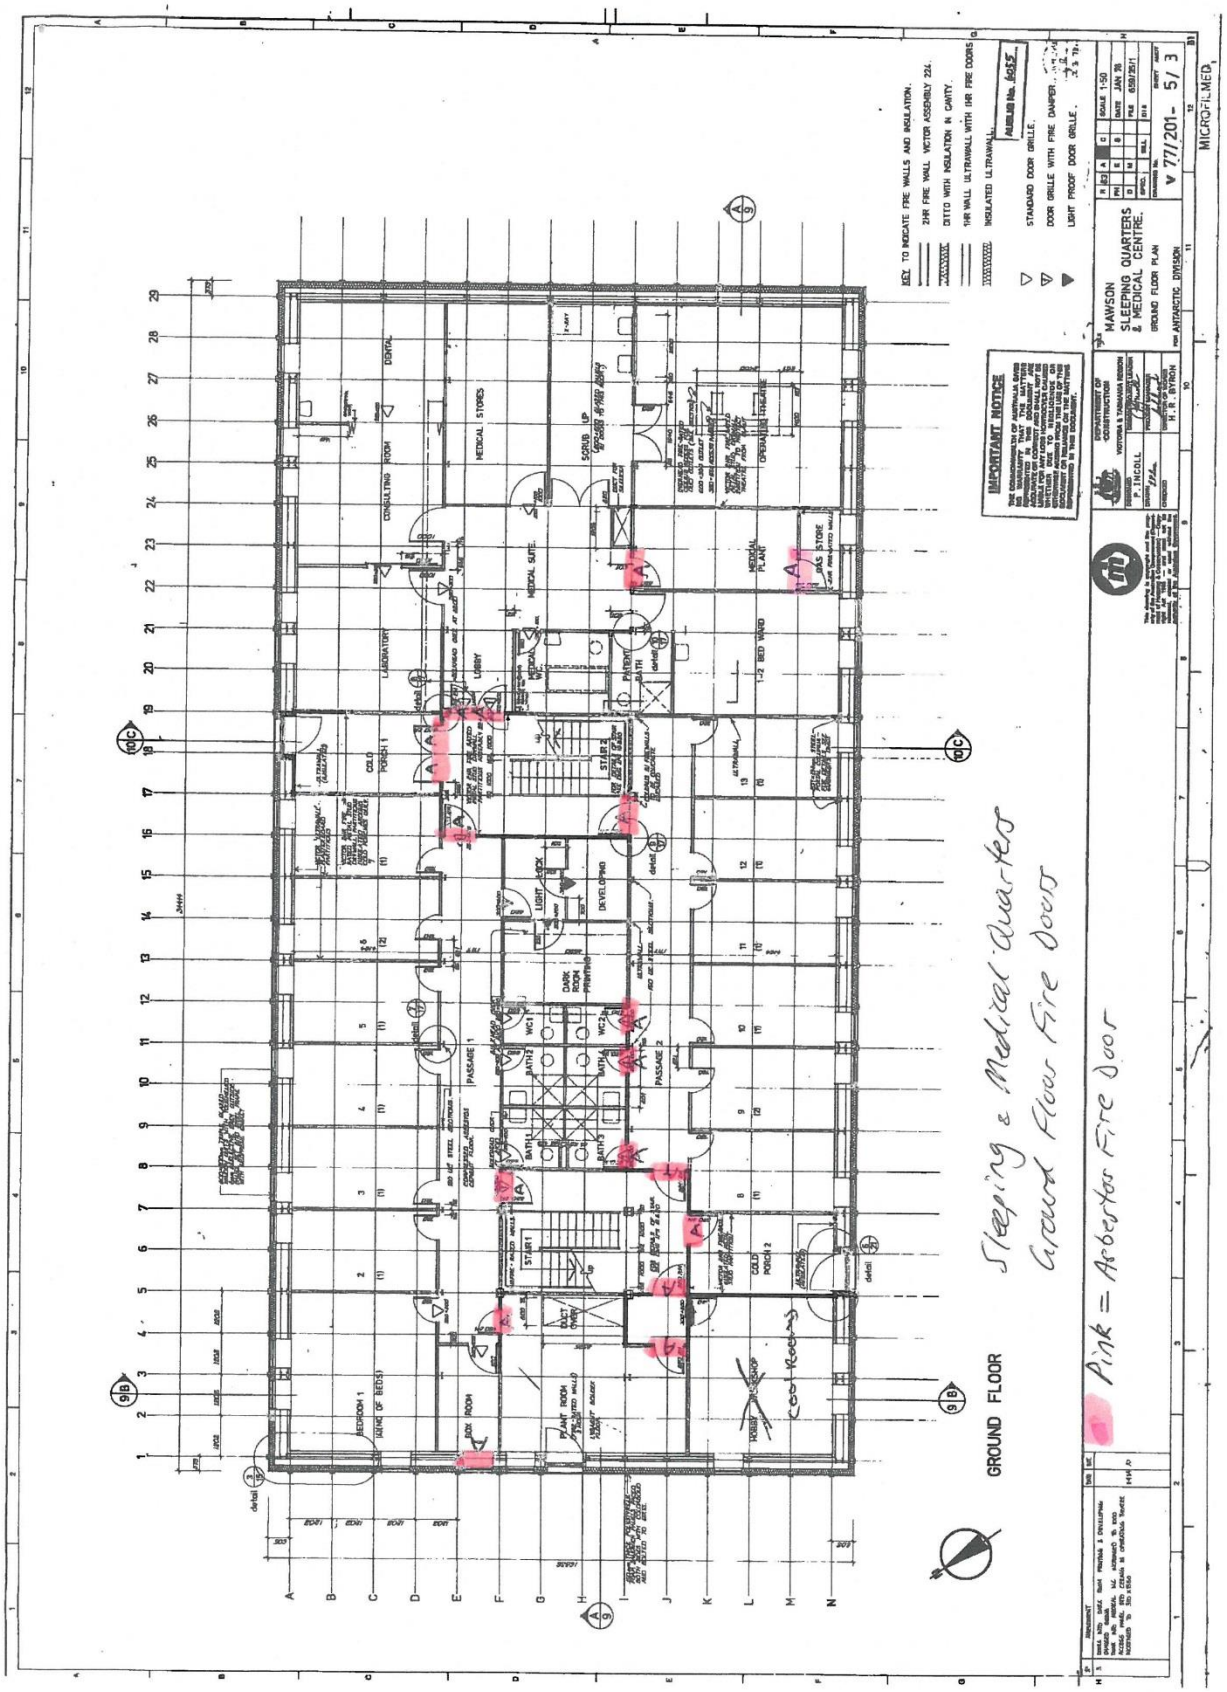


L117310	Sleeping and Medical Quarters first floor fire doors.

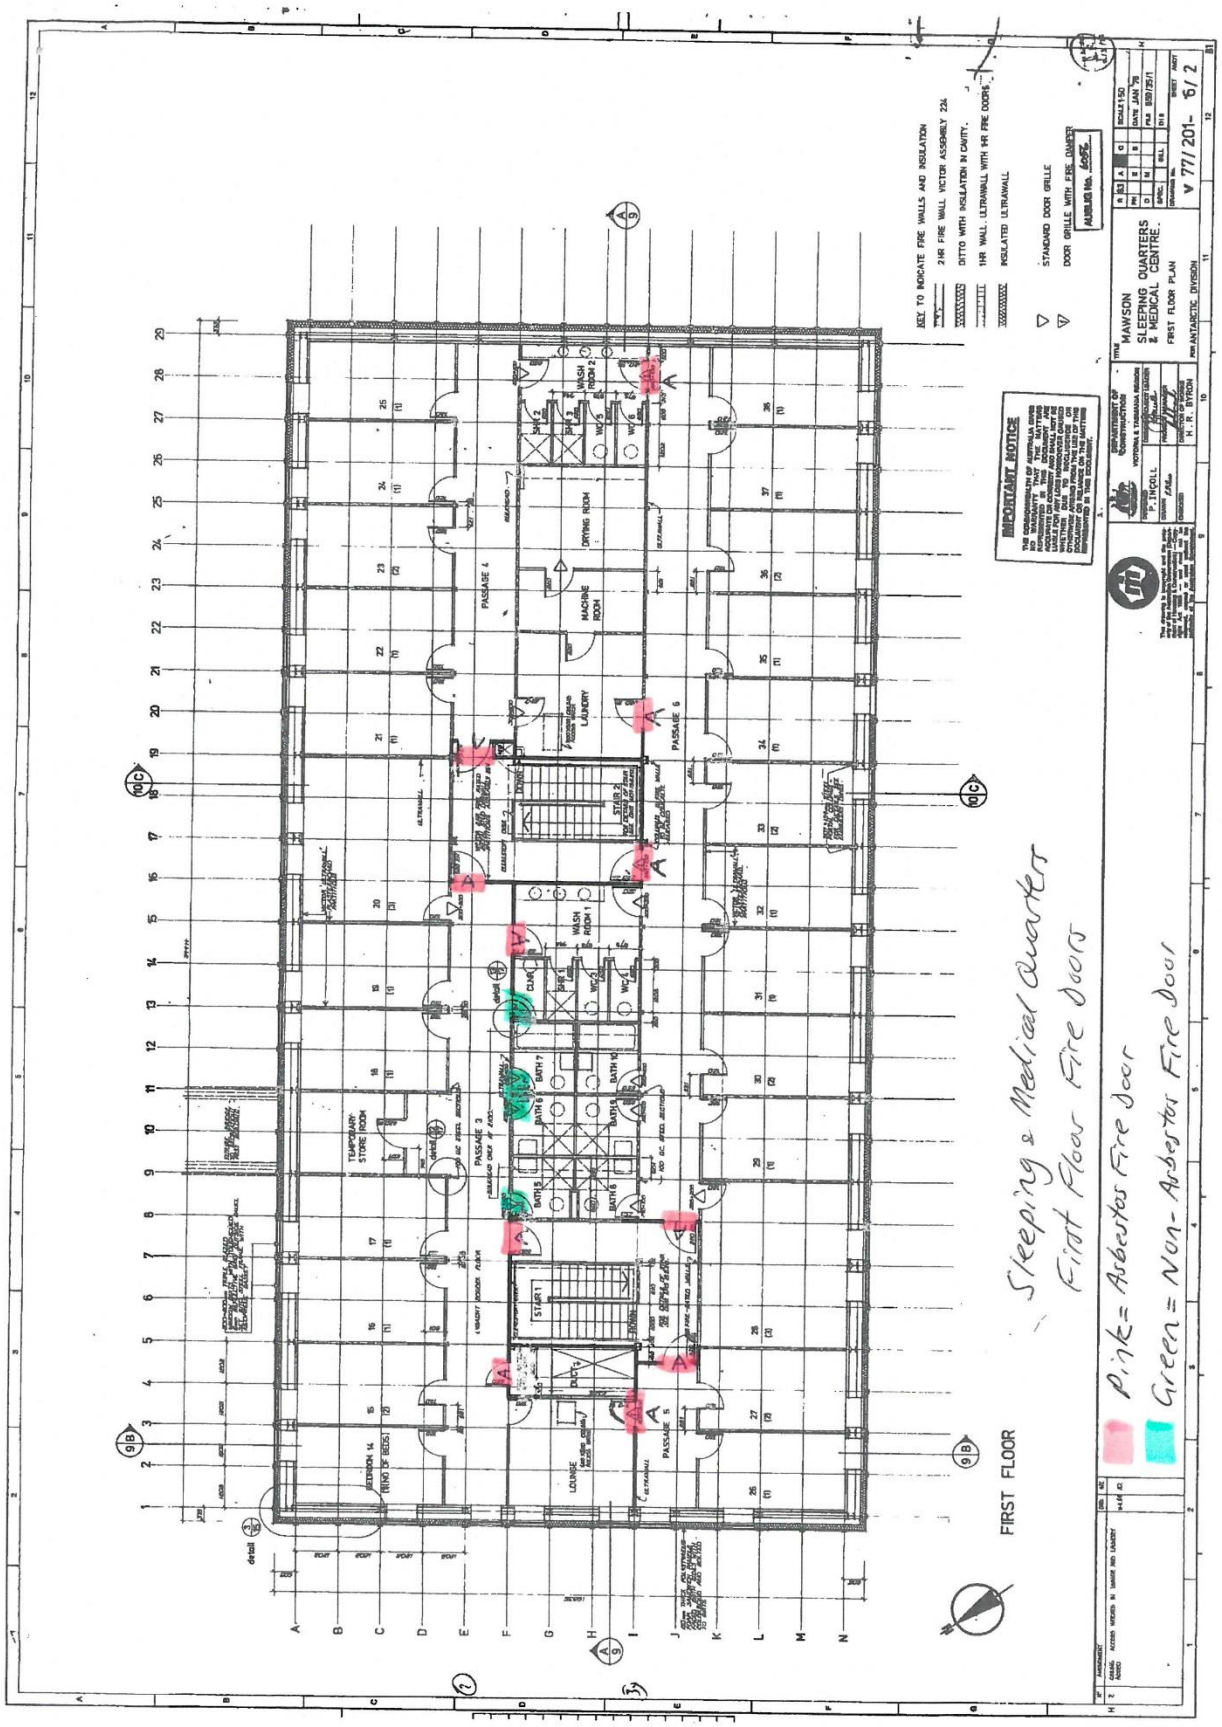

L118101	Transmitter Building external cement sheet cladding.	
L118102	Transmitter Building cement sheet underfloor.	
L118103	Transmitter Building internal cladding on all external walls (profiled cement sheet sandwich filled with polystyrene).	

L120601	Water Supply Building formwork around concrete base of building. * Note the asbestos has been encapsulated	
~~L120602~~	~~Water Supply Building various pump gaskets.~~ All gaskets have been removed and replaced with non-asbestos gaskets	

L120603	Water Supply Building switch board.	
L120604	Water Supply Building (across the road towards the Transceiver Hut) * Note the asbestos has been encapsulated	

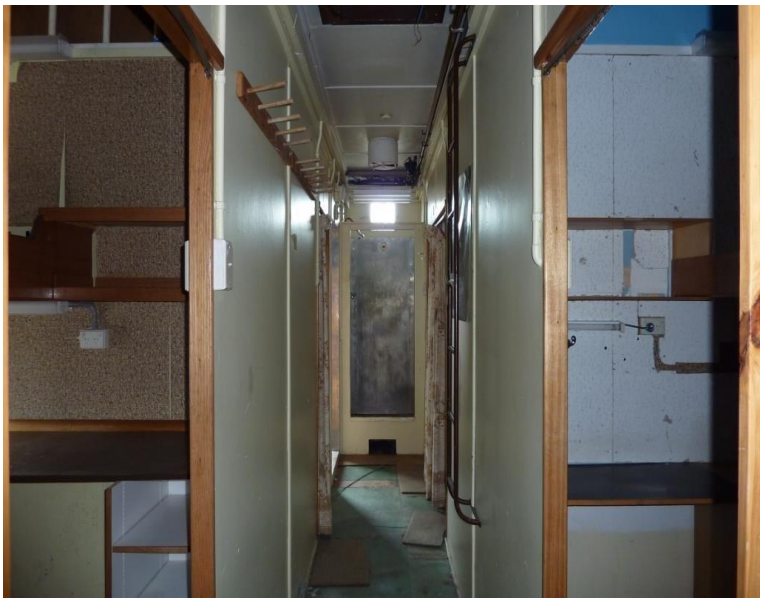L124401	Wilkins (Old Station) internal cement sheet partitions.	
L124402	Wilkins (Old Station) internal cement sheet partitions.	