
DI88W-06

8. Color on navigation screen is unusual (RGB signal error).

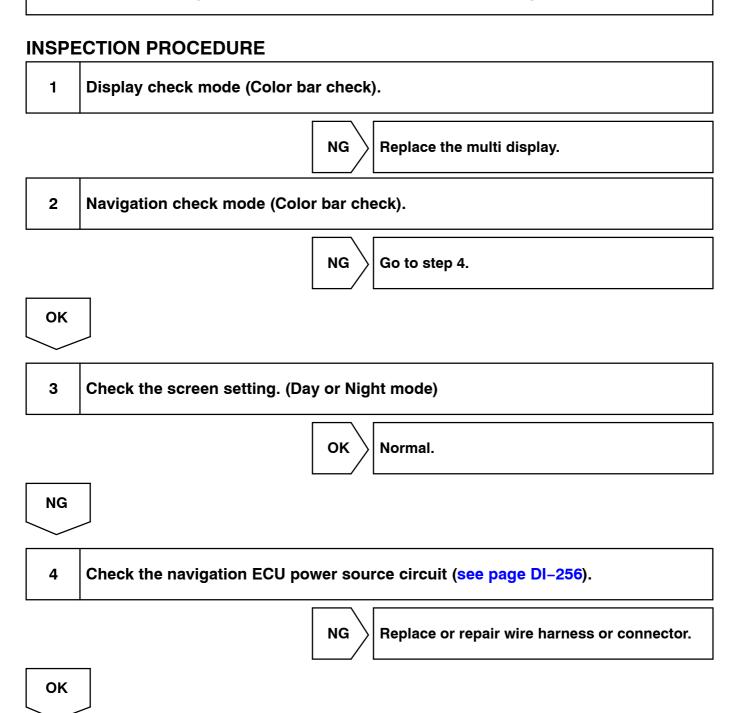

Check the display signal circuit (see page DI-270). 5

NG

Replace or repair wire harness or connector.

OK

Replace the multi -display.