Calibration in touch-screen systems

By Wendy Fang, Precision Analog Applications, High-Performance Analog, and Tony Chang, Precision Analog Nyquist, High-Performance Analog

Introduction

Today, more and more different fields are adopting touch screens or touch panels for applications with human/machinery or human/computer interfaces. Figure 1 is a block diagram of a touch-screen system where the touch screen sensor lies on top of the system's display, in this case an LCD panel.

The touch-screen controller in Figure 1 does not need any calibration by itself. However, products or instrumentation equipped with a touch screen normally require a calibration routine upon power up because it is difficult to perfectly align a touch screen's coordinates with those of the display underneath it. Calibration is necessary when the coordinates of the area touched on the screen are not so

coordinates of the area touched on the screen are not sufficiently close to the coordinates on the display. Without proper calibration, software may not respond correctly when a soft button or icon is pressed.

This article presents concepts and methods for the calibration of touch-screen systems. Software-programming algorithms and their implementation are also discussed.

Touch-coordinate errors

When pressure is applied to the touch screen, the touch-screen controller senses it and takes a measurement of the X and Y coordinates. Several sources of error can affect the accuracy and reliability of this measurement. The majority of these errors can be attributed to electrical noise, scaling factors, and mechanical misalignments.

Electrical noise comes from the display and backlight, the human interface, the panel surface's vibration, and the

Figure 2. Scaling factors on the Y axes of LCD and touch screen


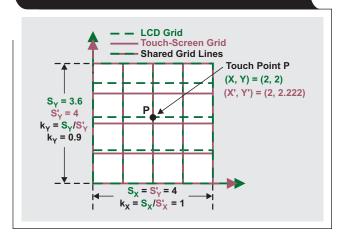


Figure 1. Typical four-wire resistive touch-screen system

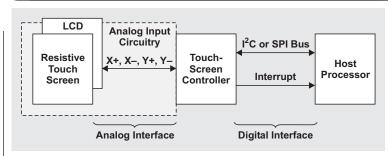

electrostatic discharge and electromagnetic pulses caused by users and their environments. This article does not address noise issues. For more information on handling noise, please see Reference 1.

Scaling factors and mechanical misalignments originate in the parts and assembly of the touch screen and the display. Typically, the touch-screen controller and display in a system do not have the same resolution, so scaling factors are needed to match their coordinates to each other. For example, consider a touch-screen system that uses an LCD with a resolution of 1024 (X coordinate) × 768 (Y coordinate) and the Texas Instruments TSC2005 touch-screen controller with 12-bit (4096×4096) resolution. The scaling factors to match them are $k_X = S_X/S_X' = 1024/4096 = 0.25$ for the X-axis coordinate and $k_Y = S_Y/S_Y' = 768/4096 = 0.1875$ for the Y-axis coordinate, where $\boldsymbol{S}_{\boldsymbol{X}}$ is the LCD's X-axis resolution, S_X' is the touch-screen controller's X-axis resolution, S_V is the LCD's Y-axis resolution, and S_V is the touch-screen controller's Y-axis resolution. Thus, a touchscreen controller's X coordinate, X^{\prime} , should be understood by the LCD (the host) as $X = k_X \times X'$; and a touch-screen controller's Y coordinate, Y', should be understood by the LCD (the host) as $Y = k_v \times Y'$.

In the preceding example, k_X and k_Y are simple linear scaling factors based on the resolution specifications for the display and touch-screen controller. "Real-world" scaling factors may vary from part to part and may need to be calibrated to reduce or eliminate any mismatch. An example is shown in Figure 2, where the X-axis scale is the same on the LCD and the touch screen, or $k_X = S_X/S_X' = 1$; but the Y-axis scale on the LCD is larger than that on the touch screen, with the scaling factor of $k_Y = S_Y/S_Y' = 3.6/4 = 0.9$. Thus, a point P (X', Y') = (2, 2.222) on the touch screen should be scaled to (X, Y) = (2, 2) for the LCD (the host).

Mechanical misalignment between the display and the touch screen includes moving and rotation errors, as shown in Figure 3. Figure 3a shows the relative position shifts of ΔX in the X direction and ΔY in the Y direction; and Figure 3b shows the relative rotation, $\Delta\theta$, between the LCD and the touch screen.

Consider a point P, read as (X', Y') on the touch screen. The display should read a moving error like that shown in Figure 3a as $(X' + \Delta X, Y' + \Delta Y)$. For a rotation error like that shown in Figure 3b, the point on the touch screen is $(R \times \cos\theta, R \times \sin\theta)$, or on the display is $[R \times \cos(\theta - \Delta\theta)]$, $R \times \sin(\theta - \Delta\theta)$, where R is the distance from origin C, or (0, 0), to the point P.

Mathematical expression

Calibration of the touch screen translates the coordinates reported by the touch-screen controller into coordinates that accurately represent the point and image location on the display or LCD. The result of calibration is a set of scaling factors that allow correction of the moving and rotation errors that are due to mechanical misalignments.

Consider the point P, represented as (X, Y) on the display and (X', Y') on the touch panel. Counting in the scaling

factor in Figure 2 and the moving and rotation errors in Figure 3, the touch-screen coordinate X can be expressed as

$$\mathbf{X} = \mathbf{k}_{\mathbf{X}} \times \mathbf{R} \times \cos(\theta - \Delta \theta) + \Delta \mathbf{X}$$

$$= k_X \times R \times \cos\theta \times \cos(\Delta\theta) + k_X \times R \times \sin\theta \times \sin(\Delta\theta) + \Delta X$$

$$= k_X \times X' \times \cos(\Delta \theta) + k_X \times Y' \times \sin(\Delta \theta) + \Delta X$$
 (1)

$$= \alpha_{X} \times X' + \beta_{X} \times Y' + \Delta X,$$

where $X' = R \times \cos\theta$, $Y' = R \times \sin\theta$, $\alpha_X = k_X \times \cos(\Delta\theta)$, and $\beta_X = k_X \times \sin(\Delta\theta)$. Similarly, the touch-screen coordinate Y can be expressed as

$$Y = k_Y \times R \times \sin(\theta - \Delta\theta) + \Delta Y$$

$$= k_{Y} \times R \times \sin \theta \times \cos(\Delta \theta) - k_{Y} \times R \times \cos \theta \times \sin(\Delta \theta) + \Delta Y$$

$$= k_{V} \times Y' \times \cos(\Delta \theta) - k_{V} \times X' \times \sin(\Delta \theta) + \Delta Y$$
 (2)

$$= \alpha_{\rm V} \times X' + \beta_{\rm V} \times Y' + \Delta Y,$$

where $\alpha_Y = -k_Y \times \sin(\Delta\theta)$, and $\beta_Y = k_Y \times \cos(\Delta\theta)$. From Equations 1 and 2 it is obvious that, to get the coefficients α_X , α_Y , β_X , β_Y , ΔX , and ΔY , at least three independent points are needed. The points are independent if they are not on one linear line (see Figure 4). Assuming that (X_1, Y_1) , (X_2, Y_2) , and (X_3, Y_3) are three independent

Figure 3. Mechanical misalignments


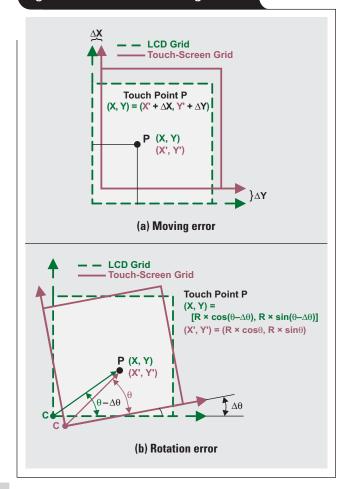


Figure 4. Independent (not on one linear line) and dependent points

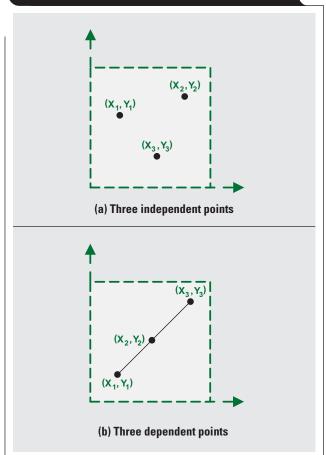

points selected on the LCD, and (X'_1, Y'_1) , (X'_2, Y'_2) , and (X'_3, Y'_3) are the corresponding points on the touch screen, Equations 1 and 2 can be used to write Equation 3:

$$\begin{split} X_1 &= \alpha_X \times X_1' + \beta_X \times Y_1' + \Delta X \\ X_2 &= \alpha_X \times X_2' + \beta_X \times Y_2' + \Delta X \\ X_3 &= \alpha_X \times X_3' + \beta_X \times Y_3' + \Delta X \\ Y_1 &= \alpha_Y \times X_1' + \beta_Y \times Y_1' + \Delta Y \\ Y_2 &= \alpha_Y \times X_2' + \beta_Y \times Y_2' + \Delta Y \\ Y_3 &= \alpha_Y \times X_3' + \beta_Y \times Y_3' + \Delta Y \end{split}$$

Equation 3 can be rewritten in matrix form:

$$\begin{pmatrix} X_1 \\ X_2 \\ X_3 \end{pmatrix} = A \times \begin{pmatrix} \alpha_X \\ \beta_X \\ \Delta X \end{pmatrix} \text{ and } \begin{pmatrix} Y_1 \\ Y_2 \\ Y_3 \end{pmatrix} = A \times \begin{pmatrix} \alpha_Y \\ \beta_Y \\ \Delta Y \end{pmatrix}, \tag{4}$$

where

$$A = \begin{pmatrix} X_1' & Y_1' & 1 \\ X_2' & Y_2' & 1 \\ X_3' & Y_3' & 1 \end{pmatrix}.$$

Calibration methods

The three independent calibration points shown in Equation 4 should be sufficient to get the scaling factors required to correct the mechanical misalignment between the touch screen and the system display.

To resolve Equation 4, both sides can be multiplied by the inverse of matrix A to get

$$\begin{pmatrix} \alpha_{X} \\ \beta_{X} \\ \Delta X \end{pmatrix} = A^{-1} \times \begin{pmatrix} X_{1} \\ X_{2} \\ X_{3} \end{pmatrix} \text{ and } \begin{pmatrix} \alpha_{Y} \\ \beta_{Y} \\ \Delta Y \end{pmatrix} = A^{-1} \times \begin{pmatrix} Y_{1} \\ Y_{2} \\ Y_{3} \end{pmatrix}, \tag{5}$$


where A^{-1} is the inverse of matrix A. The three points— $(X_1, Y_1), (X_2, Y_2)$, and (X_3, Y_3) —are designed/selected on the display surface; and the elements in matrix A are measured from the touch screen during calibration.

Example 1: Three-point calibration

On a display with 256×768 resolution, three calibration points are chosen: (64,384), (192,192), and (192,576). Refer to Figure 5a. During calibration, the three points (678,2169), (2807,1327), and (2629,3367) are measured from a touch panel with 12-bit or 4096×4096 resolution. Equation 4 can then be populated with these known values.

$$\begin{pmatrix} X_1 \\ X_2 \\ X_3 \end{pmatrix} = \begin{pmatrix} 64 \\ 192 \\ 192 \end{pmatrix} \qquad \begin{pmatrix} Y_1 \\ Y_2 \\ Y_3 \end{pmatrix} = \begin{pmatrix} 384 \\ 192 \\ 576 \end{pmatrix}$$
$$A = \begin{pmatrix} 678 & 2169 & 1 \\ 2807 & 1327 & 1 \\ 2629 & 3367 & 1 \end{pmatrix}$$

Figure 5. Examples for selecting calibration points

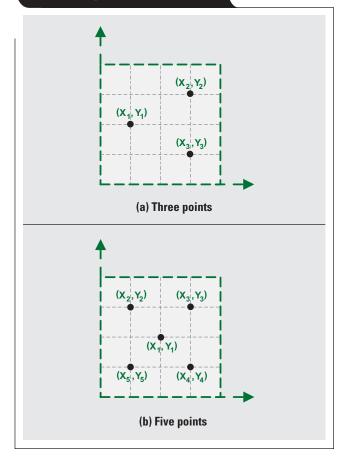

Applying Equation 5 results in α_X = 0.0623, β_X = 0.0054, ΔX = 9.9951, α_Y = -0.0163, β_Y = 0.1868, and ΔY = -10.1458. Thus the equation for X, from Equation 1, is

$$X = 0.0623 \times X' + 0.0054 \times Y' + 9.9951;$$

and the equation for Y, from Equation 2, is

$$Y = -0.0163 \times X' + 0.1868 \times Y' - 10.1458.$$

In many applications, users may use more than three points in their calibration routines to average or filter the noisy readings from the touch-screen controller. For calibration with n > 3,

$$\begin{pmatrix} X_1 \\ X_2 \\ \vdots \\ X_n \end{pmatrix} = A \times \begin{pmatrix} \alpha_X \\ \beta_X \\ \Delta X \end{pmatrix} \text{ and } \begin{pmatrix} Y_1 \\ Y_2 \\ \vdots \\ Y_n \end{pmatrix} = A \times \begin{pmatrix} \alpha_Y \\ \beta_Y \\ \Delta Y \end{pmatrix}, \tag{6}$$

where A is an $n \times 3$ matrix with n > 3 and rank (A) = 3, or

$$A = \begin{pmatrix} X'_1 & Y'_1 & 1 \\ X'_2 & Y'_2 & 1 \\ \vdots & \vdots & \vdots \\ X'_n & Y'_n & 1 \end{pmatrix}.$$

To resolve Equation 6, both sides can be multiplied by A's pseudo-inverse matrix, $(A^T \times A)^{-1} \times A^T$, where A^T is A's transpose matrix. That is, the unknown variables α_X , β_X , ΔX , α_Y , β_Y , and ΔY are resolved from

$$\begin{pmatrix} \alpha_X \\ \beta_X \\ \Delta X \end{pmatrix} = \left(A^T \times A \right)^{-1} \times A^T \times \begin{pmatrix} X_1 \\ X_2 \\ X_3 \end{pmatrix} \text{ and }$$

$$\begin{pmatrix} \boldsymbol{\alpha}_{Y} \\ \boldsymbol{\beta}_{Y} \\ \boldsymbol{\Delta}Y \end{pmatrix} = \left(\boldsymbol{A}^{T} \times \boldsymbol{A}\right)^{\!-1} \times \boldsymbol{A}^{T} \times \begin{pmatrix} \boldsymbol{Y}_{1} \\ \boldsymbol{Y}_{2} \\ \boldsymbol{Y}_{3} \end{pmatrix}$$

The solution of Equation 7 is the least-square-error estimation² of these unknown variables.

Example 2: Five-point calibration

The same system as in Example 1 is used, but five calibration points on the display are chosen: (128, 384), (64, 192), (192, 192), (192, 576), and (64, 576). Refer to Figure 5b. Equation 6 can then be populated with the five points

measured from the touch panel: (1698, 2258), (767, 1149), (2807, 1327), (2629, 3367), and (588, 3189).

$$\begin{pmatrix} X_1 \\ X_2 \\ X_3 \\ X_4 \\ X_5 \end{pmatrix} = \begin{pmatrix} 128 \\ 64 \\ 192 \\ 192 \\ 64 \end{pmatrix} \qquad \begin{pmatrix} Y_1 \\ Y_2 \\ Y_3 \\ Y_4 \\ Y_5 \end{pmatrix} = \begin{pmatrix} 384 \\ 192 \\ 192 \\ 576 \\ 576 \end{pmatrix}$$

$$A = \begin{pmatrix} 1698 & 2258 & 1 \\ 767 & 1149 & 1 \\ 2807 & 1327 & 1 \\ 2629 & 3367 & 1 \\ 588 & 3189 & 1 \end{pmatrix}$$

Using Equation 7 provides a solution similar to that found in Example 1:

$$X = 0.0623 \times X' + 0.0054 \times Y' + 10.0043$$
, and $Y = -0.0163 \times X' + 0.1868 \times Y' - 10.1482$.

Calibration algorithms

To perform these calibration methods in an embedded system, the linear algebra equation set, Equation 4 or Equation 6, must be resolved. The solution can be derived simply from Cramer's rule: For the linear equation set $b=A\times x$, b is a known real vector equal to $(b_1,b_2,\ldots,b_n)^T;$ A is a known real, square, full-rank matrix; and x is an unknown real vector equal to $(x_1,x_2,\ldots,x_n)^T.$ The unknown elements in x can be calculated by $x_1=\Delta_1/\Delta,\,x_2=\Delta_2/\Delta,\ldots,x_n=\Delta_n/\Delta,$ where Δ is the determinant of matrix A, det(A); $\Delta_k=\det(A_k)$ for $k=1,2,\ldots,n;$ and the matrix A_k is the matrix A but with its kth column replaced by the vector x.

Three-point calibration algorithm

Assuming that the dimension of A is 3×3 , Equation 8 can be determined from Equation 4, based on Cramer's rule:

$$\alpha_{x} = \Delta_{x1}/\Delta, \ \beta_{x} = \Delta_{x2}/\Delta, \ \Delta X = \Delta_{x3}/\Delta,$$

$$\alpha_{y} = \Delta_{y1}/\Delta, \ \beta_{y} = \Delta_{y2}/\Delta, \ \text{and} \ \Delta Y = \Delta_{y3}/\Delta.$$
(8)

Variables in Equation 8 are defined in the sidebar on page 9.

n-point calibration algorithm

As in Equation 6, it can be assumed that the dimension of A is $n \times 3$ with n > 3. To get the least-square solutions of the linear equation set, Equation 7 must first be rewritten as

$$\begin{pmatrix} \alpha_{X} \\ \beta_{X} \\ \Delta X \end{pmatrix} = \mathbf{A}^{-1} \times \begin{pmatrix} \mathbf{X}_{1} \\ \mathbf{X}_{2} \\ \mathbf{X}_{3} \end{pmatrix} \text{ and } \begin{pmatrix} \alpha_{Y} \\ \beta_{Y} \\ \Delta Y \end{pmatrix} = \mathbf{A}^{-1} \times \begin{pmatrix} \mathbf{Y}_{1} \\ \mathbf{Y}_{2} \\ \mathbf{Y}_{3} \end{pmatrix}, \tag{9}$$

where $\mathbf{A} = A^T \times A$, $(\mathbf{X}_1, \mathbf{X}_2, \mathbf{X}_3)^T = A^T \times (X_1, X_2, X_3)^T$, and $(\mathbf{Y}_1, \mathbf{Y}_2, \mathbf{Y}_3)^T = A^T \times (Y_1, Y_2, Y_3)^T$. Then, based on Cramer's rule, Equation 10 can be determined:

$$\begin{split} &\alpha_x = \Delta_{x1}/\Delta, \; \beta_x = \Delta_{x2}/\Delta, \; \Delta X = \Delta_{x3}/\Delta, \\ &\alpha_y = \Delta_{y1}/\Delta, \; \beta_y = \Delta_{y2}/\Delta, \; \text{and} \; \Delta Y = \Delta_{y3}/\Delta, \end{split} \tag{10}$$

where

(7)

$$\begin{split} &\Delta = n \times \left(a \times b - c^2\right) + 2 \times c \times d \times e - a \times e^2 - b \times d^2, \\ &\Delta_{x1} = n \times \left(\mathbf{X}_1 \times b - \mathbf{X}_2 \times c\right) + e \times \left(\mathbf{X}_2 \times d - \mathbf{X}_1 \times e\right) + \mathbf{X}_3 \times \left(c \times e - b \times d\right), \\ &\Delta_{x2} = n \times \left(\mathbf{X}_2 \times a - \mathbf{X}_1 \times c\right) + d \times \left(\mathbf{X}_1 \times e - \mathbf{X}_2 \times d\right) + \mathbf{X}_3 \times \left(c \times d - a \times e\right), \\ &\Delta_{x3} = \mathbf{X}_3 \times \left(a \times b - c^2\right) + \mathbf{X}_1 \times \left(c \times e - b \times d\right) + \mathbf{X}_2 \times \left(c \times d - a \times e\right), \\ &\Delta_{y1} = n \times \left(\mathbf{Y}_1 \times b - \mathbf{Y}_2 \times c\right) + e \times \left(\mathbf{Y}_2 \times d - \mathbf{Y}_1 \times e\right) + \mathbf{Y}_3 \times \left(c \times e - b \times d\right), \\ &\Delta_{y2} = n \times \left(\mathbf{Y}_2 \times a - \mathbf{Y}_1 \times c\right) + d \times \left(\mathbf{Y}_1 \times e - \mathbf{Y}_2 \times d\right) + \mathbf{Y}_3 \times \left(c \times d - a \times e\right), \text{ and} \\ &\Delta_{y3} = \mathbf{Y}_3 \times \left(a \times b - c^2\right) + \mathbf{Y}_1 \times \left(c \times e - b \times d\right) + \mathbf{Y}_2 \times \left(c \times d - a \times e\right); \text{ and} \end{split}$$

$$a = \sum_{k=1}^n {X_k'}^2, \quad b = \sum_{k=1}^n {Y_k'}^2, \quad c = \sum_{k=1}^n {X_k'} \times Y_k', \quad d = \sum_{k=1}^n {X_k'}, \quad e = \sum_{k=1}^n {Y_k'},$$

30 2007

$$\mathbf{X}_1 = \sum_{k=1}^n X_k' \times X_k, \quad \mathbf{X}_2 = \sum_{k=1}^n Y_k' \times X_k, \quad \mathbf{X}_3 = \sum_{k=1}^n X_k,$$

$$\mathbf{Y}_1 = \sum_{k=1}^n X_k' \times Y_k, \quad \mathbf{Y}_2 = \sum_{k=1}^n Y_k' \times Y_k, \text{ and } \mathbf{Y}_3 = \sum_{k=1}^n Y_k.$$

Definitions for Equation 8

$$\Delta = \det(A) = \begin{vmatrix} X'_1 & Y'_1 & 1 \\ X'_2 & Y'_2 & 1 \\ X'_3 & Y'_3 & 1 \end{vmatrix} = (X'_1 - X'_3) \times (Y'_2 - Y'_3) - (X'_2 - X'_3) \times (Y'_1 - Y'_3)$$

$$\Delta_{x1} = \det \left(A_{x1} \right) = \begin{vmatrix} X_1 & Y_1' & 1 \\ X_2 & Y_2' & 1 \\ X_3 & Y_3' & 1 \end{vmatrix} = \left(X_1 - X_3 \right) \times \left(Y_2' - Y_3' \right) - \left(X_2 - X_3 \right) \times \left(Y_1' - Y_3' \right)$$

$$\Delta_{x2} = \det(A_{x2}) = \begin{vmatrix} X_1' & X_1 & 1 \\ X_2' & X_2 & 1 \\ X_3' & X_3 & 1 \end{vmatrix} = (X_1' - X_3') \times (X_2 - X_3) - (X_2' - X_3') \times (X_1 - X_3)$$

$$\Delta_{x3} = \det\left(A_{x3}\right) = \begin{vmatrix} X_1' & Y_1' & X_1 \\ X_2' & Y_2' & X_2 \\ X_3' & Y_3' & X_3 \end{vmatrix} = X_1 \times \left(X_2'Y_3' - X_3'Y_2'\right) - X_2 \times \left(X_1'Y_3' - X_3'Y_1'\right) + X_3 \times \left(X_1'Y_2' - X_2'Y_1'\right)$$

$$\Delta_{y1} = \det(A_{y1}) = \begin{vmatrix} Y_1 & Y_1' & 1 \\ Y_2 & Y_2' & 1 \\ Y_3 & Y_3' & 1 \end{vmatrix} = (Y_1 - Y_3) \times (Y_2' - Y_3') - (Y_2 - Y_3) \times (Y_1' - Y_3')$$

$$\Delta_{y2} = \det(A_{y2}) = \begin{vmatrix} X_1' & Y_1 & 1 \\ X_2' & Y_2 & 1 \\ X_3' & Y_3 & 1 \end{vmatrix} = (X_1' - X_3') \times (Y_2 - Y_3) - (X_2' - X_3') \times (Y_1 - Y_3)$$

$$\Delta_{y3} = \det \left(A_{y3} \right) = \begin{vmatrix} X_1' & Y_1' & Y_1 \\ X_2' & Y_2' & Y_2 \\ X_3' & Y_3' & Y_3 \end{vmatrix} = Y_1 \times \left(X_2' Y_3' - X_3' Y_2' \right) - Y_2 \times \left(X_1' Y_3' - X_3' Y_1' \right) + Y_3 \times \left(X_1' Y_2' - X_2' Y_1' \right)$$

Algorithm implementation

To implement the preceding calibration algorithms, one of the first tasks after system power up is to develop and run a software routine to perform the following steps:

- Select the display calibration points (X_k, Y_k) for $k = 1, 2, \ldots, n$ and $n \ge 3$.
- Call the touch-screen controller function to access touch-screen data.
- Touch the first point (X₁, Y₁) on the display, acquire data from the touch-screen controller, and save the touch coordinates (X'₁, Y'₁).
- Repeat the previous step to get all (X_k', Y_k') for $k=2,\,3,\,\ldots$, n and $n\geq 3.$
- Call the function to calculate α_x , β_x , ΔX , α_y , β_y , and ΔY —for example, call Equation 10 for five-point calibration.

References

For more information related to this article, you can download an Acrobat Reader file at www-s.ti.com/sc/techlit/litnumber and replace "litnumber" with the **TI Lit. #** for the materials listed below.

Document Title TI Lit.

- Wendy Fang, "Reducing Analog Input Noise in Touch Screen Systems," Application Report sbaa155
- 2. Frank L. Lewis, Optimal Estimation: With an Introduction to Stochastic Control Theory (John Wiley & Sons, Inc., 1986).

Related Web sites

dataconverter.ti.com

www.ti.com/sc/device/partnumber

Replace partnumber with ADS7843, ADS7845, ADS7846, TSC2003, TSC2004, TSC2005, TSC2006, TSC2007, or TSC2046

IMPORTANT NOTICE

Texas Instruments Incorporated and its subsidiaries (TI) reserve the right to make corrections, modifications, enhancements, improvements, and other changes to its products and services at any time and to discontinue any product or service without notice. Customers should obtain the latest relevant information before placing orders and should verify that such information is current and complete. All products are sold subject to TI's terms and conditions of sale supplied at the time of order acknowledgment.

TI warrants performance of its hardware products to the specifications applicable at the time of sale in accordance with TI's standard warranty. Testing and other quality control techniques are used to the extent TI deems necessary to support this warranty. Except where mandated by government requirements, testing of all parameters of each product is not necessarily performed.

TI assumes no liability for applications assistance or customer product design. Customers are responsible for their products and applications using TI components. To minimize the risks associated with customer products and applications, customers should provide adequate design and operating safeguards.

TI does not warrant or represent that any license, either express or implied, is granted under any TI patent right, copyright, mask work right, or other TI intellectual property right relating to any combination, machine, or process in which TI products or services are used. Information published by TI regarding third-party products or services does not constitute a license from TI to use such products or services or a warranty or endorsement thereof. Use of such information may require a license from a third party under the patents or other intellectual property of the third party, or a license from TI under the patents or other intellectual property of TI.

Reproduction of information in TI data books or data sheets is permissible only if reproduction is without alteration and is accompanied by all associated warranties, conditions, limitations, and notices. Reproduction of this information with alteration is an unfair and deceptive business practice. TI is not responsible or liable for such altered documentation.

Resale of TI products or services with statements different from or beyond the parameters stated by TI for that product or service voids all express and any implied warranties for the associated TI product or service and is an unfair and deceptive business practice. TI is not responsible or liable for any such statements.

Following are URLs where you can obtain information on other Texas Instruments products and application solutions:

Products

Amplifiers amplifier.ti.com **Data Converters** dataconverter.ti.com DSP dsp.ti.com Interface interface.ti.com Logic logic.ti.com Power Management power.ti.com Microcontrollers microcontroller.ti.com

Applications

Wireless

Audio www.ti.com/audio www.ti.com/automotive Automotive Broadband www.ti.com/broadband Digital control www.ti.com/digitalcontrol Military www.ti.com/military Optical Networking www.ti.com/opticalnetwork Security www.ti.com/security Telephony www.ti.com/telephony Video & Imaging www.ti.com/video

www.ti.com/wireless

TI Worldwide Technical Support

Internet

TI Semiconductor Product Information Center Home Page support.ti.com

TI Semiconductor KnowledgeBase Home Page

support.ti.com/sc/knowledgebase

Product Information Centers

Americas Phone +1(972) 644-5580 Fax Internet/Email support.ti.com/sc/pic/americas.htm

Europe, Middle East, and Africa

Phone

European Free Call 00800-ASK-TEXAS

(00800 275 83927)

International +49 (0) 8161 80 2121 +7 (4) 95 98 10 701 Russian Support

Note: The European Free Call (Toll Free) number is not active in all countries. If you have technical difficulty calling the free call number, please use the international number above.

+(49) (0) 8161 80 2045 Fax Internet support.ti.com/sc/pic/euro.htm Japan Fax International +81-3-3344-5317 Domestic 0120-81-0036 Internet/Fmail International support.ti.com/sc/pic/japan.htm Domestic www.tij.co.jp/pic

Asia

Internet

Phone International +886-2-23786800 Domestic Toll-Free Number Toll-Free Number 1-800-999-084 1-800-80-3973 Australia Malaysia China 800-820-8682 New Zealand 0800-446-934 800-96-5941 1-800-765-7404 Hong Kong Philippines India +91-80-41381665 (Toll) Singapore 800-886-1028 Indonesia 001-803-8861-1006 Taiwan 0800-006800 080-551-2804 001-800-886-0010 Korea Thailand +886-2-2378-6808 Fmail tiasia@ti.com support.ti.com/sc/pic/asia.htm ti-china@ti.com

+1(972) 927-6377

Safe Harbor Statement: This publication may contain forwardlooking statements that involve a number of risks and uncertainties. These "forward-looking statements" are intended to qualify for the safe harbor from liability established by the Private Securities Litigation Reform Act of 1995. These forwardlooking statements generally can be identified by phrases such as TI or its management "believes," "expects," "anticipates," "foresees," "forecasts," "estimates" or other words or phrases of similar import. Similarly, such statements herein that describe the company's products, business strategy, outlook, objectives, plans, intentions or goals also are forward-looking statements. All such forward-looking statements are subject to certain risks and uncertainties that could cause actual results to differ materially from those in forward-looking statements. Please refer to TI's most recent Form 10-K for more information on the risks and uncertainties that could materially affect future results of operations. We disclaim any intention or obligation to update any forward-looking statements as a result of developments occurring after the date of this publication.

Trademarks: All trademarks are the property of their respective owners.

Mailing Address: Texas Instruments

Post Office Box 655303 Dallas, Texas 75265

© 2007 Texas Instruments Incorporated