


1 Trust badge: one word + reason.  2 State pill.  3 One instruction, nothing else on screen (no stale projections).
4 Hint bar: only the keys that matter now. Full key list behind '?'. Engineer diagnostics behind 'h'.

1


**Tracking good**

Registration found. Check it before trusting it.

**VERIFYING**

2

**Does the outline sit on the bone?**

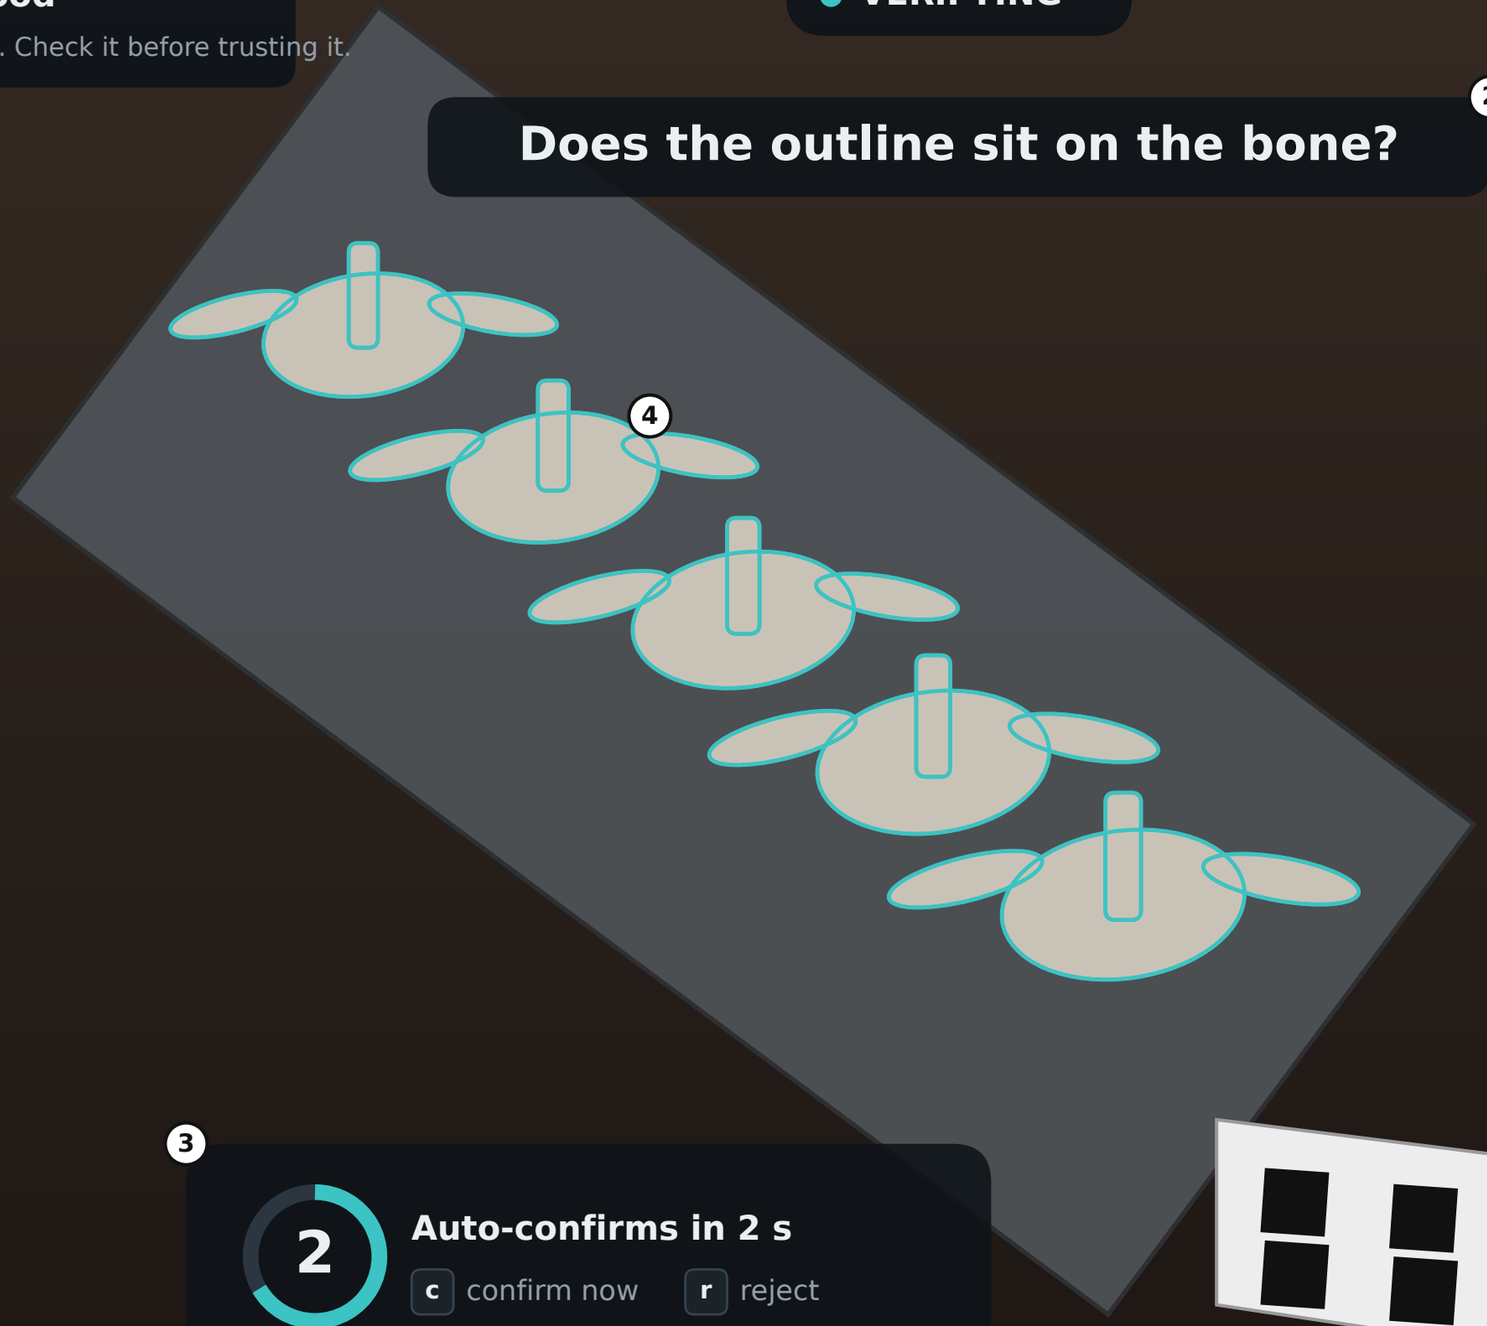



3


**Auto-confirms in 2 s**

2

c confirm now  r reject

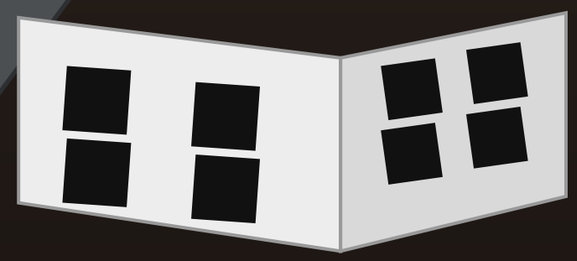


1 Trust badge.  2 The question the user must answer.  3 Countdown = consent by inaction; tap or key to reject.
4 Edge-only outline (thin, one colour, low clutter, no fill) so the physical bone stays visible underneath. No targets yet.

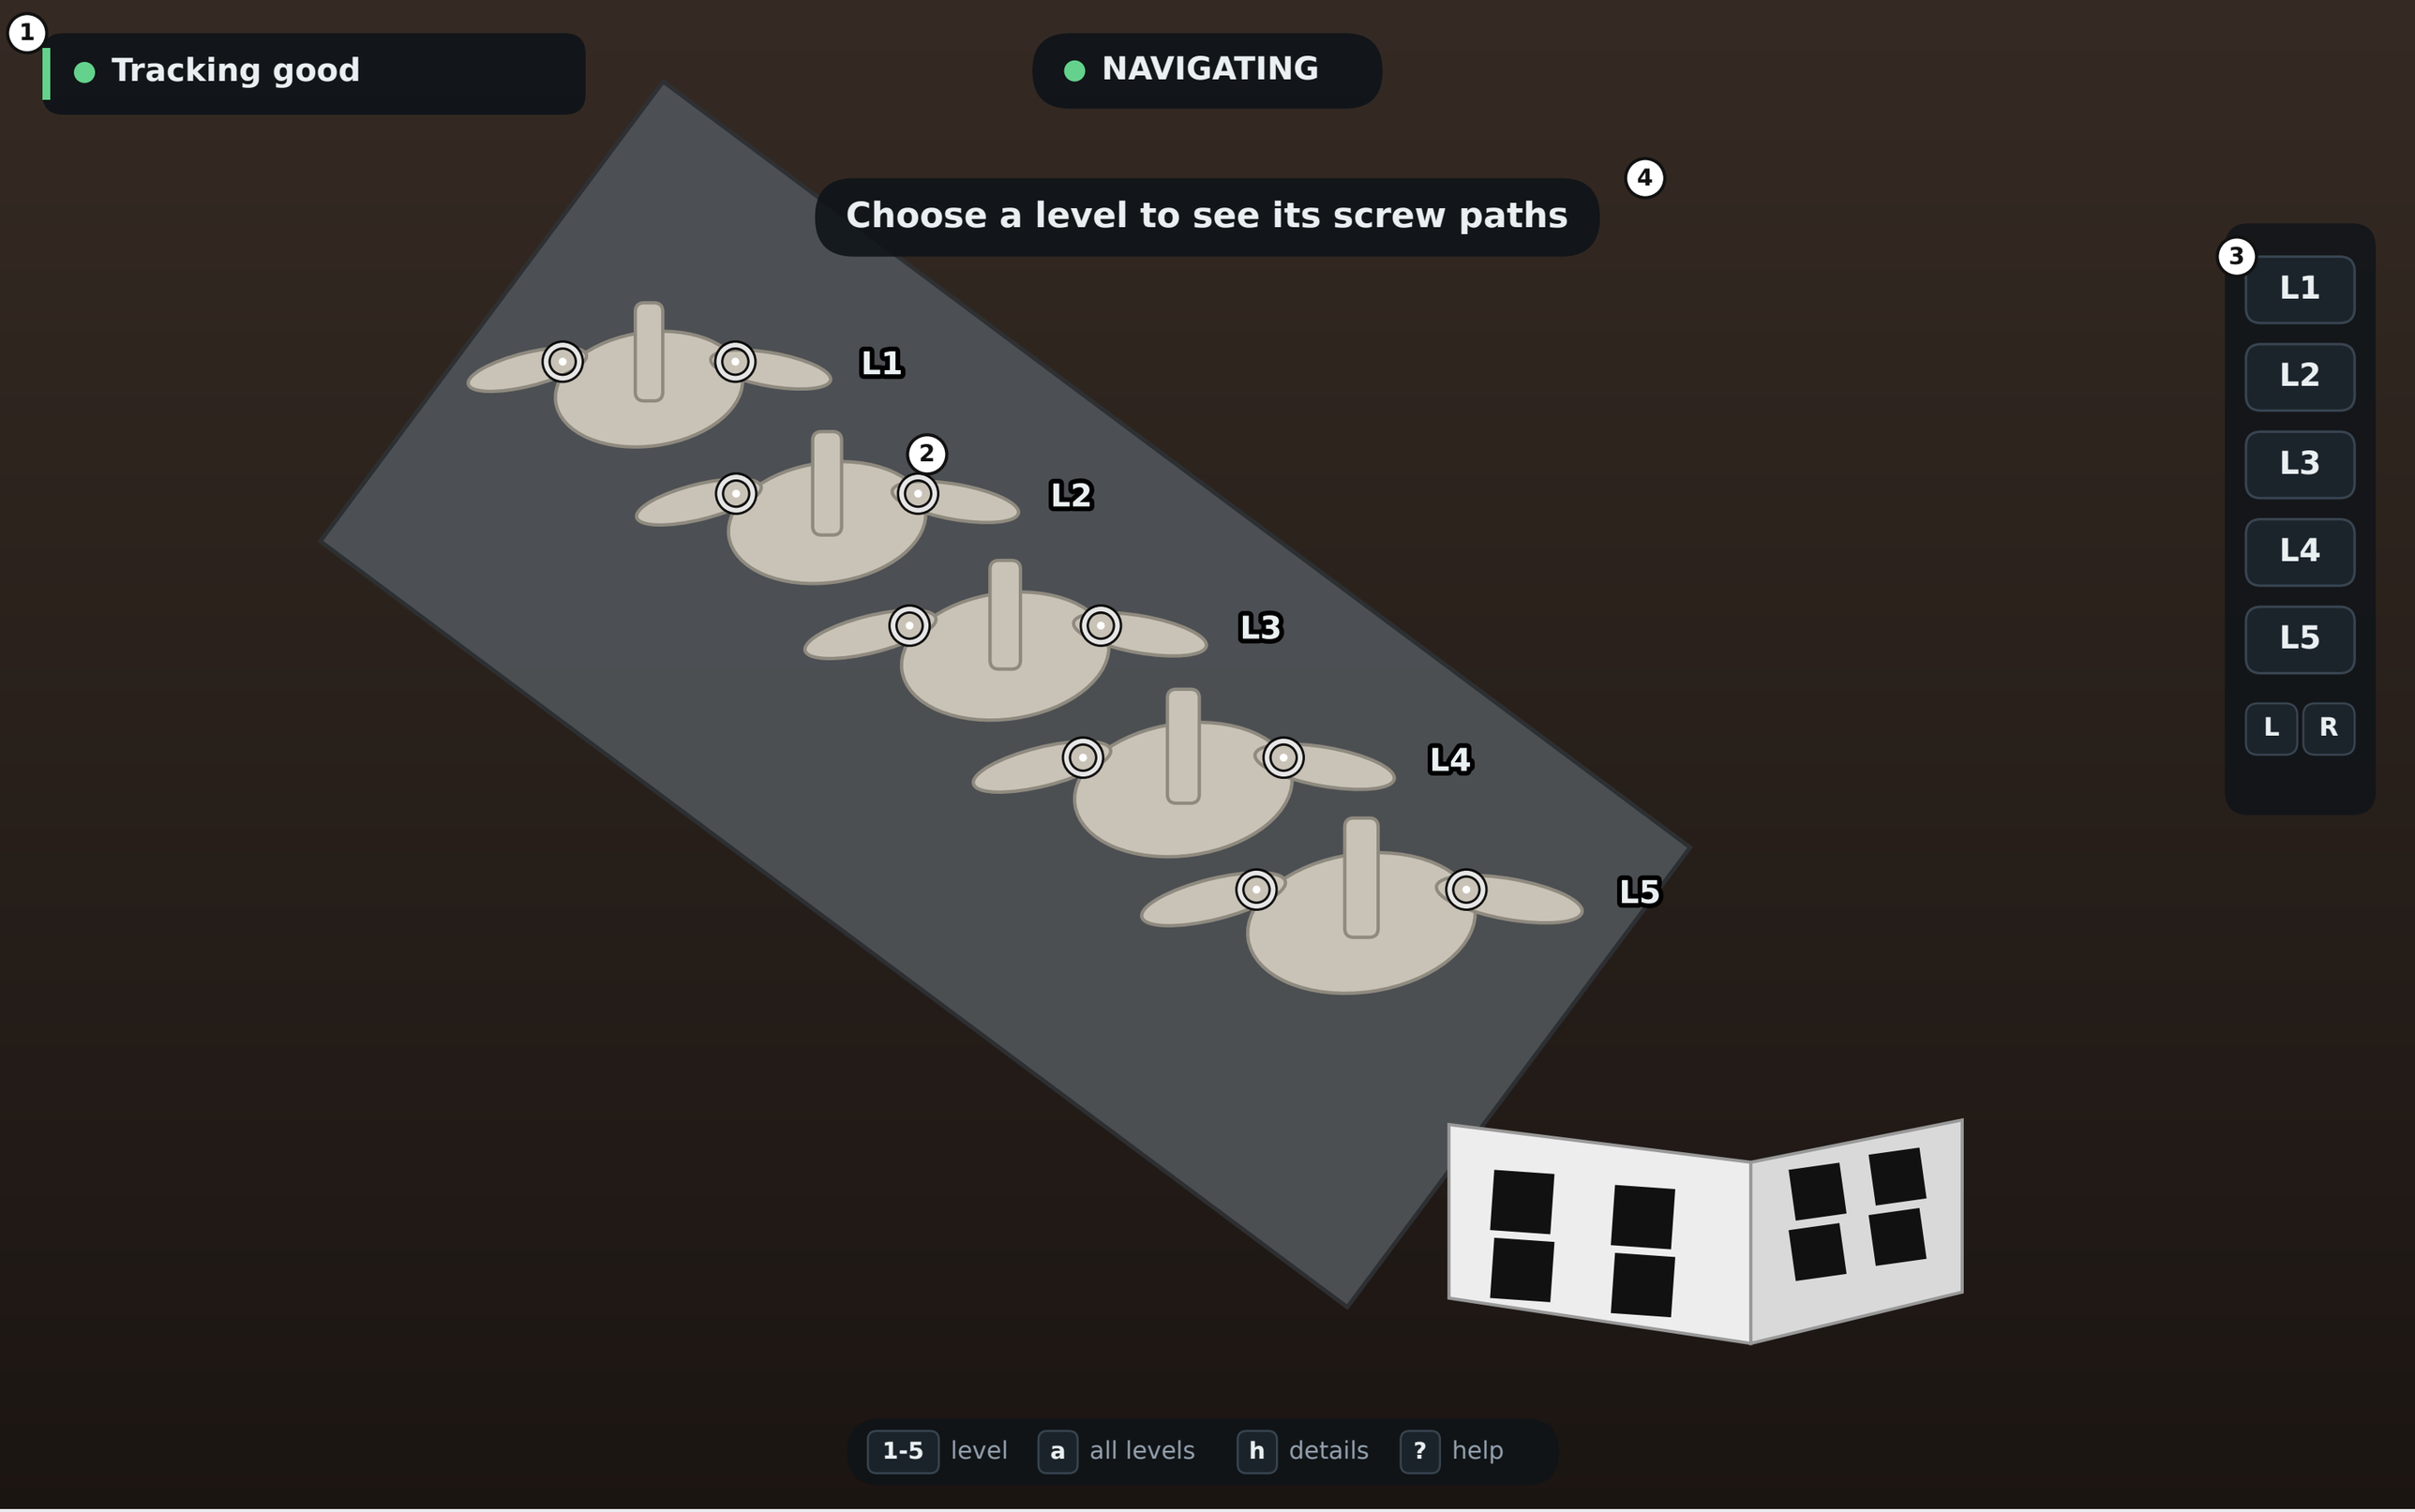


1 Trust badge (reason only when something is limited).  2 Entry points only: small rings, no trajectories, nothing to read.
3 Level selector (touch targets on the phone; keys 1-5 on the laptop).  4 Prompts the next action instead of showing everything.

Tracking good


NAVIGATING

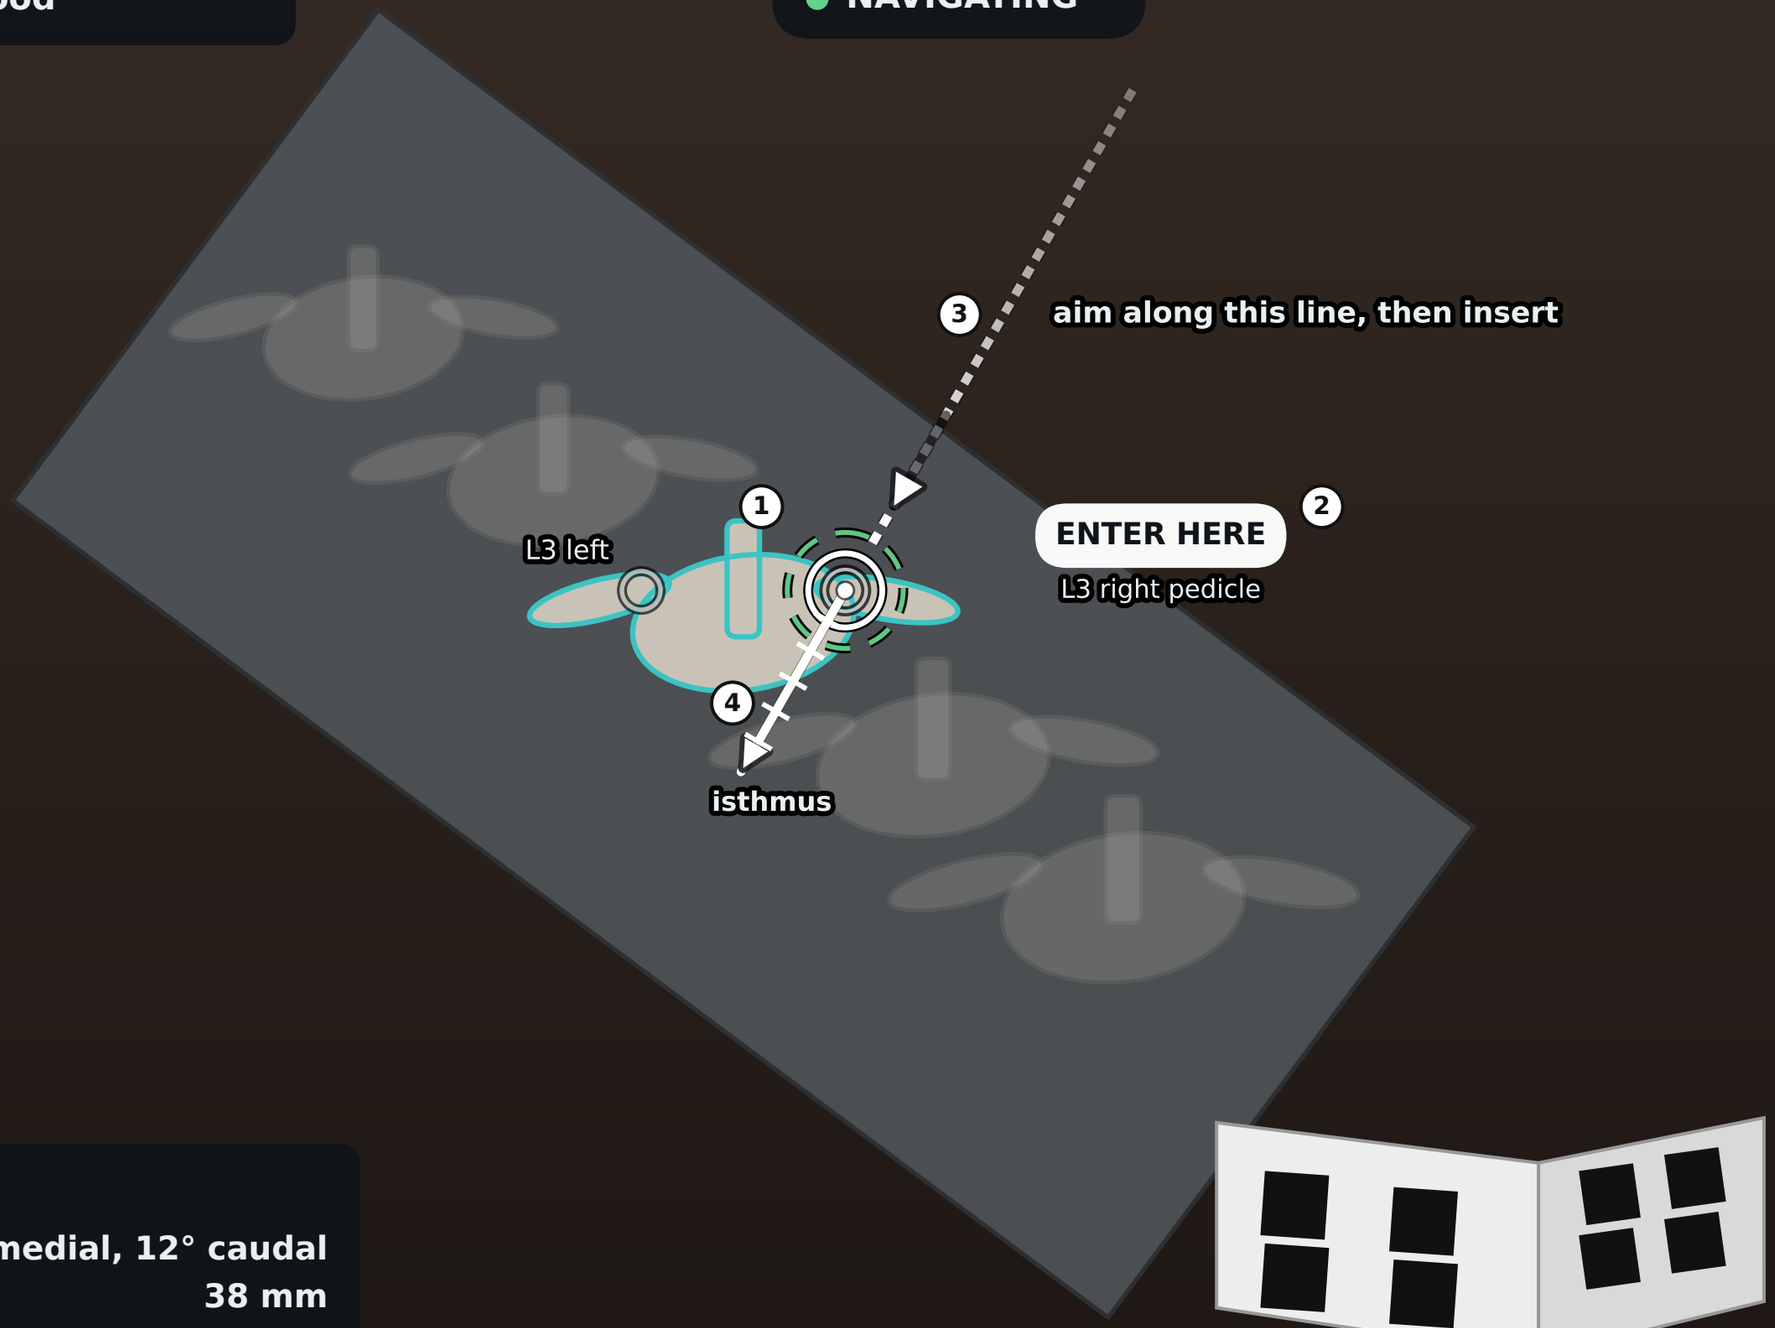


6
L1
L2
L3
L4
L5
L R

5
**L3 right**

| | |
|---|---|
| Angle | **18° medial, 12° caudal** |
| Depth to isthmus | **38 mm** |
| Accuracy | **within 2 mm** |

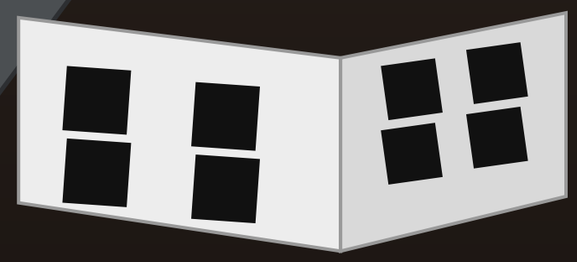


[ ] side  tab next level  a all  h details  ? help

1 Entry: dashed ring = accuracy, solid double ring = 'act here'.  2 Call to action + level.  3 Extension beyond the entry shows the direction of approach.
4 Solid arrow into the bone with depth ticks every 10 mm.  5 Target card: angle, depth, accuracy.  6 Other levels fade; the other side shows as a ring only.

1 **Tracking lost**

Showing the last position for up to 0.3 s. Move so two bracket faces or the dome are in view.

● **STALE**

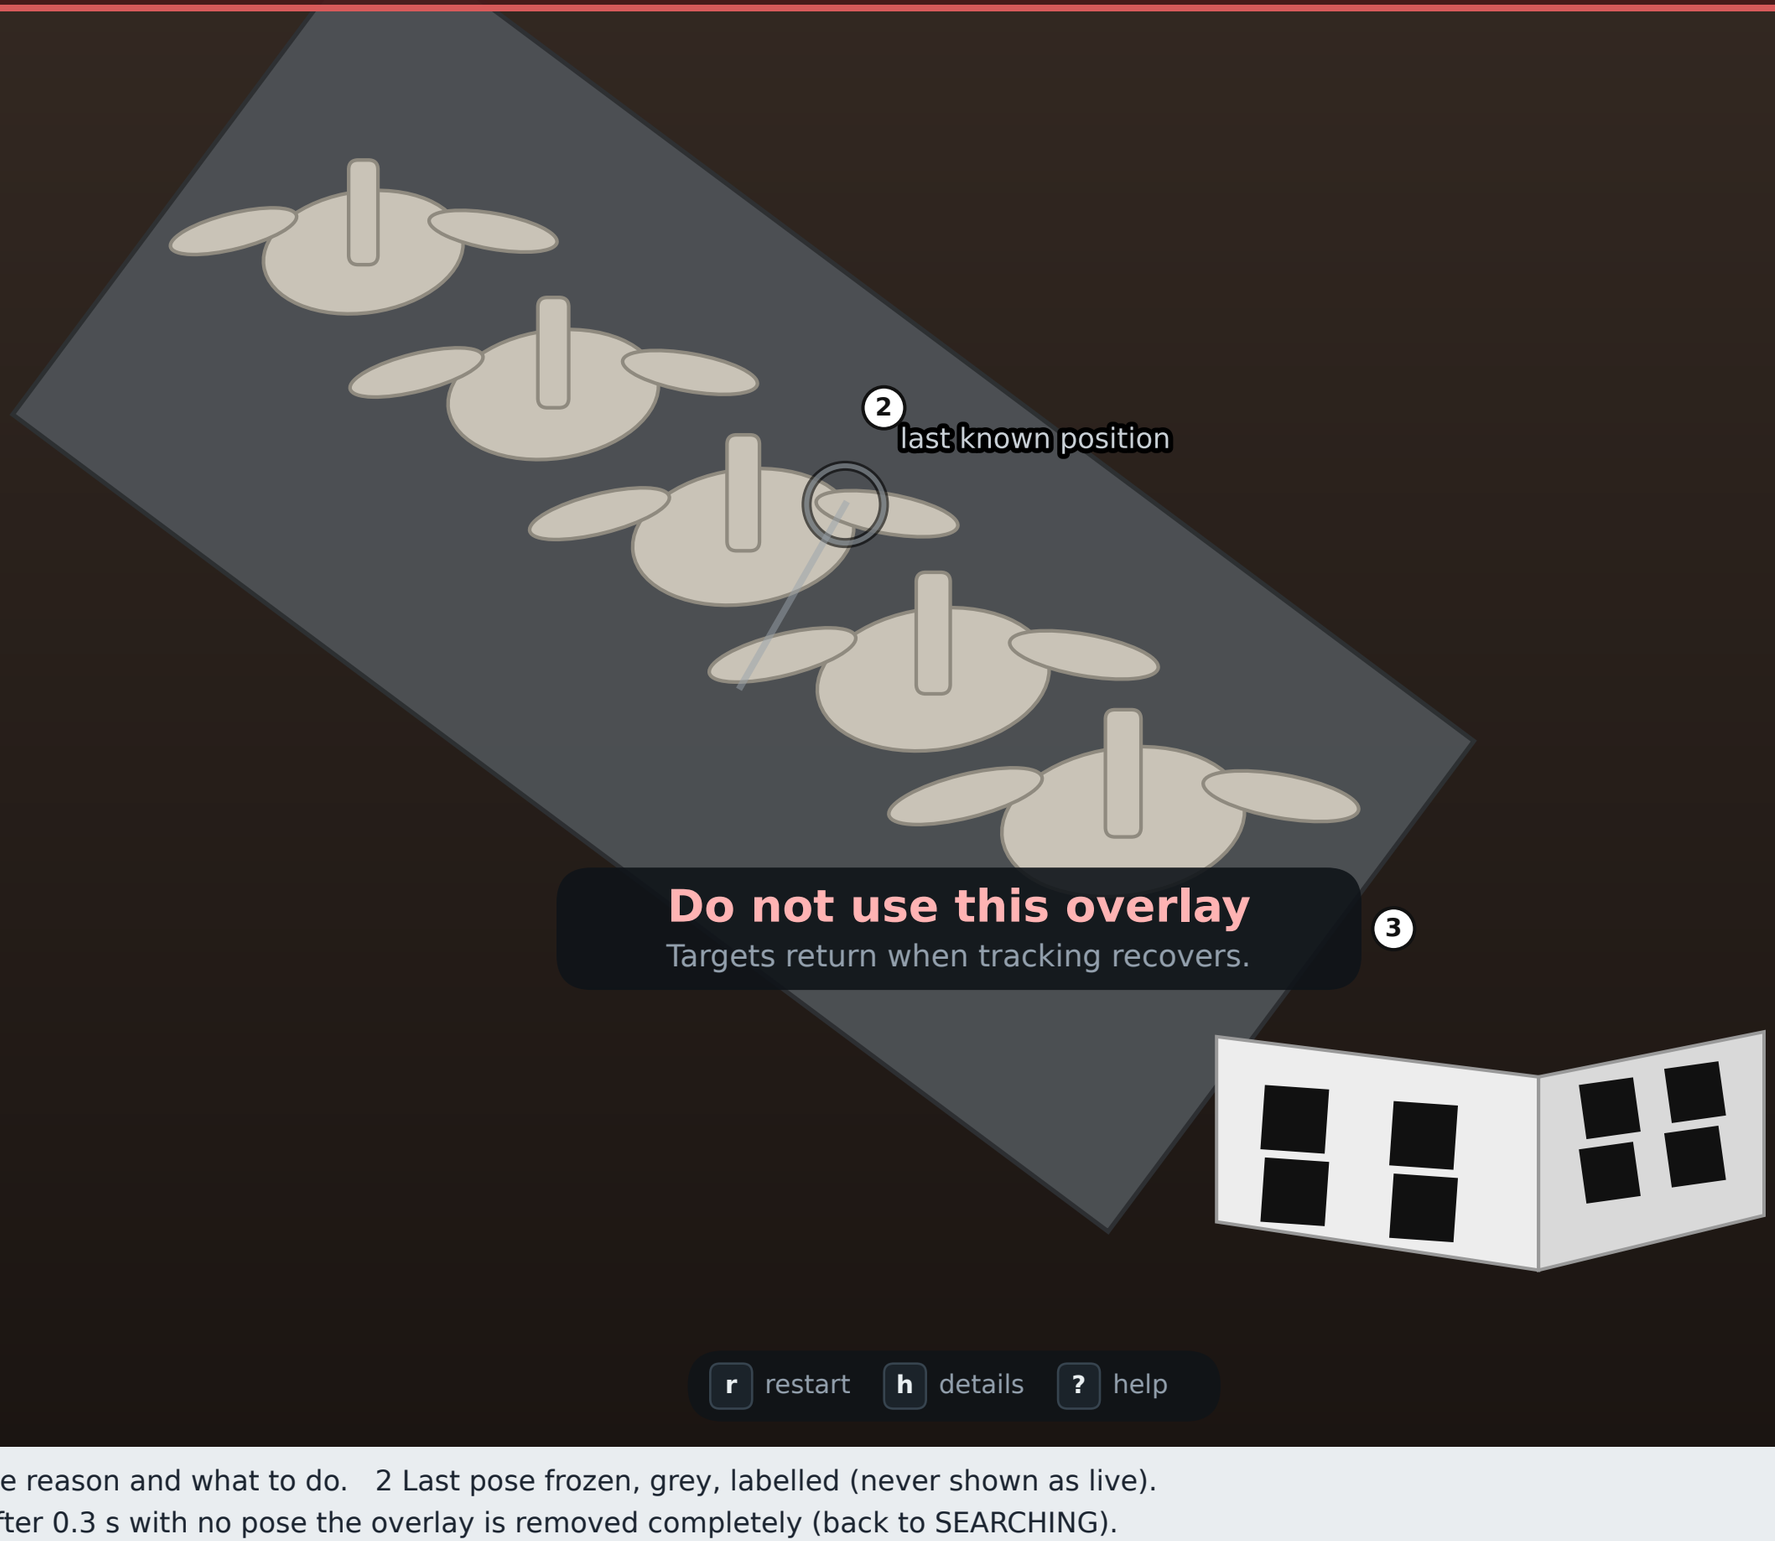


1 Red banner with the reason and what to do.  2 Last pose frozen, grey, labelled (never shown as live).
3 Plain instruction. After 0.3 s with no pose the overlay is removed completely (back to SEARCHING).