



INSPECTION



Fork pipe runout

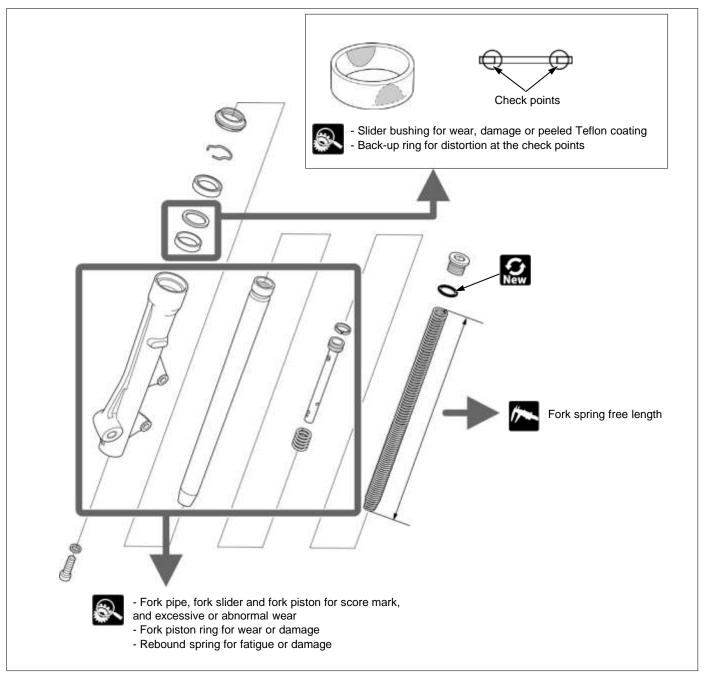

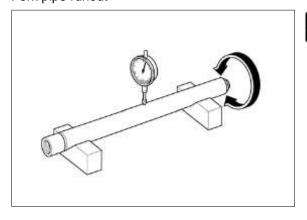

• Place the fork pipe on V-block and measure the runout. Actual runout is 1/2 the total indicator reading.