NOTES:
1. ALL DIMENSIONS ARE IN INCHES[mm].
2. ALL SHARP EDGES TO BE GROUND SMOOTH AND FREE OF BURRS.
3. ALL WELDS ARE CONTINUOUS AND FREE OF VOIDS.

1. 所有尺寸为英寸[mm]；
2. 去尖角毛刺
3. 所有焊缝连续无缺陷

BILL OF MATERIAL

ITEM	DESCRIPTION	PART NUMBER	QTY	UOM
1	MOTOR, 1/3HP,48CZ,TEFC,BALD#33E963X041	20580308	1	Each
2	SPROCKET, TMG BLT,ENP,SPCL,GATE#5MR-19S-	20514720	1	Each
3	CORDGRIP, CONN,90DEG,1/2NPT,T&B#2250	20515779	1	Each
4	CONDUIT, LQT,SEAL NUT,APLE#BLSG-50	20501139	1	Each
01 5	TUBE, SHRINK,HEAT,3/4X3/8,0.033W,PVC,BLK	20511750	18	Inch

ASSY INSTRUCTIONS:
1. REMOVE CONDUIT ADAPTER.
2. INSTALL HEAT SHRINK TUBING.
3. INSTALL CORD GRIP IN CONDUIT ADAPTER @ 0° DEG.
4. PULL MOTOR LEADS THROUGH ADAPTER & CORD GRIP.
5. TIGHTEN ADAPTER SCREWS.
6. SECURE MOTOR CABLE W/ TIE WRAP, DO NOT LET EXCESS CABLE COVER MOTOR NAME PLATE.

安装说明:
1.拆除接头; 2.安装热缩管;
3.将防水接头如图所示0°度定位，并安装接头;
4.从接头里面出电机引出线 5.拧紧接头;
6.保持线路畅洁 防止线遮住铭牌;

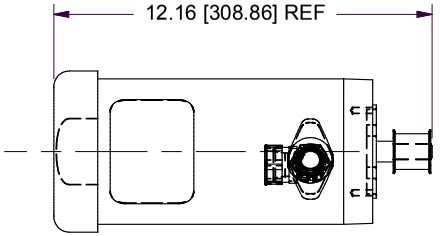

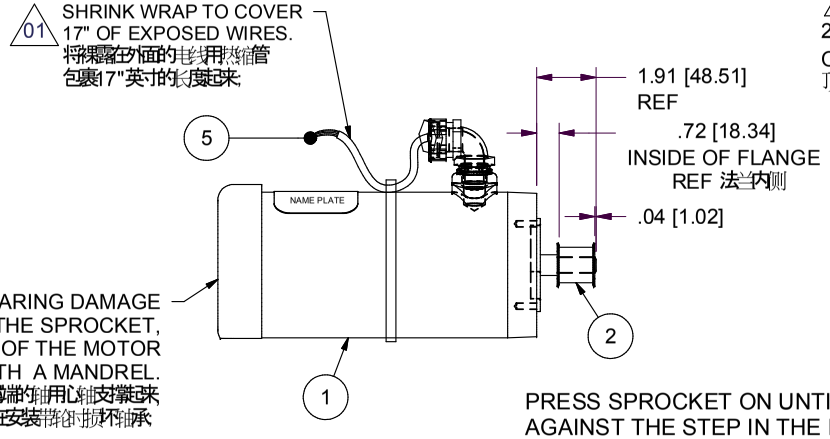

TO PREVENT BEARING DAMAGE WHILE PRESSING ON THE SPROCKET, SUPPORT THIS END OF THE MOTOR SHAFT WITH A MANDREL.
要将电机的同轴用心轴支撑起来，防止在安装链轮时损坏轴承;

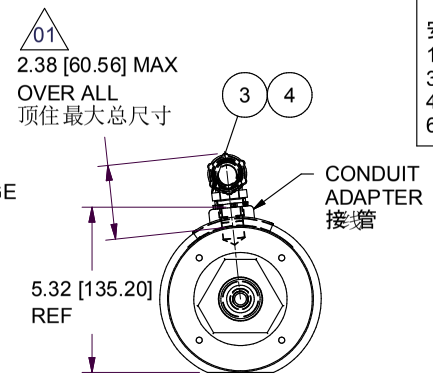

PRESS SPROCKET ON UNTIL FULLY SEATED AGAINST THE STEP IN THE MOTOR SHAFT
要将链轮装到位，完全顶住轴的台阶

CONFIDENTIAL

未注公差:
x.xxxx = ±0.0127mm; x.xxx =±0.127mm ;
x.xx = ±0.381mm; x.x =± 0.762mm;
未注加工表面粗糙度 3.2;
未注加工角度允许偏差 0度至30分;

SALES ORDER/ITEM		DRAWN QV	DATE 1/26/2016
MODEL	HEAT AND CONTROL ®	CHECKED TGK	DATE 1/26/2016
ISSUE DATE		APPR. TGK	DATE 1/26/2016
PRODUCTION ORDER			

THIS DRAWING IS SENT TO YOU SUBJECT TO RETURN UPON DEMAND, AND WITH THE UNDERSTANDING THAT IT IS NOT TO BE USED IN ANY WAY DETRIMENTAL TO OUR INTERESTS. ALL RIGHTS OF DESIGN OR INVENTION ARE RESERVED.

TITLE	SHEET
MOTOR/PULLEY ASSY,90E,5MM,H&C#20580308	1 OF 1

MATERIAL NUMBER	DRAWING DOCUMENT	MODEL DOCUMENT	SCALE
31384946	701917007	701917006	1:4

RAW MATERIAL	RAW DESCRIPTION	QTY	UOM	REV
				02

REV.	DESCRIPTION	DATE	BY
02	UPDATED TITLE...REPLACED "50E" WITH "90E".	7/26/2016	QV
01	(5) QTY WAS 22". EXPOSED WIRES WAS 21". DIM WAS 2.49".	6/2/2016	QV

UNLESS OTHERWISE SPECIFIED:
X.XXXX = ' .0005 X.XX = ' .015 MACHINED FINISHES = 250
X.XXX = ' .005 X.X = ' .030 ∠ = 0～30'
DRESS AND DEBURR ALL SHARP CORNERS AND EDGES THREADS = CLASS 2 UNIFIED SERIES

PROJECTION 3RD ANGLE

DO NOT SCALE DRAWING | FORMAT B | INV