




SERVICE BULLETIN

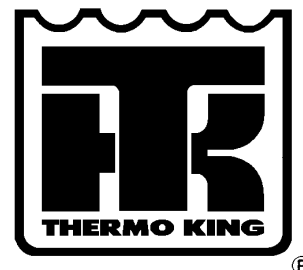

SUBJECT: Using MP-3000 / MPC2000ID Test Kit

BULLETIN NO: C 057

DATE: November 20, 2002

The following information relates to the proper use of the MP-3000 / MPC2000ID Test kit when testing the Main Relay Board (MRB). There is also a Training Presentation on the program CD that comes with the test kit. Review the presentation completely before using test kit.


We have received information from the field on failed MRB's that in fact were good. The problem was the power supply was disconnected.

NOTE: Disconnect ALL orange connectors to the MRB EXCEPT J10 and J17. These two connections provide the power for the controller, MRB, relays and contactors. If they are not connected, the test will fail.

**J17 – Provides AC power for
Schrack relays controlling
heaters and fan motors**

Schrack Relays

**J10 – Provides power for
controller and MRB**

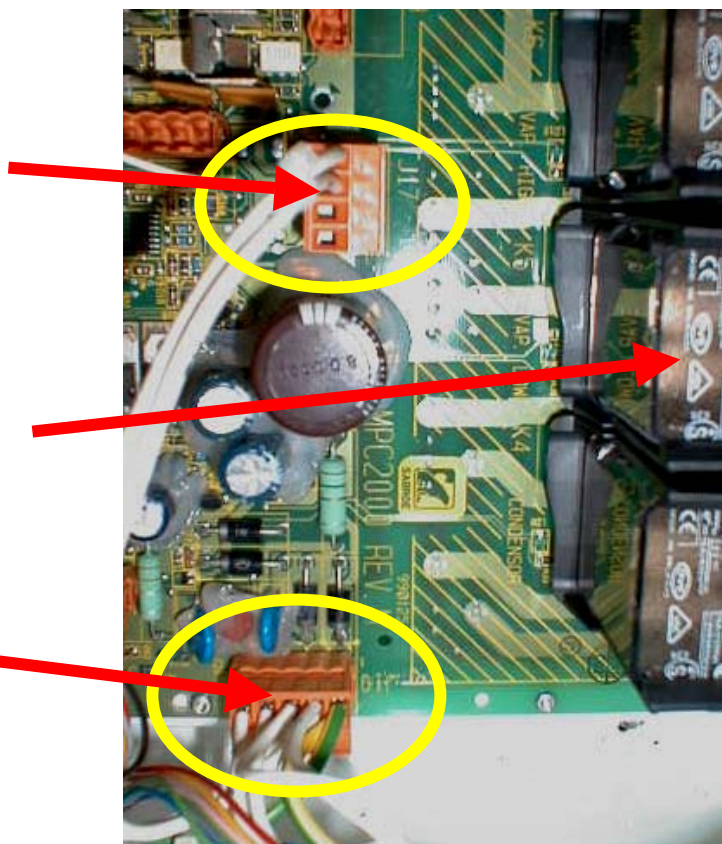

MGR
☐

SALES
☐

SERVICE
☐

PARTS
☐