

INVESTMENT PROSPECTUS

Investment Prospectus

The property, the work it needs, and what that work costs — before anyone finds it themselves

PROPERTY

Two-bedroom house, City Bowl, Cape Town

REFERENCE

SAMPLE-B

INSPECTION DATE

20 July 2026

AREAS RECORDED

15



1 The proposition, stated honestly

A published AssetProof sample. A real, complete record with every identifying detail removed — no address, no owner or agent name, no contact details, and no image showing a street frontage, a neighbouring property or a vehicle registration.

A two-bedroom, two-bathroom house on a corner plot in Cape Town's City Bowl, with a single garage, gated off-street parking from two roads, a courtyard plunge pool and a covered braai deck. It is part-furnished, it is structurally sound, and it is **not presently in the condition it should be sold or let in**.

That last sentence is the reason this document exists. Every prospectus written for this house could have led on the Smeg kitchen and the hardwood floors and left the reader to discover the green pool on the second viewing. This one puts the work in front of the numbers, with the cost of putting it right, because a buyer who finds it themselves discounts twice — once for the defect and once for having been shown a document that did not mention it.

2 The property

Type	Freehold house — 2 bedroom / 2 bathroom, plus a guest cloakroom	Location	City Bowl, Cape Town
Reference	SAMPLE-B	Position	Corner plot, one shared boundary; vehicle access from both a back and a front road
Parking	Single garage on an motorised door, plus gated off-street parking	Outdoor	Courtyard plunge pool, covered braai deck, lawn and planted borders
Condition	Sound; a defined schedule of works set out below	Furnishing	Part-furnished — see the contents schedule
Security	Electric perimeter fence, burglar bars throughout, motorised gate, security trellis, DSC alarm	Record date	20 July 2026

3 What the record establishes

15

AREAS FULLY
RECORDED

358

ITEMS SCHEDULED

230

CONDITION FINDINGS

R1.46m

CONTENTS,
REPLACEMENT VALUE

4 Accommodation

SPACE	WHAT IS THERE
Entrance and exterior	Sage-painted plaster boundary walls, a motorised wood-slat sliding gate on a galvanised surround, exposed-aggregate driveway paving, lawn and planted borders, and a flat roof terrace.
Lounge	Open living room with a Jetmaster built-in fireplace, honey-toned solid pine flooring, a grey L-shaped sectional, a leather two-seater, a Samsung television on a timber console and a DSC alarm panel.
Dining	Solid pine floor, a light-timber dining table with four wishbone-style chairs, open to the kitchen.
Kitchen	Fitted white joinery with hardwood counters, a Smeg freestanding range with a five-burner gas hob, an integrated dishwasher, a Defy side-by-side fridge/freezer, a Defy four-slice toaster and a full run of overhead lift-up cabinets.
Main bedroom suite	Double bedroom with a full wall of built-in wardrobes and an en-suite bathroom with a double vessel-basin vanity, a bath and a separate shower.
Bedroom 2	Double bedroom with a built-in melamine wardrobe run and venetian blinds.
Second bathroom	Full bathroom with a bath, a shower, a timber-topped vanity and a WC.
Guest powder room	Cloakroom off the circulation space.
Garage, laundry and storage	Single garage on an motorised door with a fitted white cabinetry run, a laundry bay, the distribution board and the household plant.
Pool courtyard	Enclosed courtyard with a plunge pool, a white paved surround, loungers and a rainwater tank.
Braai courtyard	Covered deck with a built-in Jetmaster braai and prep counter, a rattan lounge suite and a security trellis to the rear entrance.

5 The work, and what it costs

Taken directly from the condition inspection. Cost bands are planning figures at South African rates, not quotations.

WORK	PRIORITY	INDICATIVE COST
Pool: shock treatment, filtration run, vacuum the sediment off the steps and floor, re-test and re-inspect	BEFORE SALE OR LET	R4,000 – R9,000
Pool plant: locate, inspect and record the pump, filter and backwash equipment – it appears nowhere in the record and its condition is unknown	BEFORE SALE OR LET	R0 – R25,000 (unknown until inspected)
Electrical: enclose and terminate the exposed cabling at the alarm control box; issue or refresh the electrical certificate of compliance	BEFORE SALE OR LET	R2,500 – R6,000
Alarm: clear the panel fault, walk-test every zone, confirm it arms clean	BEFORE SALE OR LET	R1,500 – R4,000
Gas: obtain the certificate of compliance for the Smeg gas hob installation	STATUTORY	R1,200 – R2,500

WORK	PRIORITY	INDICATIVE COST
Detection: install smoke and carbon-monoxide detection — none was observed anywhere in the property	BEFORE OCCUPATION	R1,500 – R4,000
Damp: clean back and investigate the damp-like staining and moss on the unfinished concrete wall section	INVESTIGATE	R2,000 – R15,000 (scope-dependent)
Dishwasher: replace the torn and lifting door seal	FUNCTIONAL	R600 – R1,500
Grounds: scarify, top-dress and re-seed the patchy lawn; pressure-wash and treat the algae on the steps, paving and driveway	PRESENTATION	R6,000 – R14,000
Making good: fill and paint the unfinished concrete patch, the bare wall niches and the unpainted timber strip at the door head	PRESENTATION	R5,000 – R12,000
Blinds: re-level and re-tension the venetian slats in both bedrooms	PRESENTATION	R800 – R2,500
Soft furnishings: professionally clean the sectional chaise and the outdoor cushions; the leather two-seater is heavily worn and should be recovered or replaced	PRESENTATION	R3,000 – R26,000 (clean vs replace)
Cosmetic round: the remaining scuffs, smudges and marks recorded across the house	COSMETIC	R3,000 – R8,000

6 The single number a buyer will ask for

The single number a buyer will ask for

On the bands above, a full pre-sale or pre-let programme sits in the region of **R32,000 to R130,000**, and the width of that range is honest: it is driven almost entirely by three unknowns — the state of the pool plant, the extent of the damp behind the stained concrete, and whether the leather two-seater is cleaned or replaced. Each of those can be resolved in a single morning's inspection, and doing so before going to market is worth considerably more than it costs.

7 What is included in the sale

CLASS	ENTRIES	REPLACEMENT, EXPECTED (R)
Fitted joinery, sanitaryware, flooring, gates, braai and pool shell	58	288,500
Loose furniture, appliances, tools and household contents	300	1,173,850
Whole schedule	358	1,462,350

8 Rental positioning

One live comparable was identified in the immediate area at the date of the record. The figure is converted from a published US-dollar nightly rate and is an estimate, not confirmed booking data.

COMPARABLE	BEDS	INDICATIVE ADR (R)	RATING	BASIS
This property, once the works above are complete	2	To be set	Not yet rated	Two en-suite-standard bathrooms, a garage, gated parking and a pool courtyard put it in the upper half of the local two-bed set

COMPARABLE	BEDS	INDICATIVE ADR (R)	RATING	BASIS
Two-bed / two-bath rental unit, same area	2	3,035	4.97	Converted from a published rate of about US\$164 a night at roughly R18.5 to the dollar – an estimate, to be confirmed against the live listing

9 Risks and disclosures

Everything a buyer would find on their own survey, said first.

MATTER	POSITION
The pool	Severely green and algae-affected with sediment on the submerged steps at the date of the record. Treatable, but it must not be presented as ready for use until it has been cleared and re-inspected.
The pool plant	Never recorded. Its presence and condition are an open question, not an assurance.
Compliance certificates	No electrical or gas certificate of compliance was on file at the date of the record.
Detection	No smoke or carbon-monoxide detection was observed anywhere in the property.
Damp	Damp-like staining and moss on an unfinished concrete wall section. Recorded, not diagnosed – no part of the fabric was opened up.
Roof and rainwater goods	Not recorded at close range; the rainwater-harvesting tank is present and in good order at ground level.
Geyser	Not recorded. Believed to be in the garage roof space.
Room attribution	Three rooms – a single-bed room, an empty tiled room and a taupe-walled room – are recorded in full, but the record does not establish which named bedroom each is. They are carried separately rather than filed against a room they may not be.
Boundary	Corner plot with one shared neighbour. Vehicle access from two roads.

10 The property as recorded



Plate 001 Built-in fireplace recess with black metal gas/radiant fire insert



Plate 002 Built-in fireplace recess with black metal gas/radiant fire insert

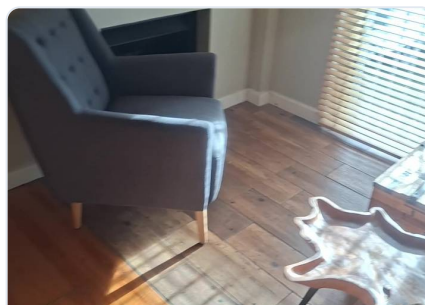


Plate 003 Built-in fireplace recess with black metal gas/radiant fire insert



Plate 004 Built-in fireplace recess with black metal gas/radiant fire insert



Plate 005 Grey woven-fabric wingback armchair



Plate 006 Grey woven-fabric wingback armchair



Plate 007 Grey woven-fabric wingback armchair



Plate 008 Grey woven-fabric wingback armchair



Plate 009 Grey woven-fabric wingback armchair



Plate 010 Grey woven-fabric wingback armchair



Plate 011 Grey/charcoal fabric L-shaped sectional sofa with chaise section



Plate 012 Grey/charcoal fabric L-shaped sectional sofa with chaise section



Plate 013 Tan/caramel-brown leather sofa

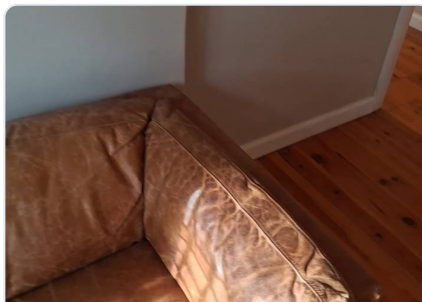


Plate 014 Tan/caramel-brown leather sofa



Plate 015 Tan/caramel-brown leather sofa

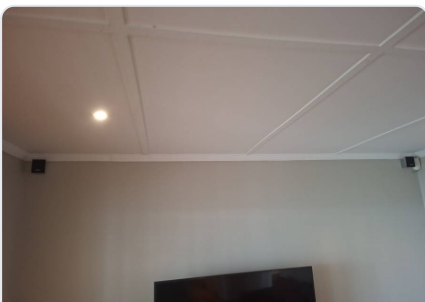


Plate 016 SAMSUNG flat-screen television

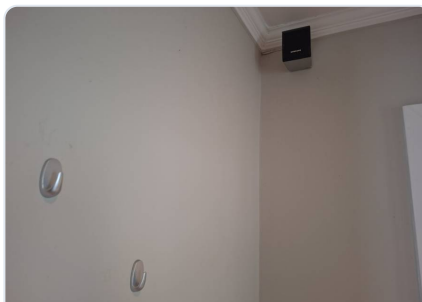


Plate 017 SAMSUNG wireless satellite speakers



Plate 018 SAMSUNG wireless satellite speakers

Important. AssetProof is not an insurer, loss adjuster, assessor, broker or certified valuer. This document is a structured record based on the media and information supplied for the property and on visual assessment of it. Replacement and reinstatement figures are **opinions of value and a point of departure for discussion** — they are estimates, not certified valuations, and a certified valuer should sign off the final figure for any high-value, insured or disputed item. Confirmed facts, owner-supplied information and estimates are distinguished throughout. Condition statements describe what was visible on the recorded date; they are not a structural, electrical, gas, damp or compliance survey, and no part of the fabric was opened up, moved or tested. Cost bands are planning figures at South African rates and are not quotations. Rental figures are estimates from public signals, not confirmed booking data, and are not a forecast of income.