



Photo Report



SALTHILL CAPITAL
1001-130 BLOOR STREET WEST /
TORONTO, ON
TORONTO, ONTARIO M5S 1N5

FACILITY: Royal Oak Park	ROOF SECTION: 1.6.1 Daycare	TITLE: Cut Tests_Sept 17_25	DATE: 09/17/2025
--------------------------	-----------------------------	-----------------------------	------------------

Map



Summary

Roof Composition:

- Metal deck
- Gypsum board, glued. Roofers thought it was DensDeck Prime by looking at it. This is unconfirmed.
- TPO membrane, loose laid.
- 3" of insulation, loose laid (one layer of 2", one layer of 1").
- *in area of fence posts, 2" of insulation is replaced with a 2" paver. This is to weight down the fence post stands.
- Mat system for fake grass.
- Gravel.
- Fake grass

Wall panels: to replace roof, we will need to remove and reinstall the wall panels. We are getting a price for this from a wall panel contractor.

Flashings at base of windows and doors: glazer (or potentially roofer) will need to remove and reinstall these to be able to properly install flashing membranes. Roofer will carry this.



Overview photo of the roof.



Overview of SE roof area.



Close up of the fence post. Sealant is failed where the post enters the support sleeve.

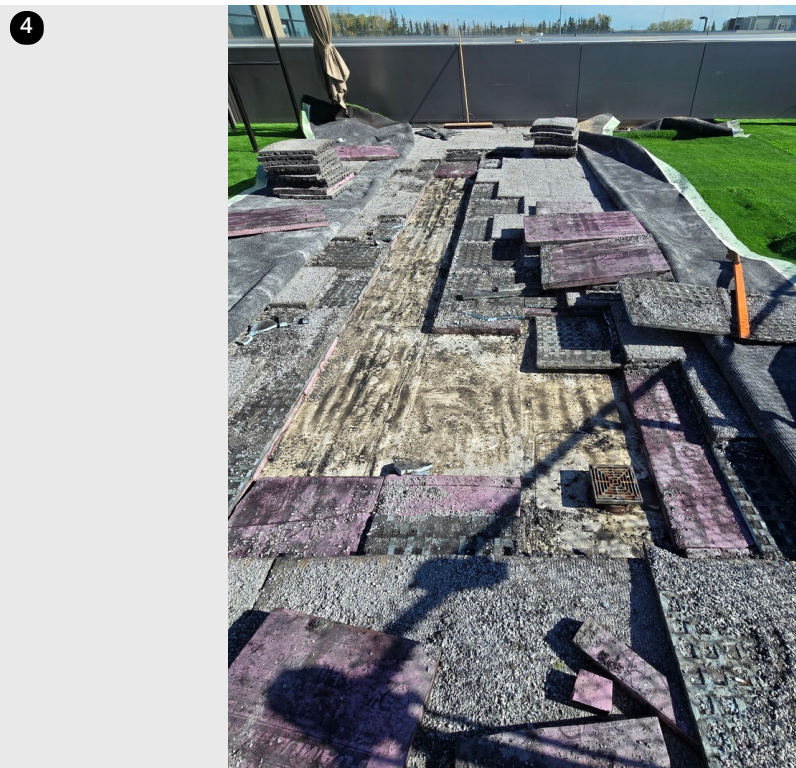


Photo of previous leak investigation completed by Flynn, prior to Salthill ownership.



Overview of the exposed substrate against the east wall and adjacent to a fence post. Each post appears to have a metal stand, with a sleeve to the fence post welded to it. A paver sits in the stand (or frame) to weigh it down.



TPO membrane was observed to be loose laid.



2" thickness pavers on either side of each fence post.



A cut test was also completed in the area of the drain. Same composition and insulation thickness was observed.

9



TPO membrane loose laid on gypsum board.

10




2" XPS.

11



1" Roofmate.

12

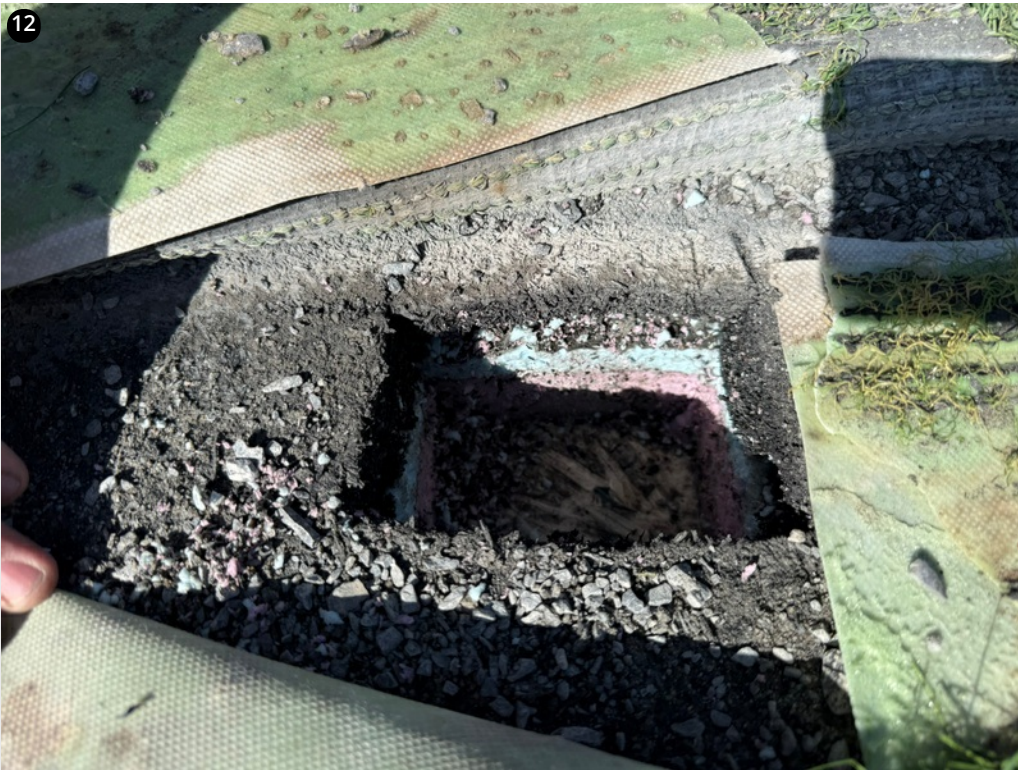

Overview photo.

13



Cut test was completed in the corner in the area of the window sill and wall. Same composition.

14



2" insulation + 1" insulation (see next photo).

15



1" layer of insulation.

16



Example of the mat laid beneath the grass and gravel.



17

A glazer needs to be engaged with to price to remove metal flashings which run under the window frames. There will not be adequate height to run membrane if we do not remove this.



18

Area was restored and cleaned.

19



Areas was restored and cleaned.