HANGER SCHEDULE


Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

Every hung end in the takeoff, the member it hangs on and the hanger for it. Hangers are chosen by rule from the two members in the model (product, plies, depth, slope), so a member that changes size changes its hangers on the next build. Simpson Strong-Tie model numbers; an equal MiTek or USP hanger is fine. Members that bear on a wall plate, post or beam top are listed too, so every end is accounted for.

BEAM AND HANGER PLAN: each tag is a row number in the schedule; grey tag = bears, no hanger; red ring = to confirm.

2ND FLOOR DECK: BEAMS AND HANGERS (batch 2 and the balcony)

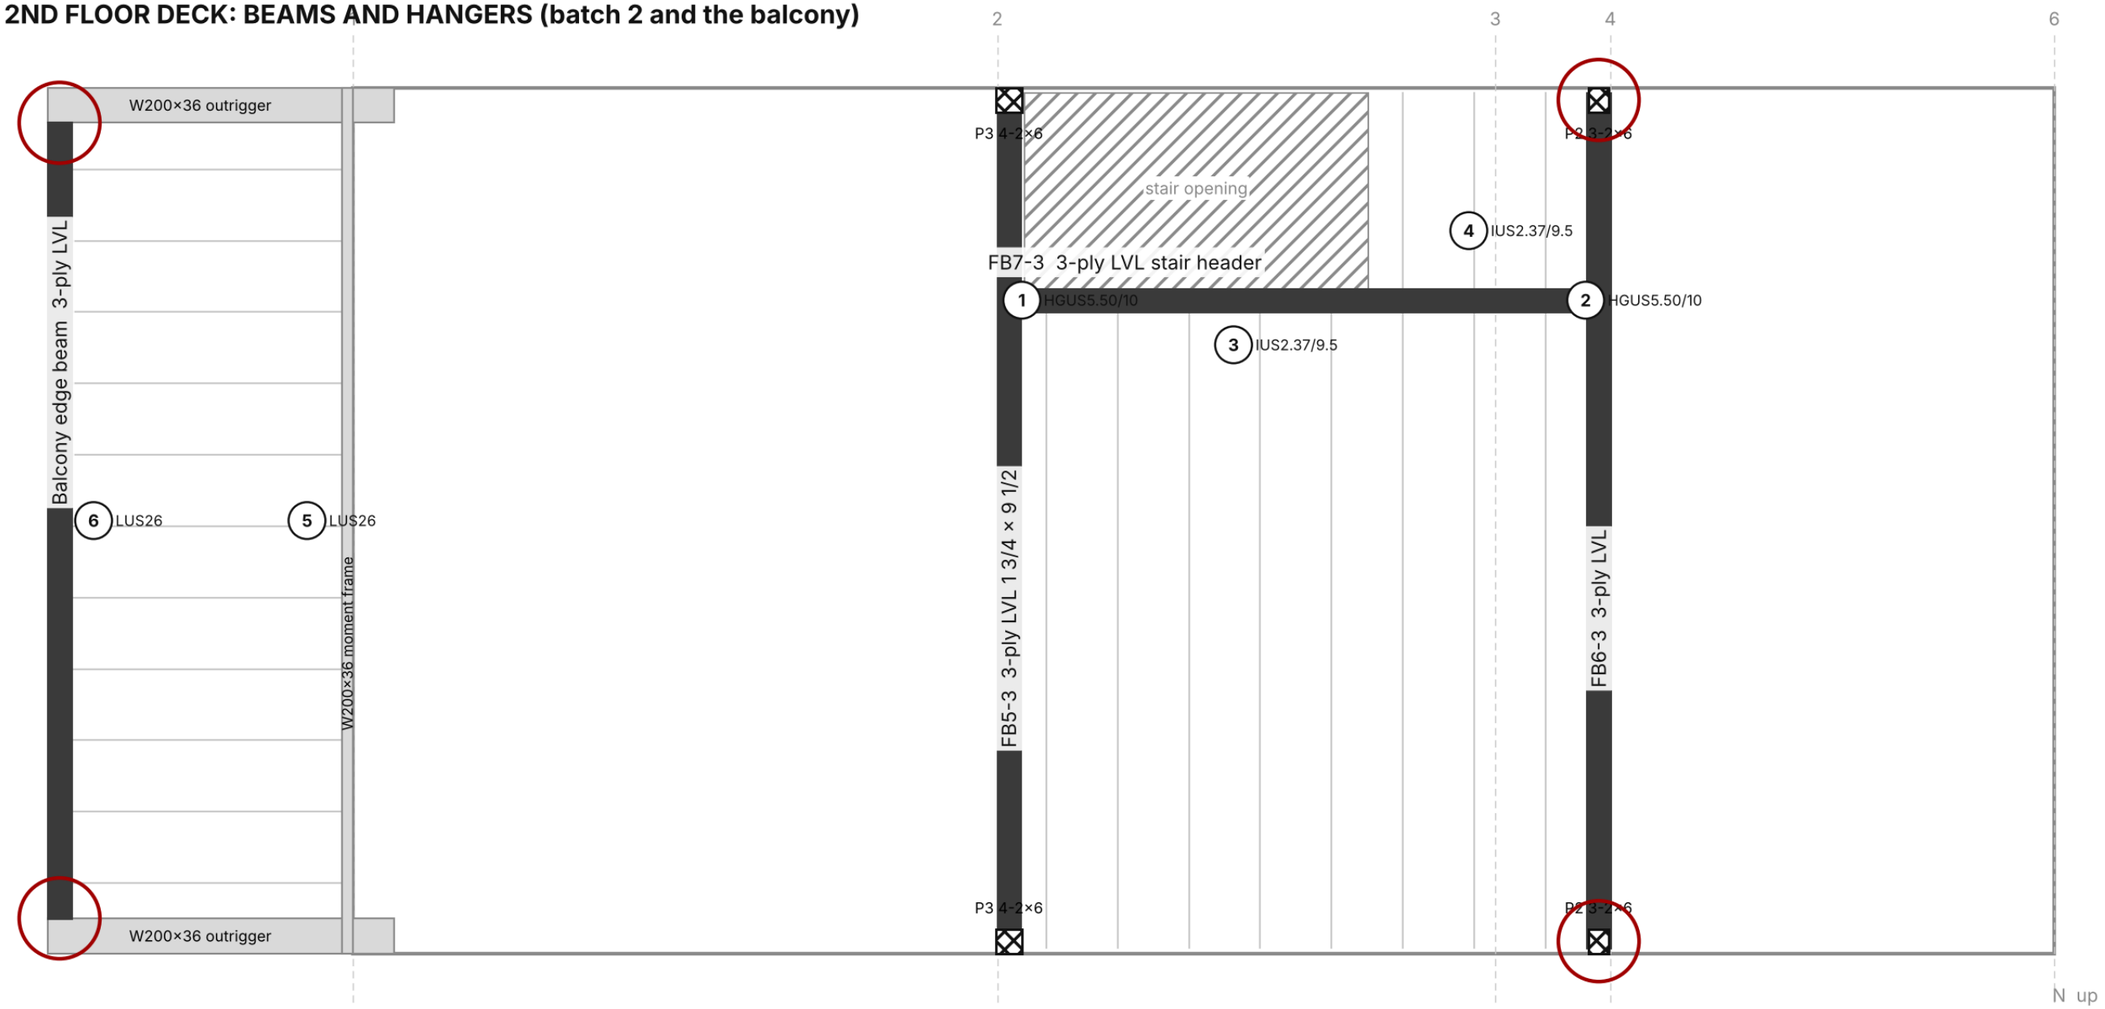

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026


Hanger Schedule – T 1.06B

HANGER SCHEDULE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

ROOF AND LOWER LEVEL EAST OF GRID 2: BEAMS AND HANGERS (batch 4)

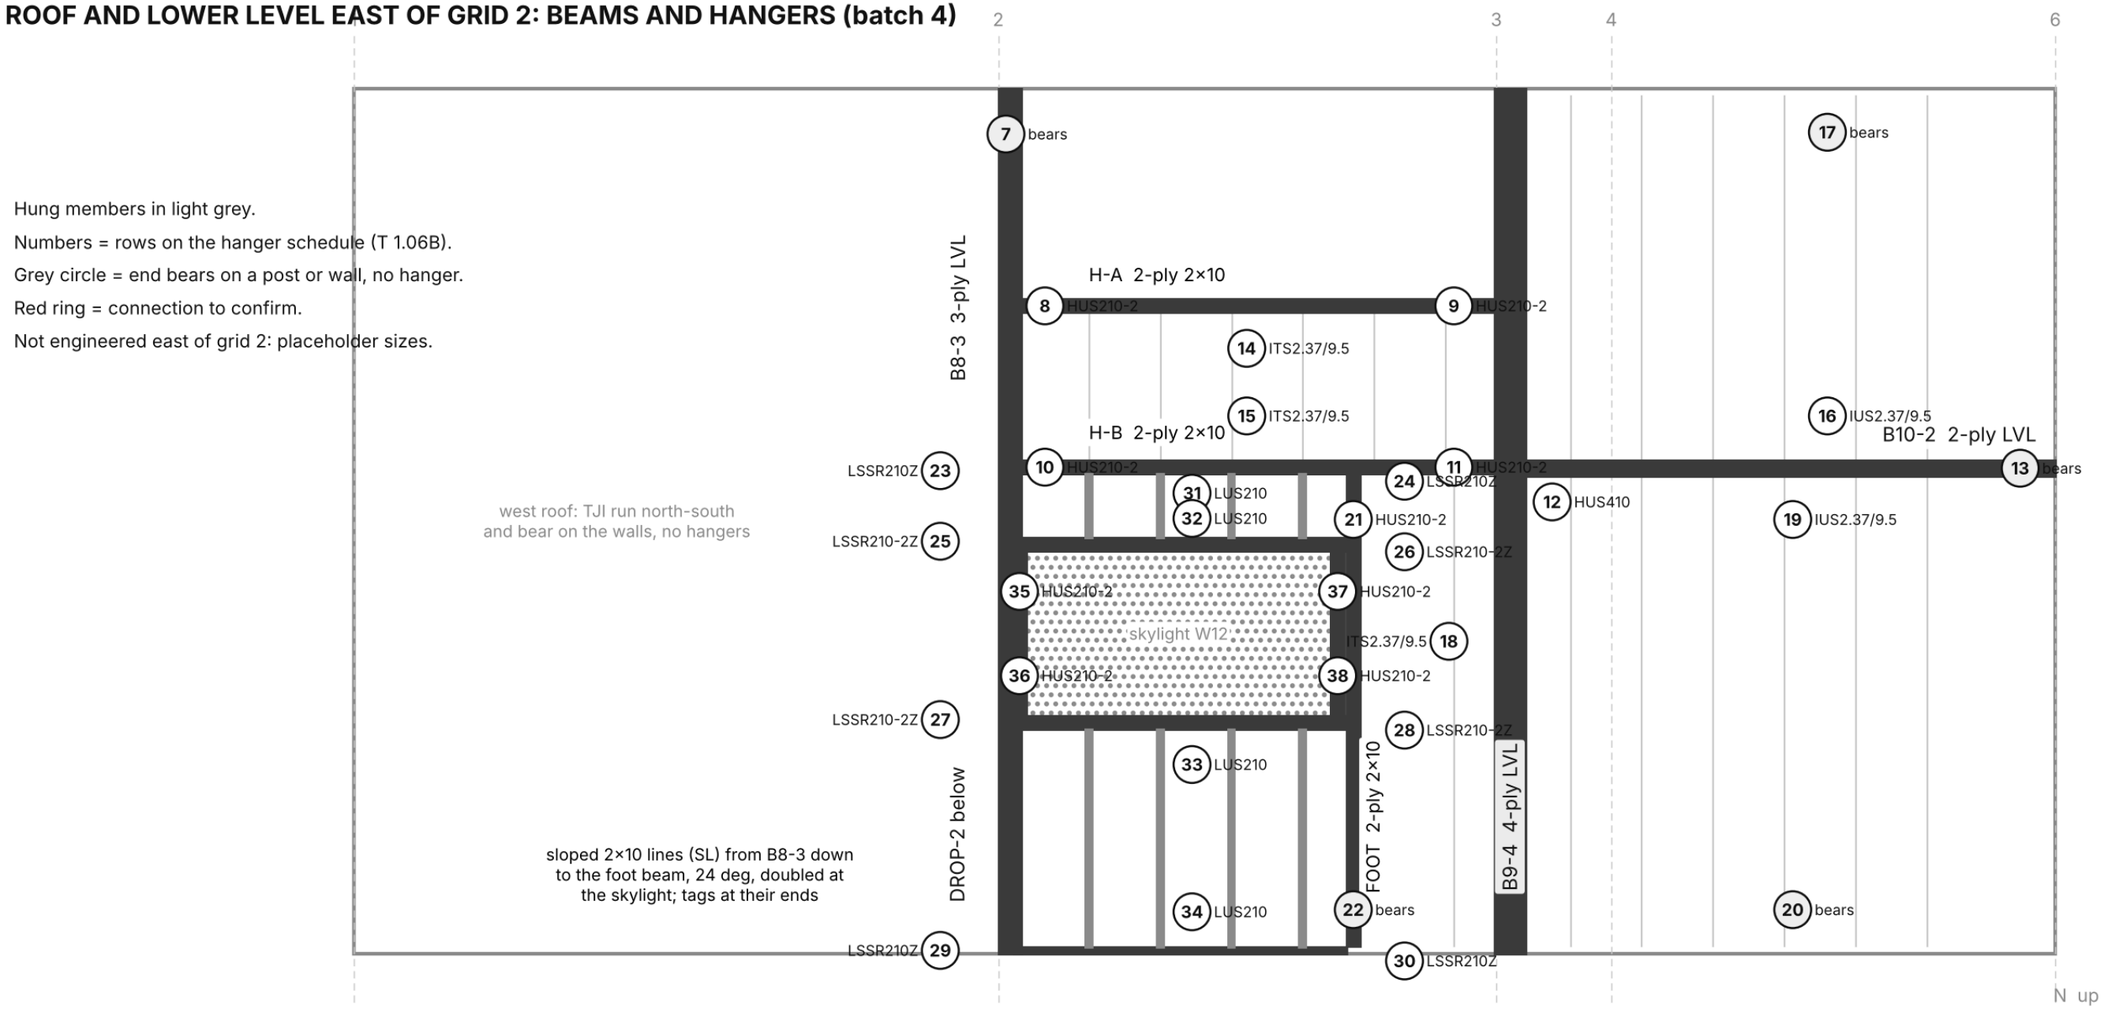

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hanger Schedule – T 1.06B

HANGER SCHEDULE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

CHANGES SINCE MAREK'S COMMENTS (T2 TO T4)

the hangers and their fastening only; nothing else in the order changed

WHAT	T2 (WHAT MAREK SAW)	NOW	WHY
TJI hangers	IUS2.56/9.5 x 45	**IUS2.37/9.5 x 26, ITS2.37/9.5 x 13**	IUS2.56 is for a 2 1/2" flange (Taiga's PJI-40); the TJI 360 flange is 2 5/16". Top flange where the TJI hangs on a 9 1/4" 2x10 header.
Sloped 2x10 at the slope	LSSU210 x 12	**LSSR210Z x 4, LSSR210-2Z x 4**	LSSU210 is discontinued; the doubled members take one double hanger per end, not two singles.
Stairs	LUS210 x 6, LSC x 6	**none**	No hangers at the stairs.
Grid 2 drop beam	HUS210-2 x 2	**none**	Bears on the P3 posts.
B10-2 east end	HUS410 x 2	**HUS410 x 1**	East end bears on the east wall; one hanger into B9-4, as Taiga.
Enclosure floor east of grid 3, north ends	IUS x 6	**none**	Bear on the north wall.
Balcony joists	LUS26 x 26	**LUS26 x 22**	11 joists in the model; T2 had 13 a side typed.
Nails for HGUS and HUS	SDS screws and 1 1/2" hanger nails	**16d commons**	Simpson: HGUS5.50/10 46-16d face and 16-16d joist; HUS 8 + 8 16d.
Multi-ply LVL ply fastening	not carried	**Simpson SDW EWP-PLY screws**	Every 2-, 3- and 4-ply LVL carrying hung members is screwed together, 2 rows at 16" o.c.

MULTI-PLY LVL CONNECTIONS (TRIPLE LVL AND THE 2- AND 4-PLY BEAMS)

how each end is carried, what hangs on each beam, and how the plies are fastened so a side-hung load reaches every ply

BEAM	WHERE	PLIES	ENDS	CARRIES ON ITS FACES	PLY SCREWS	TO CONFIRM
FB5-3	2nd floor, grid 2 beam line (Taiga FB5-3, engineer's sheet)	3	north end: bears on post P3 (4-2x6) in the north wall; south end: bears on post P3 (4-2x6) in the south wall	stair header FB7-3 on the east face (HGUS5.50/10)	SDW22500 x 26, 2 rows at 16"	
FB6-3	2nd floor, grid 4 beam line (Taiga FB6-3, engineer's sheet)	3	north end: bears on post P2 (3-2x6) in the north wall; south end: bears on post P2 (3-2x6) in the south wall	stair header FB7-3 on the west face (HGUS5.50/10)	SDW22500 x 26, 2 rows at 16"	**Both ends: post P2 is 4 1/2" wide under a 5 1/4" beam, so the outside ply is not fully on the post. Hossein to confirm, or make it a 4-2x6 post (6").**
FB7-3	2nd floor, stair header between the beam lines (Taiga FB7-3)	3	west end: hangs on FB5-3, HGUS5.50/10; east end: hangs on FB6-3, HGUS5.50/10	8 TJI tails on the south face and 3 on the north face (IUS2.37/9.5)	SDW22500 x 20, 2 rows at 16"	
Balcony edge beam	Balcony, laneway edge between the outrigger ends (engineer's sheet)	3	north end: to the end of the north W200x36 outrigger: not detailed; south end: to the end of the south W200x36 outrigger: not detailed	11 balcony 2x6 on the east face (LUS26); guardrail on the west face (A405)	SDW22500 x 28, 2 rows at 16"	**Both ends: wood to steel connection not on the drawings (seat or end plate on the outrigger). Hossein to detail.**
B8-3	Roof, grid 2 beam at the high end of the slope (Taiga B8-3)	3	north end: bears on post P3 in the 2nd floor north wall; south end: bears on post P3 in the 2nd floor south wall	the 4 sloped 2x10 lines on the east face (LSSR210Z, LSSR210-2Z)	SDW22500 x 30, 2 rows at 16"	
B9-4	Lower level, grid 3 beam (Taiga B9-4)	4	north end: bears on a post in the north wall (not on the engineer's sheet: question on T 1.00); south end: bears on a post in the south wall (as north)	H-A and H-B on the west face (HUS210-2), B10-2 on the east face (HUS410)	SDW22638 x 30, 2 rows at 16"	
B10-2	Lower level, under the enclosure south wall (Taiga B10-2)	2	west end: hangs on B9-4, HUS410; east end: bears on the east wall	enclosure floor and east roof TJI on both faces (IUS2.37/9.5)	SDW22338 x 22, 2 rows at 16"	

HANGER SCHEDULE

one row per connection; QTY is the number of hung ends

#	WHERE	MEMBER HUNG	END	HANGS ON	QTY	HANGER (T4)	T2 HAD	NOTES
1	2nd floor, stair opening	stair header, 3-ply LVL between the trimmers (Taiga FB7-3) (3-ply LVL 1 3/4 x 9 1/2)	west end	west stair trimmer, 3-ply LVL beam line at grid 2 (Taiga FB5-3)	1	**HGUS5.50/10**	HGUS5.50/10	
2	2nd floor, stair opening	stair header, 3-ply LVL between the trimmers (Taiga FB7-3) (3-ply LVL 1 3/4 x 9 1/2)	east end	east stair trimmer, 3-ply LVL beam line at grid 4 (Taiga FB6-3)	1	**HGUS5.50/10**	HGUS5.50/10	
3	2nd floor, stair opening	TJI tails south of the header, TJI 360 9 1/2"	north end	stair header, 3-ply LVL between the trimmers (Taiga FB7-3)	8	**IUS2.37/9.5**	IUS2.56/9.5	**CHANGED. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2".**
4	2nd floor, stair opening	TJI east of the opening, north of the header, TJI 360 9 1/2"	south end	stair header, 3-ply LVL between the trimmers (Taiga FB7-3)	3	**IUS2.37/9.5**	IUS2.56/9.5	**CHANGED. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2".**
5	Balcony deck	Balcony joists, 2x6	east end	House-side rim (2x6)	11	**LUS26**	LUS26 (13 per side typed)	**CHANGED. 11 joists in the model; T2 typed 13 a side.**
6	Balcony deck	Balcony joists, 2x6	west end	Balcony LVL edge beam (LVL 1 3/4 x 9 1/2)	11	**LUS26**	LUS26 (13 per side typed)	**CHANGED. 11 joists in the model; T2 typed 13 a side.**

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hanger Schedule – T 1.06B

HANGER SCHEDULE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

#	WHERE	MEMBER HUNG	END	HANGS ON	QTY	HANGER (T4)	T2 HAD	NOTES
7	Lower level east of grid 2	2-ply 2x10 drop beam on grid 2 under the lower level (2-ply 2x10)	both ends	P3 posts in the north and south walls	2	**none, bears**	HUS210-2	**CHANGED. Bears on the posts; post cap or seat to the engineer. T2 had two HUS210-2 hangers here.**
8	Lower level east of grid 2	2-ply 2x10 header at the south edge of the roof-stair opening, grid 2 to 3 (2-ply 2x10)	west end	2-ply 2x10 drop beam on grid 2 under the lower level	1	**HUS210-2**	HUS210-2	Not engineered yet.
9	Lower level east of grid 2	2-ply 2x10 header at the south edge of the roof-stair opening, grid 2 to 3 (2-ply 2x10)	east end	4-ply LVL beam at grid 3 (Taiga B9-4)	1	**HUS210-2**	HUS210-2	Not engineered yet.
10	Lower level east of grid 2	2-ply 2x10 header under the enclosure south wall, grid 2 to 3 (2-ply 2x10)	west end	2-ply 2x10 drop beam on grid 2 under the lower level	1	**HUS210-2**	HUS210-2	Not engineered yet.
11	Lower level east of grid 2	2-ply 2x10 header under the enclosure south wall, grid 2 to 3 (2-ply 2x10)	east end	4-ply LVL beam at grid 3 (Taiga B9-4)	1	**HUS210-2**	HUS210-2	Not engineered yet.
12	Lower level east of grid 2	2-ply LVL beam under the enclosure south wall, grid 3 to the east wall (Taiga B10-2) (2-ply LVL 1 3/4 x 9 1/2)	west end	4-ply LVL beam at grid 3 (Taiga B9-4)	1	**HUS410**	HUS410	
13	Lower level east of grid 2	2-ply LVL beam under the enclosure south wall, grid 3 to the east wall (Taiga B10-2) (2-ply LVL 1 3/4 x 9 1/2)	east end	east wall	1	**none, bears**	HUS410	**CHANGED. T2 carried a second HUS410 here.**
14	Enclosure floor, grid 2 to 3	Enclosure floor joists, TJI 360 9 1/2"	north end	2-ply 2x10 header at the south edge of the roof-stair opening, grid 2 to 3	6	**ITS2.37/9.5**	IUS2.56/9.5	**CHANGED. Not engineered yet. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2". Header is 1/4" shallower than the TJI, so top flange.**
15	Enclosure floor, grid 2 to 3	Enclosure floor joists, TJI 360 9 1/2"	south end	2-ply 2x10 header under the enclosure south wall, grid 2 to 3	6	**ITS2.37/9.5**	IUS2.56/9.5	**CHANGED. Not engineered yet. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2". Header is 1/4" shallower than the TJI, so top flange.**
16	Enclosure floor east of grid 3	Enclosure floor joists, TJI 360 9 1/2"	south end	2-ply LVL beam under the enclosure south wall, grid 3 to the east wall (Taiga B10-2)	6	**IUS2.37/9.5**	IUS2.56/9.5	**CHANGED. Not engineered yet. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2".**
17	Enclosure floor east of grid 3	Enclosure floor joists, TJI 360 9 1/2"	north end	north wall plate	6	**none, bears**	IUS2.56/9.5	**CHANGED. T2 hung these ends too.**
18	East low roof	East roof joists west of grid 3, TJI 360 9 1/2"	north end	2-ply 2x10 header under the enclosure south wall, grid 2 to 3	1	**ITS2.37/9.5**	IUS2.56/9.5	**CHANGED. Not engineered yet. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2". Header is 1/4" shallower than the TJI, so top flange.**
19	East low roof	East roof joists east of grid 3, TJI 360 9 1/2"	north end	2-ply LVL beam under the enclosure south wall, grid 3 to the east wall (Taiga B10-2)	6	**IUS2.37/9.5**	IUS2.56/9.5	**CHANGED. Not engineered yet. TJI 360 has a 2 5/16" flange; IUS2.56 is for 2 1/2".**
20	East low roof	East roof joists, TJI 360 9 1/2"	south end	south wall plate	7	**none, bears**	none	bears, no hanger
21	Sloped roof	2-ply 2x10 foot beam at the bottom of the slope (2-ply 2x10)	north end	2-ply 2x10 header under the enclosure south wall, grid 2 to 3	1	**HUS210-2**	HUS210-2	Not engineered yet.
22	Sloped roof	2-ply 2x10 foot beam at the bottom of the slope (2-ply 2x10)	south end	south wall plate	1	**none, bears**	none	bears, no hanger
23	Sloped roof	sloped 2x10, north edge of the slope (2x10, sloped 24 deg)	high end (SL-2158)	3-ply LVL roof beam at grid 2, high end of the slope (Taiga B8-3)	1	**LSSR210Z**	LSSU210	**CHANGED. Not engineered yet. LSSU210 is discontinued. The plumb cut at the slope is 10 1/8" deep against a 9 1/2" support: seat or bevel the bottom to suit, Hossein to confirm.**
24	Sloped roof	sloped 2x10, north edge of the slope (2x10, sloped 24 deg)	low end (SL-2158)	2-ply 2x10 foot beam at the bottom of the slope	1	**LSSR210Z**	LSSU210	**CHANGED. Not engineered yet. LSSU210 is discontinued. The plumb cut at the slope is 10 1/8" deep against a 9 1/4" support: seat or bevel the bottom to suit, Hossein to confirm.**
25	Sloped roof	sloped 2-ply 2x10, north trimmer of the skylight (2-ply 2x10, sloped 24 deg)	high end (SL-2560)	3-ply LVL roof beam at grid 2, high end of the slope (Taiga B8-3)	1	**LSSR210-2Z**	LSSU210 x2 (one per ply)	**CHANGED. Not engineered yet. LSSU210 is discontinued. One double hanger per end, not two singles. The plumb cut at the slope is 10 1/8" deep against a 9 1/2" support: seat or bevel the bottom to suit, Hossein to confirm.**
26	Sloped roof	sloped 2-ply 2x10, north trimmer of the skylight (2-ply 2x10, sloped 24 deg)	low end (SL-2560)	2-ply 2x10 foot beam at the bottom of the slope	1	**LSSR210-2Z**	LSSU210 x2 (one per ply)	**CHANGED. Not engineered yet. LSSU210 is discontinued. One double hanger per end, not two singles. The plumb cut at the slope is 10 1/8" deep against a 9 1/4" support: seat or bevel the bottom to suit, Hossein to confirm.**
27	Sloped roof	sloped 2-ply 2x10, south trimmer of the skylight (2-ply 2x10, sloped 24 deg)	high end (SL-3576)	3-ply LVL roof beam at grid 2, high end of the slope (Taiga B8-3)	1	**LSSR210-2Z**	LSSU210 x2 (one per ply)	**CHANGED. Not engineered yet. LSSU210 is discontinued. One double hanger per end, not two singles. The plumb cut at the slope is 10 1/8" deep against a 9 1/2" support: seat or bevel the bottom to suit, Hossein to confirm.**

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hanger Schedule – T 1.06B

HANGER SCHEDULE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by **William**

#	WHERE	MEMBER HUNG	END	HANGS ON	QTY	HANGER (T4)	T2 HAD	NOTES
28	Sloped roof	sloped 2-ply 2x10, south trimmer of the skylight (2-ply 2x10, sloped 24 deg)	low end (SL-3576)	2-ply 2x10 foot beam at the bottom of the slope	1	**LSSR210-2Z**	LSSU210 x2 (one per ply)	**CHANGED. Not engineered yet. LSSU210 is discontinued. One double hanger per end, not two singles. The plumb cut at the slope is 10 1/8" deep against a 9 1/4" support: seat or bevel the bottom to suit, Hossein to confirm.**
29	Sloped roof	sloped 2x10, south edge of the slope (2x10, sloped 24 deg)	high end (SL-4891)	3-ply LVL roof beam at grid 2, high end of the slope (Taiga B8-3)	1	**LSSR210Z**	LSSU210	**CHANGED. Not engineered yet. LSSU210 is discontinued. The plumb cut at the slope is 10 1/8" deep against a 9 1/2" support: seat or bevel the bottom to suit, Hossein to confirm.**
30	Sloped roof	sloped 2x10, south edge of the slope (2x10, sloped 24 deg)	low end (SL-4891)	2-ply 2x10 foot beam at the bottom of the slope	1	**LSSR210Z**	LSSU210	**CHANGED. Not engineered yet. LSSU210 is discontinued. The plumb cut at the slope is 10 1/8" deep against a 9 1/4" support: seat or bevel the bottom to suit, Hossein to confirm.**
31	Sloped roof	short 2x10 joists between the sloped members, north of the skylight (2x10)	north end	sloped 2x10, north edge of the slope	4	**LUS210**	LUS210	Not engineered yet.
32	Sloped roof	short 2x10 joists between the sloped members, north of the skylight (2x10)	south end	sloped 2-ply 2x10, north trimmer of the skylight	4	**LUS210**	LUS210	Not engineered yet.
33	Sloped roof	short 2x10 joists between the sloped members, south of the skylight (2x10)	north end	sloped 2-ply 2x10, south trimmer of the skylight	4	**LUS210**	LUS210	Not engineered yet.
34	Sloped roof	short 2x10 joists between the sloped members, south of the skylight (2x10)	south end	sloped 2x10, south edge of the slope	4	**LUS210**	LUS210	Not engineered yet.
35	Sloped roof, skylight	2-ply 2x10 header at the top of the skylight opening (2-ply 2x10)	north end	sloped 2-ply 2x10, north trimmer of the skylight	1	**HUS210-2**	HUS210-2	Not engineered yet.
36	Sloped roof, skylight	2-ply 2x10 header at the top of the skylight opening (2-ply 2x10)	south end	sloped 2-ply 2x10, south trimmer of the skylight	1	**HUS210-2**	HUS210-2	Not engineered yet.
37	Sloped roof, skylight	2-ply 2x10 header at the bottom of the skylight opening (2-ply 2x10)	north end	sloped 2-ply 2x10, north trimmer of the skylight	1	**HUS210-2**	HUS210-2	Not engineered yet.
38	Sloped roof, skylight	2-ply 2x10 header at the bottom of the skylight opening (2-ply 2x10)	south end	sloped 2-ply 2x10, south trimmer of the skylight	1	**HUS210-2**	HUS210-2	Not engineered yet.

HANGERS TO ORDER, T2 AGAINST T4

T4 includes 3 spare IUS2.37/9.5 at the stair, as before

HANGER	FITS	T2 QTY	T4 QTY
HGUS5.50/10	3-ply 1 3/4" LVL, 5 1/4" x 9 1/2"	2	2
HUS210-2	2-ply 2x10	11	9
HUS410	2-ply 1 3/4" LVL	2	1
ITS2.37/9.5	TJI 360 9 1/2", top flange over a shallower header		13
IUS2.37/9.5	TJI 360 9 1/2" (2 5/16" flange), face mount		26
IUS2.56/9.5	2 1/2" flange I-joist (Taiga's PJI-40): not the TJI 360 now carried	45	
LSSR210-2Z	2-ply 2x10, sloped (field-adjustable)		4
LSSR210Z	single 2x10, sloped (field-adjustable)		4
LSSU210	single 2x10 sloped; discontinued by Simpson	12	
LUS210	single 2x10	22	16
LUS26	single 2x6	26	22

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hanger Schedule – T 1.06B

HANGER SCHEDULE

Lamb Laneway House and Secondary Suite | 80 Lamb Ave, Toronto, Ontario | North Arrow Limited | Framing package

by William

NOTES

1. TJI hangers: T2 carried IUS2.56/9.5 from Taiga's layout, which was drawn for a 2 1/2" flange joist (PJI-40). The approved TJI 360 has a 2 5/16" flange, so the hanger is IUS2.37/9.5.
2. Where a TJI (9 1/2") hangs on a 2-ply 2x10 header (9 1/4") a face-mount hanger would sit 1/4" below the header, so those ends take the top-flange ITS2.37/9.5.
3. Sloped members: LSSU210 is discontinued; LSSR210Z replaces it, and the doubled lines at the skylight take one LSSR210-2Z per end, not two singles. The plumb cut of a 24 deg 2x10 is about 10 1/8" deep, deeper than the 9 1/4" foot beam and the 9 1/2" LVL at grid 2: seat or bevel the bottom to suit, Hossein to confirm.
4. Ends that bear, not hang: the grid-2 drop beam on the P3 posts (T2 had two HUS210-2), the east end of B10-2 on the east wall (Taiga lists one HUS410, T2 had two), and the north ends of the enclosure floor joists east of grid 3 on the north wall.
5. Balcony: 11 joists in the model, so 22 LUS26 (T2 had 26 typed); the house-side ones only if the joists do not land on the steel, confirm on the steel shop drawings.
6. Fastening per Simpson (ESR-2552): HGUS5.50/10 46-16d into the carrying beam and 16-16d into the header, driven at 45 deg (double shear); HUS 8-16d + 8-16d. 16d commons (0.162" x 3 1/2") are their own order line. Where a hanger is on the screw-tip face of a multi-ply beam, its face nails must be at least 3" long.
7. Ply screws: Simpson Strong-Drive SDW EWP-PLY, SDW22338 for 2-ply, SDW22500 for 3-ply, SDW22638 for 4-ply 1 3/4" LVL, 2 rows at 16" o.c. from one face (675 plf allowable side load on a 3-ply at that spacing in the LVL maker's table). Taiga to confirm the pattern for RigidLam.
8. Everything east of grid 2 is not engineered yet: the hangers follow the architect's placeholder sizes and change with Hossein's roof sheet.

ISSUED FOR BUDGET AND COORDINATION, REV T4, 23 OCT 2026

80 Lamb Ave – Laneway House
Oct 23, 2026

Hanger Schedule – T 1.06B