


A closed lid with three clearly labelled controls

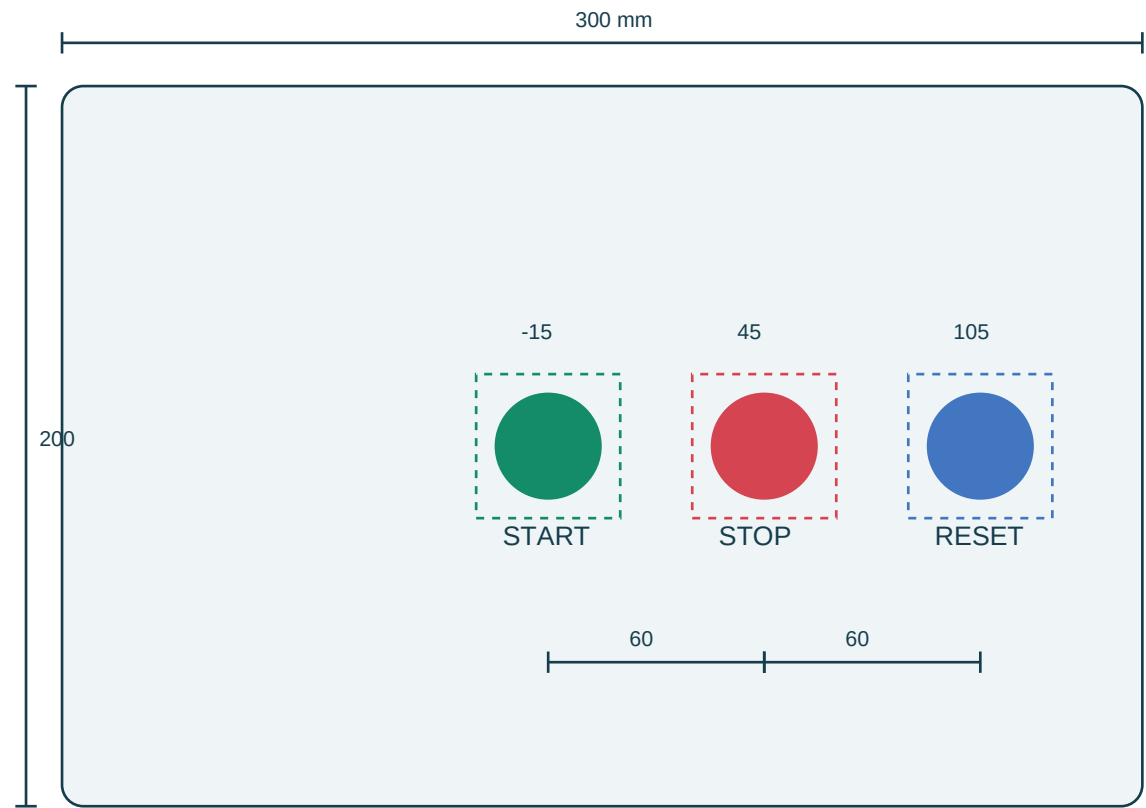

Datum: box centre X/Y; proposed row Y=0; not a drilling template

Dashed squares: ASSUMED 40 x 40 rear envelopes

Verified OEM mounting instruction: BRU46063 page2 specifies 22.3mm hole with +0.4/-0 tolerance; 1-6mm panel range for these ordinary heads. Same-row minimum 30mm; proposed 60mm pitch exceeds this. Labels and installed accessories must still fit.

Detected in the private box STEP: lid thickness 4.0mm at all three proposed centres. It lies within the head mounting range. This does not establish delivered thickness, retention or ingress protection after drilling.

Assumed, not measured: rear stack 40x40x55mm below inner lid plus 20mm wire-tail depth. All reservations clear the 24 OEM box solids and three existing component bodies. Smallest combined reservation/body gap 6.03mm.


Conflict found: STOP/RESET wire-tail reservations overlap the hub and speed-controller *assumed service spaces*. No solid body clash, but cable routing/connector access is NOT closed. Keep these overlap results for review; do not claim full assembled fit.

Speed setting: retain the unmodified internal NA-FC1 for now. Disconnect the external source before access; set speed, then close the lid before operation. Live adjustable external knob mounting is NOT designed. Ordinary STOP is not isolation.

Control	Candidate head / collar / contact	Centre X/Y mm	Function
START	ZB5AA3 / ZB5AZ009 / ZBE1016	[-15, 0]	NO spring-return
STOP	ZB5AA4 / ZB5AZ009 / ZBE1026	[45, 0]	NC spring-return
RESET	ZB5AA6 / ZB5AZ009 / ZBE1016	[105, 0]	NO spring-return

Ordinary input circuit - not a safety circuit

PROPOSED PROTECTED +12 V CONTROL BRANCH - PROTECTION / TERMINALS UNSELECTED

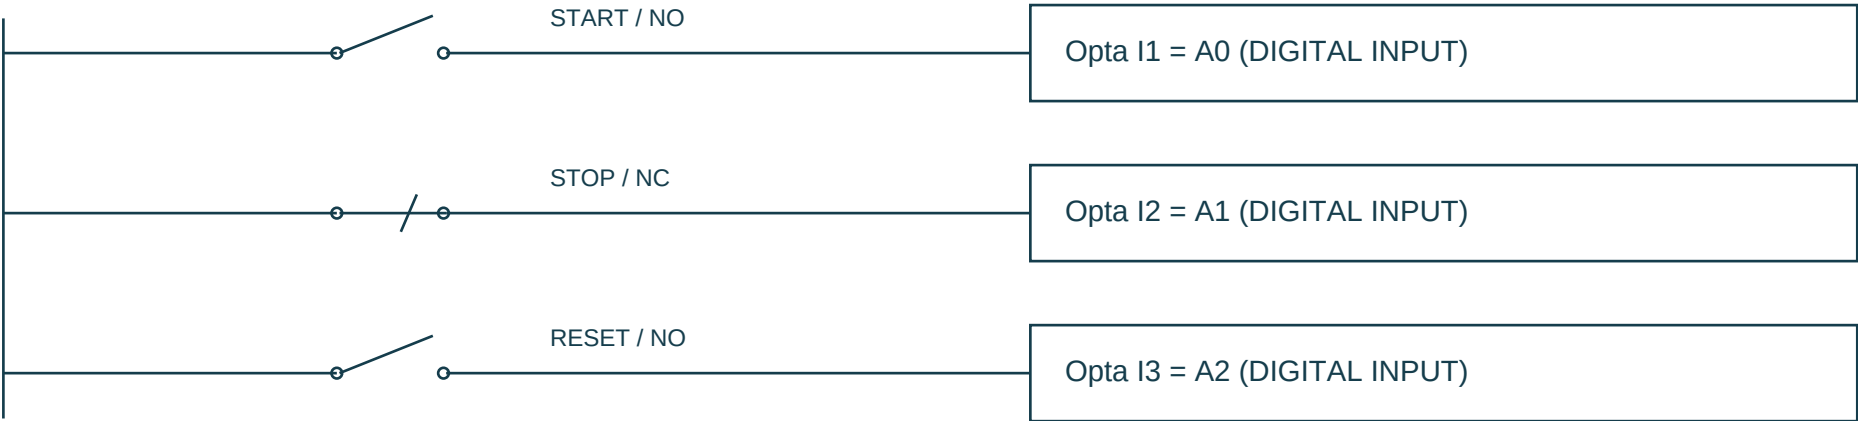

Contact screw IDs intentionally omitted - not verified

Input state	Ordinary software interpretation
START NO pressed / I1 HIGH	Request RUN only when existing logic permits. Held START cannot auto-restart.
STOP NC healthy / I2 HIGH	Pressing STOP opens contact; LOW requests stop. This is NOT protective isolation.
RESET NO pressed / I3 HIGH	Clear ordinary latched fault only when logic allows; does NOT itself start fans.
Common / additional inputs	Opta negative shares reviewed source0V. I4 bench permit / I5 source present remain E02 references; not protective inputs.

OEM electrical facts: Opta digital input0-24V, HIGH minimum6.6V, LOW maximum4.46V, impedance8.9kOhm,1.12mA at10V.12V/8.9kOhm =1.348mA is a nominal resistance screen only, not guaranteed current. Gold-flashed ZBE1016(NO) / ZBE1026(NC) are manufacturer-designated low-power contacts. Their numerical minimum switching range at our conditions remains UNKNOWN.

Bench-only status: default sketch leaves every relay OFF; this circuit cannot yet operate the fans. No protective PR1 selected, no fan-power contact assignment, no fuses or wire sizes released. Verify contact minimum rating, terminal IDs, retention, source/branch protection, actual cables, service loop, heat and isolation before any dummy-load commissioning.

Primary sources checked5 Oct2026: Schneider BRU46063 page2; Harmony catalogue DIA5ED2121213EN low-power contact table; Arduino Opta collective datasheet input specification. Full links in LID_CONTROL_CHECKS.json / README. OEM drawings/models are private research references, not redistributed. Physical prototypes0; unchanged R03M geometry.