Storage Firmware Bundle 2.76 Release Notes

HCI

Michael Wallis, Aksel Davis, Ann-Marie Grissino, Dave Bagwell
May 26, 2021

This PDF was generated from https://docs.netapp.com/us-en/hci/docs/rn_storage_firmware_2.76.html on July 16, 2021. Always check docs.netapp.com for the latest.

Table of Contents

Storage Firmware Bundle 2.76 Release Notes . . . 1
What's New . . . 1
Changes in Storage firmware components . . . 2
Resolved and known issues . . . 2
Resolved security vulnerabilities . . . 3

Storage Firmware Bundle 2.76 Release Notes

Starting with Element 12.0 and management services version 2.14, you can perform firmware-only upgrades on your storage nodes using the NetApp Hybrid Cloud Control UI and REST API. This procedure does not upgrade Element software and enables you to upgrade storage firmware outside of a major Element release.

What's New

The storage firmware bundle version 2.76 contains various bug fixes and new features, including security vulnerability fixes. You can upgrade the storage firmware using the instructions in Upgrade storage firmware.

Updated firmware components

This firmware package contains the following firmware versions for hardware components, with updated versions in bold:

Component	SolidFire SF-series	H410S	H610S
BIOS	N/A	NA2.1	**3B06**
BMC	N/A	6.84.00	**3.86.07**
NIC / Mellanox	-	**14.25.1020**	**14.25.1020**
RMS200	ae3b8cc	ae3b8cc	-
RMS300	7d8422bc	7d8422bc	-
NVDIMM, Smart	-	-	3.1
BPM, Smart	-	-	2.16
NVDIMM, Micron Gen1	-	-	26.2c
NVDIMM, Micron Gen2	-	-	25.3c
PGEM, Micron	-	-	1.40
PM863, SED	GXT5404Q	GXT5404Q	-
PM863, NSED	GXT5103Q	GXT5103Q	-
PM883, SED	**HXT7904Q**	**HXT7904Q**	-
Hawk-4, SED	8ENP7101	8ENP7101	-
Hawk-4, NSED	8ENP6101	8ENP6101	-
PM963, SED	-	-	CXV8202Q
PM963, NSED	-	-	CXV8501Q
PM983, SED	-	-	**EDA5402Q**
PM983, NSED	-	-	**EDA5700Q**
CD5, SED	-	-	**0109**
CD5, NSED	-	-	**0109**

Component	SolidFire SF-series	H410S	H610S
CD5, FIPS	-	-	0108

Changes in Storage firmware components

Component	Improvement/Change
H610S BIOS 3B06	• Improved handling of memory failures • Updated microcode version to MCU x6906
H610S BMC 3.86.07	• Added BIOS PPR event log parsing in BMC SEL • Prevent system overheat when BMC hangs • Changed length of Group Domain of LDAP from 64 to 128 characters
H410S/H610S NIC, Mellanox 14.25.1020	N/A
Various Drive Firmware Updates	N/A

Resolved and known issues

See the Bugs Online tool for details of issues that have been resolved and for any new issues.

Accessing the BOL tool

1. Navigate to the BOL tool and select **Element Software** from the drop-down list:

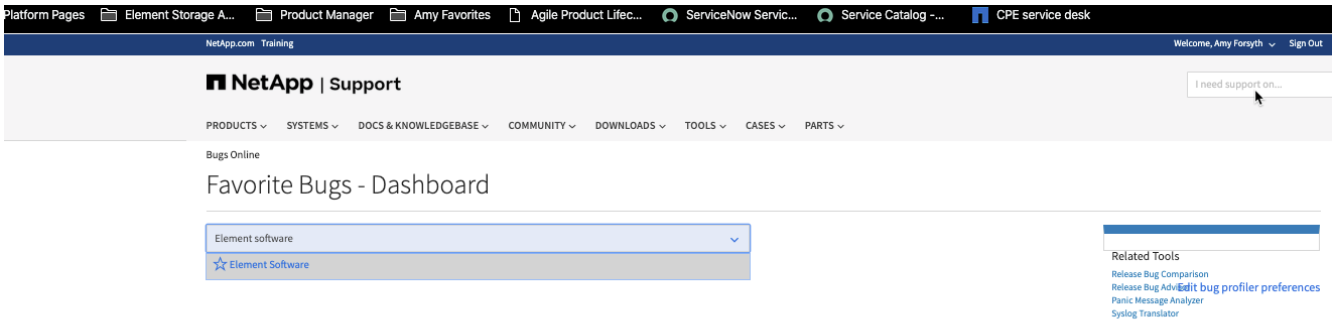

2. In the keyword search field, type “Storage Firmware Bundle” and click **New Search**:

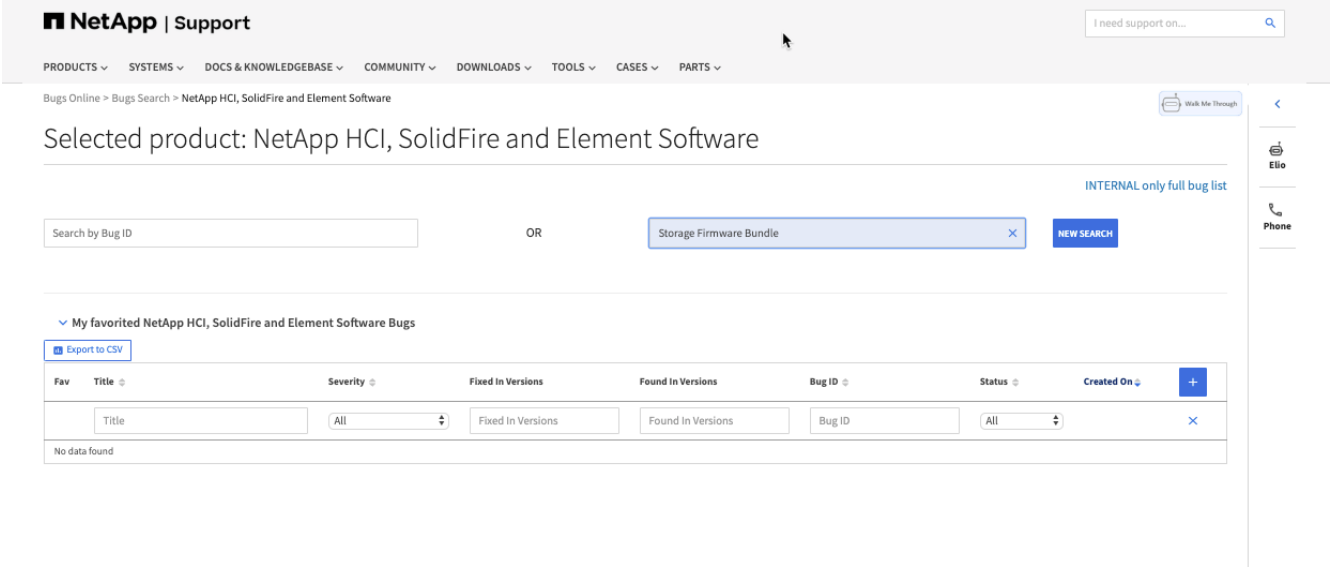

3. A list of resolved or open bugs is displayed. You can further refine the results as shown:

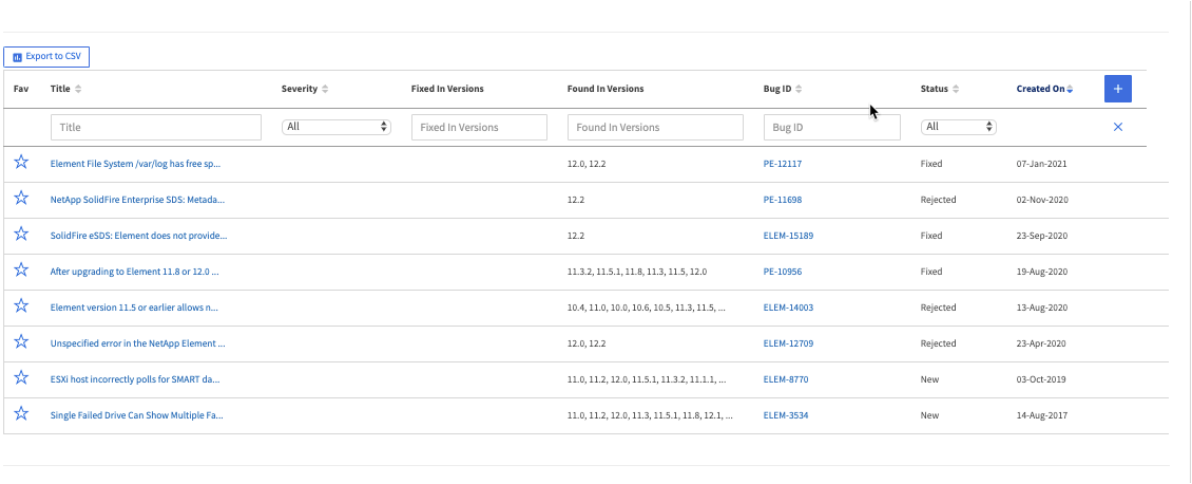

Resolved security vulnerabilities

The following are security vulnerabilities that have been resolved in this release:

H410S BMC 6.84.00

- CVE-2020-0542, CVE-2020-0532, CVE-2020-0538, CVE-2020-0534, CVE-2020-0541, CVE-2020-0533, CVE-2020-0537, CVE-2020-0531
- CVE-2020-0535, CVE-2020-0536, CVE-2020-0545, CVE-2020-0540, CVE-2020-0566, CVE-2020-0539, CVE-2020-0586, CVE-2020-0594
- CVE-2020-0595, CVE-2020-0596, CVE-2020-8674, CVE-2020-0597 CVE-2020-0543 CVE-2020-0548, CVE-2020-0549

H610S BMC 3.86.07

- CVE-2019-20636
- CVE-2019-11599, CVE-2020-12826, CVE-2020-12464, CVE-2020-12114

- CVE-2016-3706, CVE-2011-5320, CVE-2015-8984, CVE-2015-8983, CVE-2015-8982, CVE-2006-7254, CVE-2005-3590

Find more information

- NetApp HCI Documentation Center
- NetApp HCI Resources Page

Copyright Information

Copyright © 2021 NetApp, Inc. All rights reserved. Printed in the U.S. No part of this document covered by copyright may be reproduced in any form or by any means-graphic, electronic, or mechanical, including photocopying, recording, taping, or storage in an electronic retrieval system-without prior written permission of the copyright owner.

Software derived from copyrighted NetApp material is subject to the following license and disclaimer:

THIS SOFTWARE IS PROVIDED BY NETAPP “AS IS” AND WITHOUT ANY EXPRESS OR IMPLIED WARRANTIES, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, WHICH ARE HEREBY DISCLAIMED. IN NO EVENT SHALL NETAPP BE LIABLE FOR ANY DIRECT, INDIRECT, INCIDENTAL, SPECIAL, EXEMPLARY, OR CONSEQUENTIAL DAMAGES (INCLUDING, BUT NOT LIMITED TO, PROCUREMENT OF SUBSTITUTE GOODS OR SERVICES; LOSS OF USE, DATA, OR PROFITS; OR BUSINESS INTERRUPTION) HOWEVER CAUSED AND ON ANY THEORY OF LIABILITY, WHETHER IN CONTRACT, STRICT LIABILITY, OR TORT (INCLUDING NEGLIGENCE OR OTHERWISE) ARISING IN ANY WAY OUT OF THE USE OF THIS SOFTWARE, EVEN IF ADVISED OF THE POSSIBILITY OF SUCH DAMAGE.

NetApp reserves the right to change any products described herein at any time, and without notice. NetApp assumes no responsibility or liability arising from the use of products described herein, except as expressly agreed to in writing by NetApp. The use or purchase of this product does not convey a license under any patent rights, trademark rights, or any other intellectual property rights of NetApp.

The product described in this manual may be protected by one or more U.S. patents, foreign patents, or pending applications.

RESTRICTED RIGHTS LEGEND: Use, duplication, or disclosure by the government is subject to restrictions as set forth in subparagraph (c)(1)(ii) of the Rights in Technical Data and Computer Software clause at DFARS 252.277-7103 (October 1988) and FAR 52-227-19 (June 1987).

Trademark Information

NETAPP, the NETAPP logo, and the marks listed at http://www.netapp.com/TM are trademarks of NetApp, Inc. Other company and product names may be trademarks of their respective owners.