CORVANE FIELD SERVICES

Field Service Ops Review

Q2 2026 (April - June)

Prepared by Lena Hoffmann (EU Field Team Lead) and Kenji Watanabe (NA Team Lead)
for Rachel Lindqvist, Director of Field Service Operations
Leads meeting, 21 July 2026 | v1.2 (after the 17 July pre-read)

TEAM LEADS ONLY. Contains quarter KPIs before they are shared with customers and staff. Please do not forward or post in team channels.

SUMMARY

Q2 at a glance: both regions below the 80% first-time fix target

First-time fix, NA

74%

Q1: 76%. Target 80%.

First-time fix, EU

66%

Q1: 63%. Target 80%.

Repeat-visit share, NA

11%

Q1: 10%. Corrective WOs only.

Repeat-visit share, EU

17%

Q1: 19% (restated, see p.8).

What moved

- NA first-time fix fell two points. Almost all of the drop is in compressors: VRS-110 units coming back with E-14 after a sensor swap. Pumps and conveyors held at Q1 levels.
- EU first-time fix is up three points on Q1, mainly from the Gdansk van restock in April. It is still 14 points under target.
- The EU repeat-visit share stays the highest we report, and chillers drive it. NK-600 L-03 is the single largest EU repeat driver again.
- In the EU, a third of the first visits that didn't fix the fault needed a certified technician who wasn't on the visit. We have 9 F-gas certified technicians for 31 on chiller work.

Volumes, Q2

Work orders completed: NA 10,412, EU 2,236.
Corrective share: NA 38%, EU 44%.
Median time to attend, P1/P2: NA 5.8 h, EU 7.4 h.
Customer escalations to director level: NA 3, EU 5.

FIRST-TIME FIX

First-time fix by month and why first visits didn't fix the fault

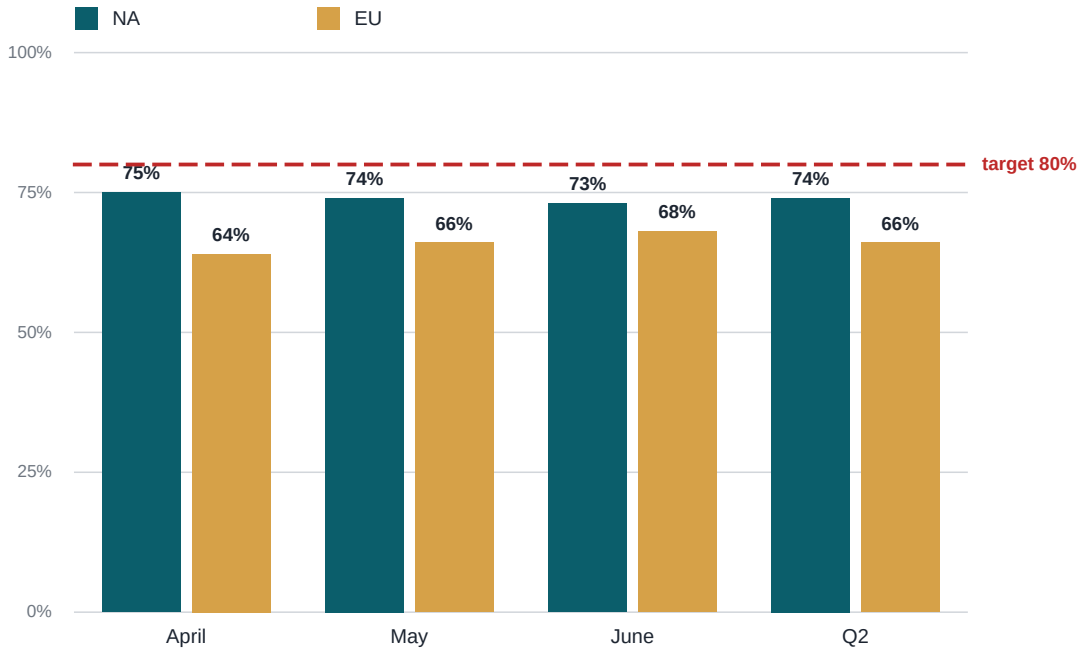

Reason the first visit did not close the work order (share of non-FTF WOs)

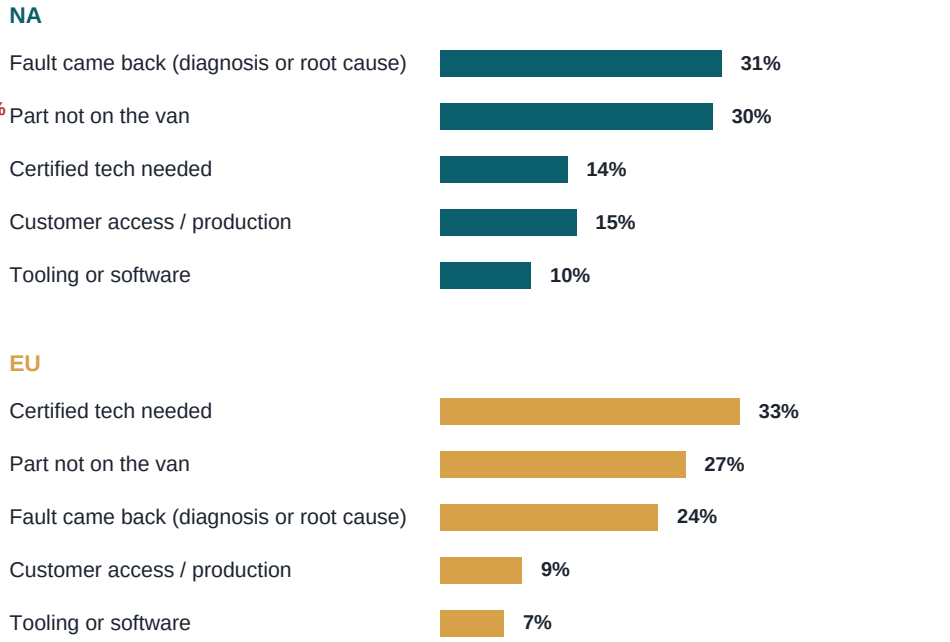

Last four quarters, NA / EU: Q3 2025 77% / 61%, Q4 2025 76% / 62%, Q1 2026 76% / 63%, Q2 2026 74% / 66%. "Tooling or software" in NA is mostly firmware work that couldn't be done because the service cable or laptop wasn't on site.

REPEAT VISITS

Repeat visits: where the second trip comes from

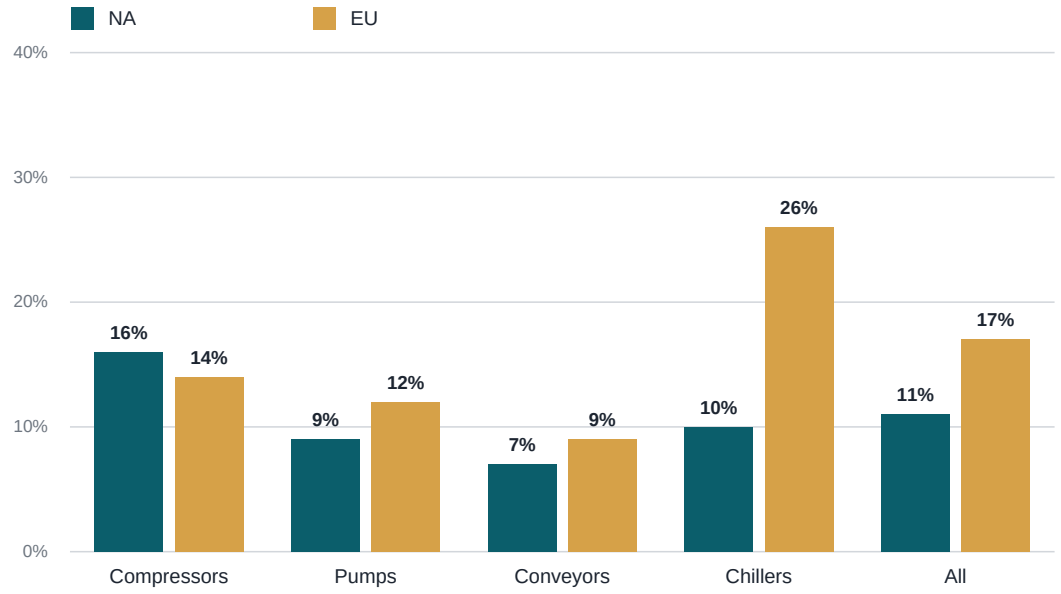

Repeat visit: a corrective work order on the same asset within 30 days of an earlier corrective work order for the same fault code or symptom. Share = repeat visits / all corrective visits in the quarter.

Top repeat drivers, Q2

Region	Model / code	Repeats	Typical pattern
NA	VRS-110 E-14	41	Sensor TS-2 swapped, E-14 back within weeks
NA	HCP-350/500 P-07	23	Strainer cleaned, cause upstream left
NA	BX-12 C-02	12	Tracking after belt change
EU	NK-600 L-03	29	Top-up, alarm back after next idle period
EU	VRS-45 coupling noise	9	Element replaced, room still hot
EU	HCP-500 P-07	7	Strainer, glycol tank debris

From the pre-read discussion

- The NA and EU drivers look different but behave the same way: the first visit treats the symptom (sensor, charge, strainer) and the unit comes back.
- BX-12 C-02 is new this quarter. Most of it is one known issue on belts changed in spring, now fixed at the affected sites.
- We don't count a repeat when the second visit is a different technician under a new case number and the fault code is empty. The real figure is probably higher in the EU.

VRS-110 E-14: we keep replacing the same sensor

- 41 repeat visits in Q2 for E-14 on VRS-110 across NA contracts, 27 different units. In 33 of them the first visit replaced the TS-2 discharge temperature sensor (41-2207) and the unit tripped again within 30 days.
- TS-2 consumption in NA went from 22 in Q1 to 37 in Q2. Van stock ran out twice in Tacoma and once in Sacramento.
- Tacoma is the one most of you have heard about: TAC-C-0142 had its TS-2 replaced in March and tripped E-14 again on 2 July (TS-2 replaced again). The customer has asked twice whether the unit is a lemon.
- Not every E-14 is the sensor. In June three Fresno-area units had real over-temperatures from dirty coolers and hot compressor rooms. Both kinds look the same on the work order today.
- We need to know which firmware each VRS-110 is running and what the Vastra bulletins say about these units before we buy more sensors. We don't record firmware on the work order, and only the fleet register has it.

Asks for this group

1. Firmware level on every VRS-110 with a repeat E-14 since January, by 31 August.
2. Two more service cables for the Pacific NW team. Today we share one between Tacoma and Fresno, and it is usually in the wrong city.
3. Add a firmware field to the compressor work order template.

TS-2 sensors used, NA

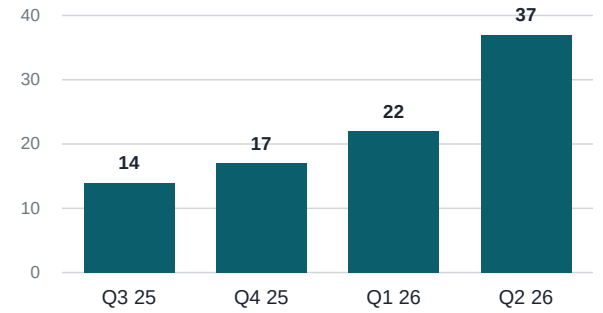

NK-600 L-03 and F-gas coverage

- 29 repeat visits on NK-600 for L-03 in Q2, 11 units. Most second visits follow a weekend or seasonal restart. On the first visit the charge was found low and topped up, a leak was rarely found.
- We still top up under the Kyltek low-suction instruction (KT-WI-14) on EU sites. Corvane SOP-020 says never top up without a leak test. Both documents are live in SharePoint and FS-STD-001 doesn't say which one wins. Technicians are following procedure either way, which is the problem.
- Only certified technicians can open the refrigerant circuit. On the 9 of 31 split, the first visit to a chiller is often a non-certified technician who can read the controller and nothing more. That is a second trip by design.
- Gdansk has no HV-certified technician either. The December E-31 at Baltic Prime was down 27 hours waiting for one.

F-gas certified technicians on EU chiller work

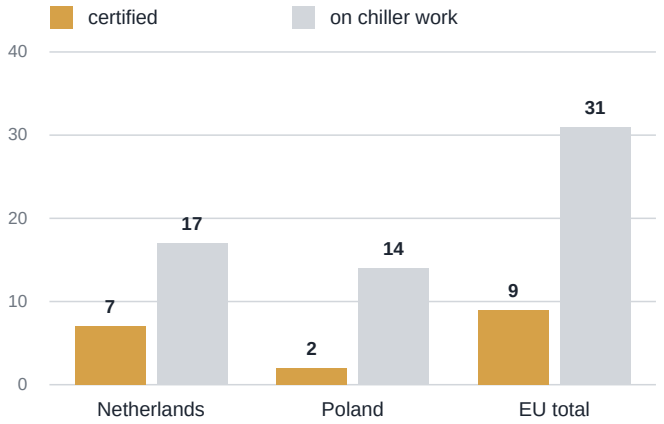

Four exams booked for H2, including one in Gdansk in November. Even if all four pass we are at 13 of 31 by year end.

NK-600 L-03 repeat visits in Q2, by what happened before the alarm

Before the alarm	Repeat visits	Charge added on first visit	Leak found
Restart after weekend or seasonal stop	19	15	2
Running normally	6	3	2
After maintenance on the unit	4	1	0
Total	29	19	4

ACTIONS

Actions agreed in the pre-read (17 July) and open points

#	Action	Owner	Due	Status
1	Close-out quality: Resolution field mandatory and validated in Salesforce. "fixed" / "ok now" no longer accepted.	Rachel Lindqvist	31 Aug 2026	In progress
2	VRS-110 E-14: firmware level and applicable Vastra bulletins checked on every unit with a repeat E-14 since January; updates scheduled with the customers.	Kenji Watanabe	31 Aug 2026	Open
3	Buy two more Vastra service cables (Pacific NW).	Kenji Watanabe	31 Jul 2026	Ordered
4	Add 41-2207 to NA compressor van minimum stock (2 per van).	Kenji Watanabe	-	Done
5	No second top-up on the same NK-600 circuit without a full leak test. Effective now, all EU sites.	Lena Hoffmann	immediate	Communicated 18 Jul
6	Fund four F-gas exams in H2 2026, plan for HV coverage in Poland.	Lena Hoffmann	31 Dec 2026	Open
7	Review legacy KT-WIs against Corvane SOPs (which stay, which are retired).	TBD	not set	Needs an owner
8	Load Servio equipment history into Salesforce asset records so technicians see one history.	Corvane IT (integration)	Q4 2026	Not started
9	Repeat-visit flag at dispatch: show corrective WOs on the asset in the last 30 days.	Rachel Lindqvist / IT	Q4 2026	Scoping

Item 7 came up again in the pre-read discussion. The KT-WIs were translated in 2024 but nobody on the Corvane side owns them, and Sofie de Vries can't retire an instruction she no longer owns. Rachel to propose an owner at the August leads meeting.

APPENDIX

Definitions, data sources and caveats

- First-time fix (FTF): corrective work order closed on the first visit, with no follow-up corrective work order on the same asset within 30 days. PMs, inspections and installs are excluded.
- Repeat visit: corrective work order on the same asset within 30 days of an earlier corrective work order for the same fault code or symptom. Symptom matching is manual where the fault code is empty (about 1 in 5 EU work orders).
- Scope: all NA and EU service contracts, not only the key accounts. Figures are by region of the technician, not of the customer.
- Sources: Salesforce Field Service work orders and cases (both regions, extracted 6 July). Run hours from MaintPro (NA). EU equipment history from the Servio monthly export, which still has its own work order numbers. About 4% of EU Salesforce work orders could not be matched to a Servio record and are counted from Salesforce alone.
- EU Q1 repeat share restated from 21% to 19% after duplicate Servio rows were removed. Q1 FTF unchanged.
- 7% of EU corrective work orders in Q2 were closed without a resolution code and are excluded from the reason breakdown on page 3. NA: 3%.
- Certification counts from the Technician Certification Matrix, 30 June 2026.

Questions on the numbers: Lena Hoffmann (EU) or Kenji Watanabe (NA). Next review: Q3 2026, October leads meeting.