



Customer

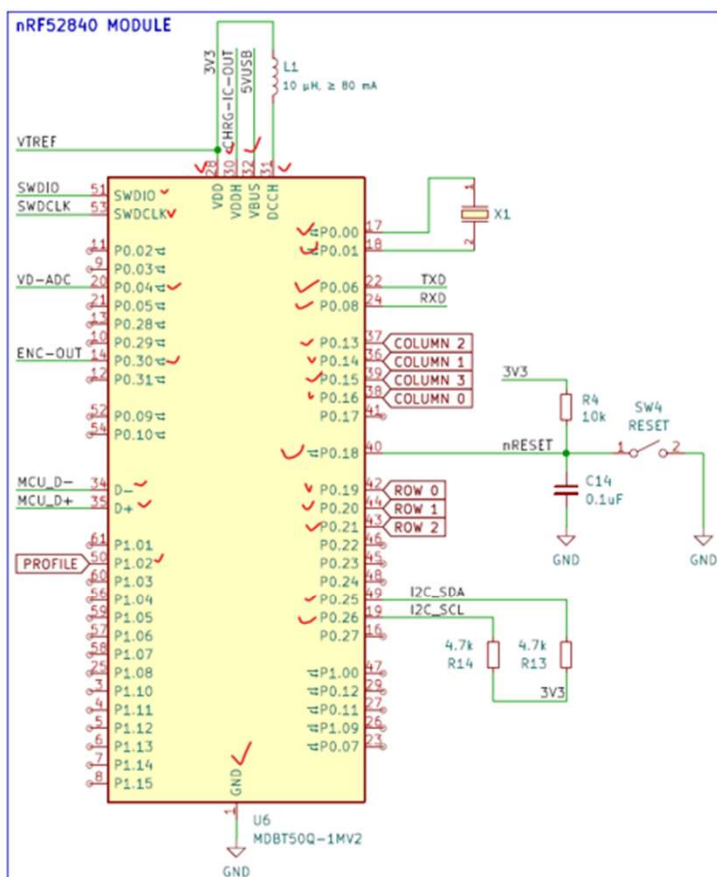



Raytac

1. Please make sure that the other ground pins of the module are solidly connected to the PCBA ground.

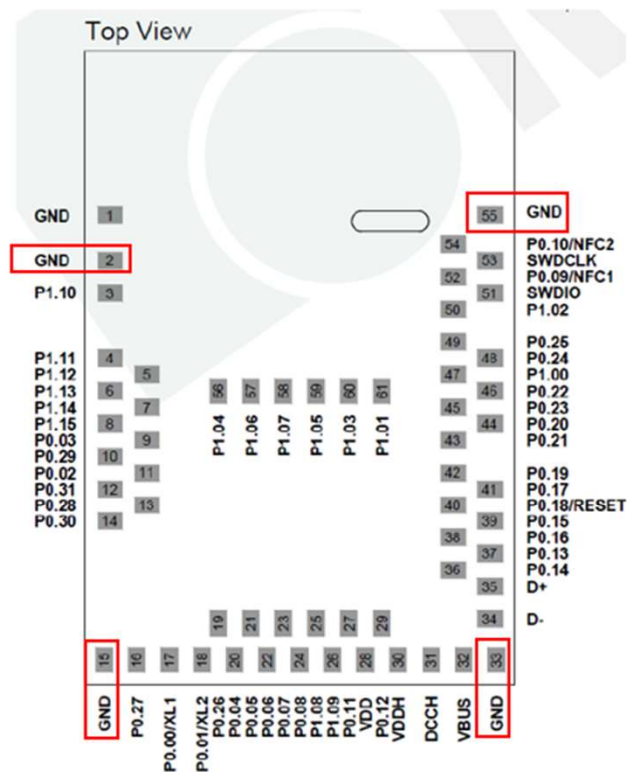




Raytac: If the antenna clearance cannot follow the recommended layout, the antenna radiated performance should be verified with the final product or housing to ensure it meets the required performance.

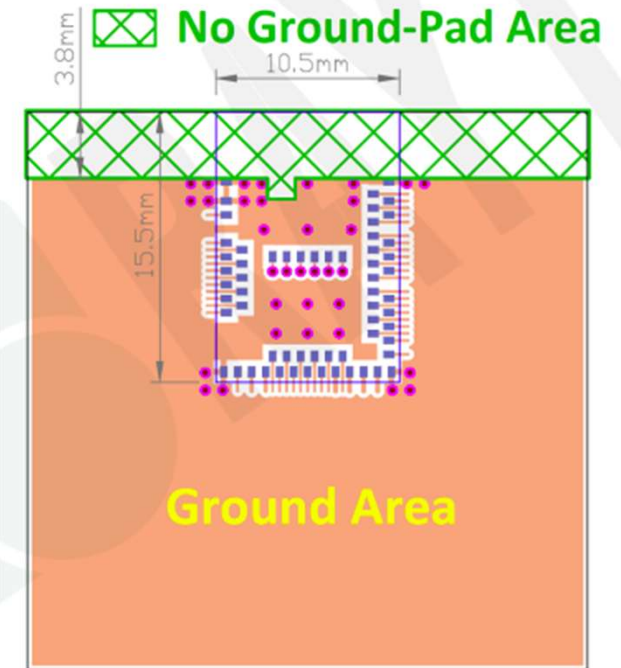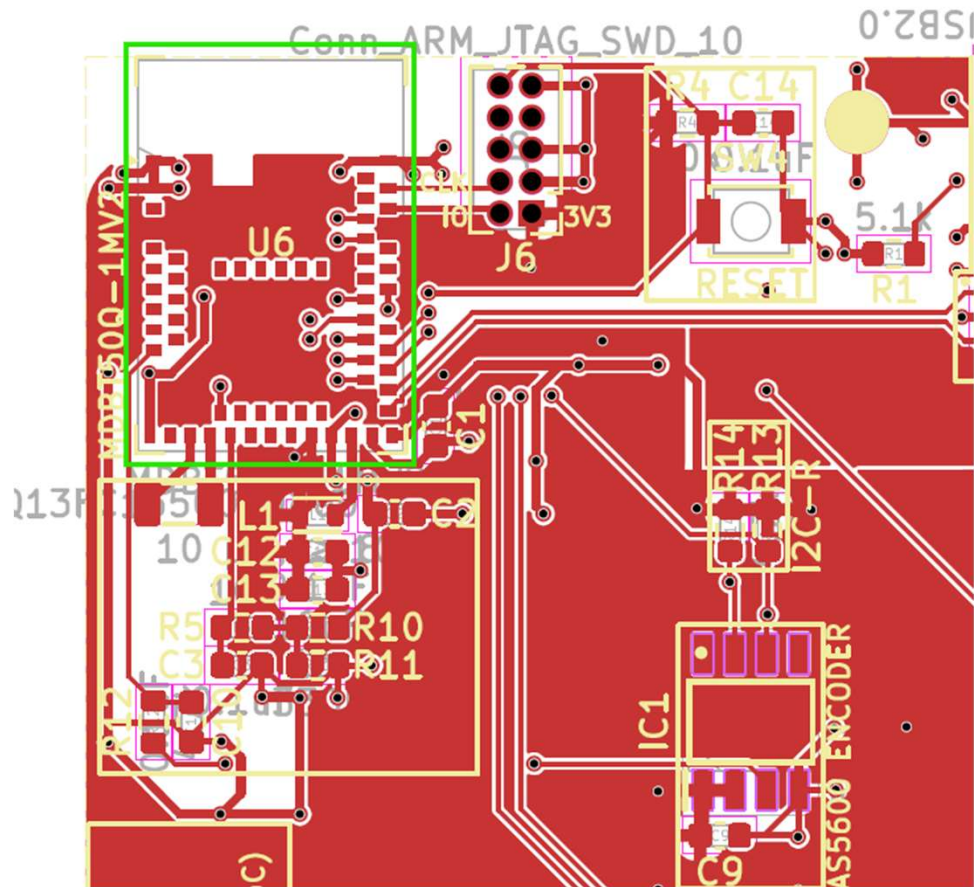


Top View



Raytac: Please add more ground vias according to the RF layout recommendations.(see Chapter 2.3 of the datasheet)

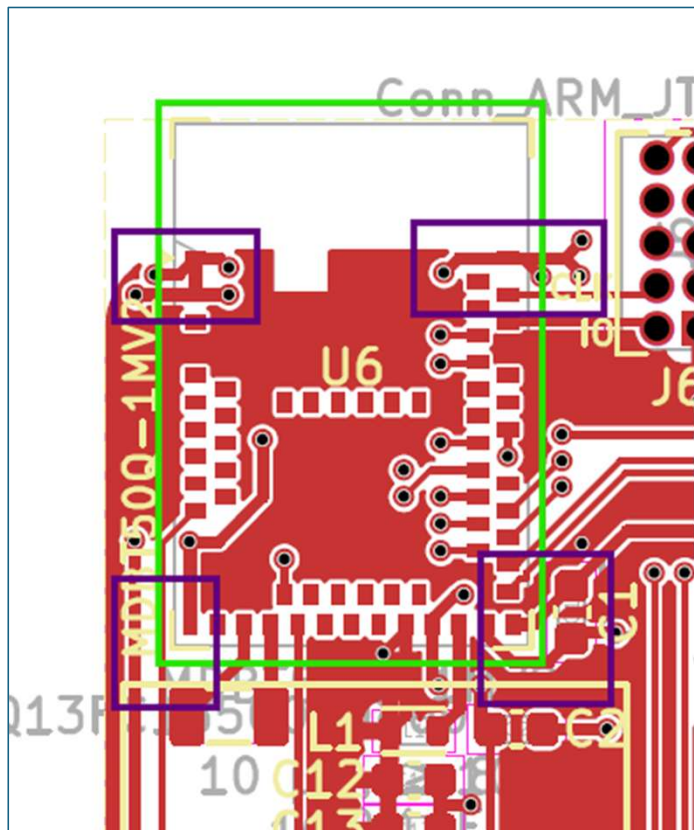

Please add via holes in GROUND area as many as possible, especially around the four corners.

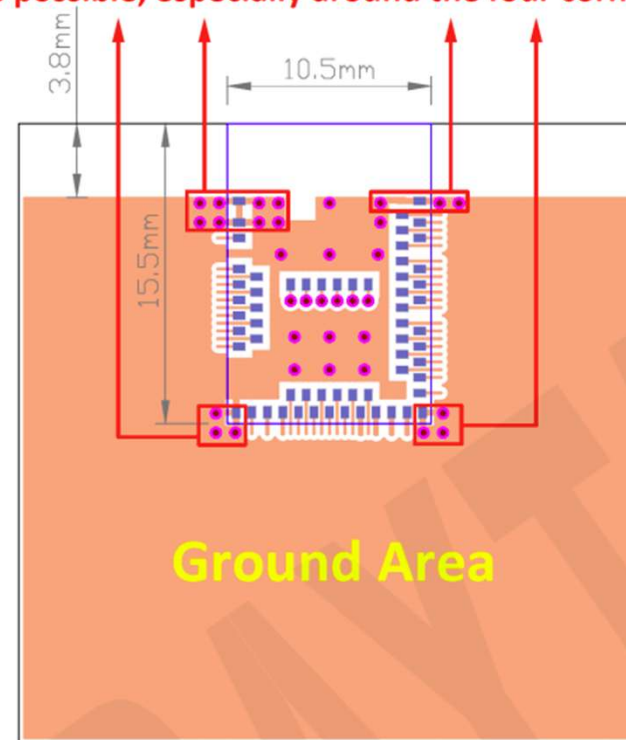

Top View



Raytac:

1. Please check which function the red plane on the BOT layer belongs to - power or ground? It is not recommended to fill the entire power plane due to EMI and ESD concerns. However, If it is a ground plane, the module's ground pins should be connected to the it.
2. The PCB ground planes on the top and bottom layers should be solidly connected through ground vias. It is also recommended to place a ground guard with vias along the outermost edge of the board to enhance ESD protection.

