


- Rotate the end effector again and move the tooltip to the fixed point. Select the third table row, and then click **Teach** to save the current position to the row.

4

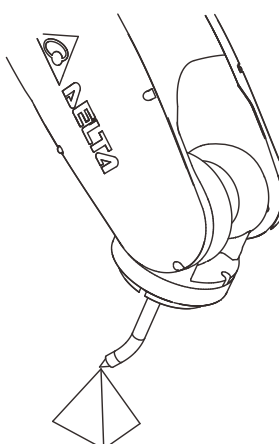

Tool size calculation

ID : 5

Input : Enter data of each axis and Height by teach, and then calculate.

X (mm)	Y (mm)	Z (mm)	Error	Select
406.758	244.932	-66.656	0	☐
527.156	119.999	-66.657	0	☐
408.191	21.006	-66.657	0	☒
0	0	0	0	☐
0	0	0	0	☐
0	0	0	0	☐
0	0	0	0	☐
0	0	0	0	☐

Output :

Height (mm):

Width (mm):

Angle (degree):

Buttons: Back, Save, Teach, Clear, Calculate, Set

- After teaching at least three points with different postures, select the check boxes in the Select column for the points to be calculated, and then click **Calculate**.

Tool size calculation

ID : 5

Input : Enter data of each axis and Height by teach, and then calculate.

X (mm)	Y (mm)	Z (mm)	Error	Select
423.318	244.237	-66.658	1.353	☒
528.176	119.872	-72.487	1.873	☒
376.553	27.968	-73.97	1.242	☒
0	0	0	0	☐
0	0	0	0	☐
0	0	0	0	☐
0	0	0	0	☐

Output :

Height (mm): 123.405

Width (mm): -117.149

Angle (degree): 6.403

Buttons: Back, Save, Calculate, Set

DRASstudio Calculate Done. Check

- After calculation, the Output area in the bottom shows the new tool size.

Output :

Height (mm): 123.405

Width (mm): -117.149

Angle (degree): 6.403