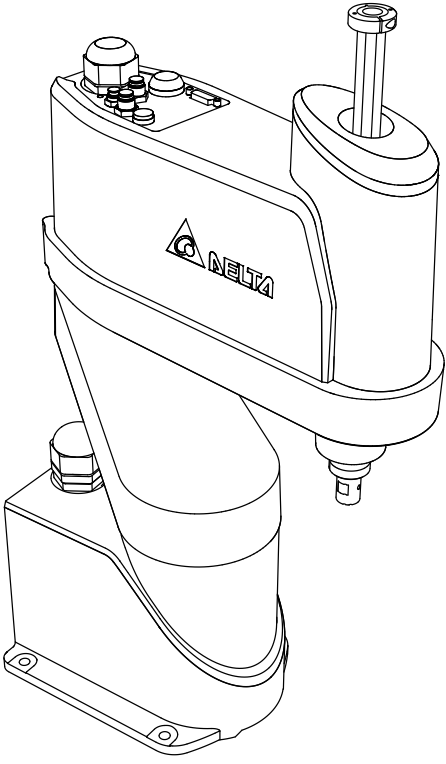
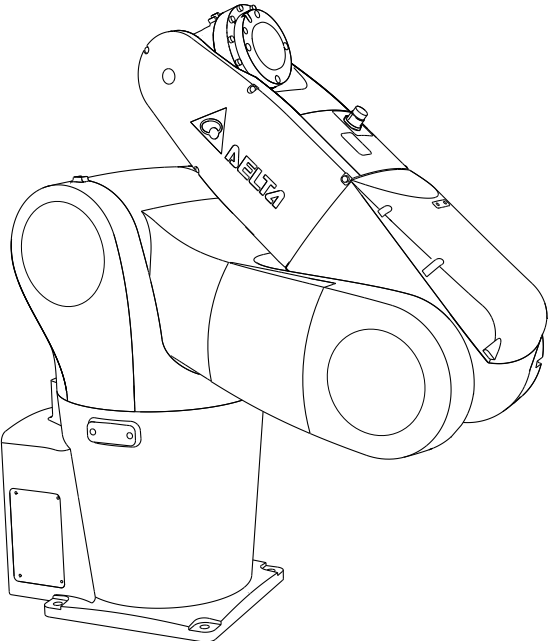


7.3.2 Hardware limit posture

There are multiple hardware limit postures which vary based on the applications; the postures must be stable and can be recreated. The following are the default postures of the 4-axis SCARA robots and the 6-axis VA robots.

Default hardware limit posture of 4-axis SCARA robots	Default hardware limit posture of 6-axis VA robots
	
J1 axis is at the positive limit position; J2 axis is at the negative limit position; and J3 axis is at the positive limit position.	J1 axis is at the positive limit position; J2 axis is at the negative limit position; J3 axis is at the positive limit position; and J5 axis is at the negative limit position.