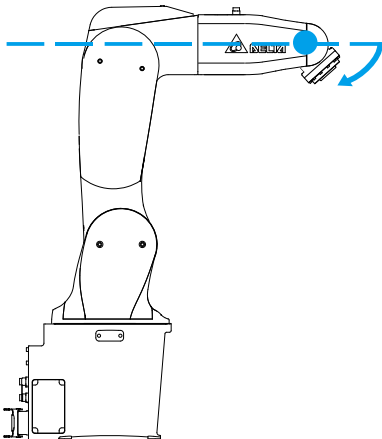
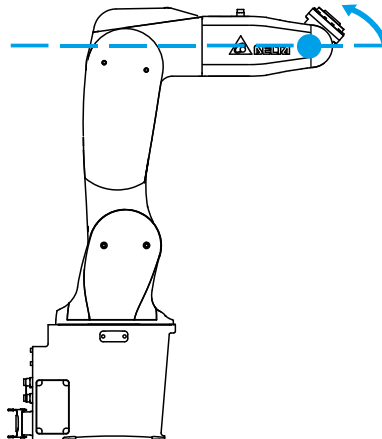
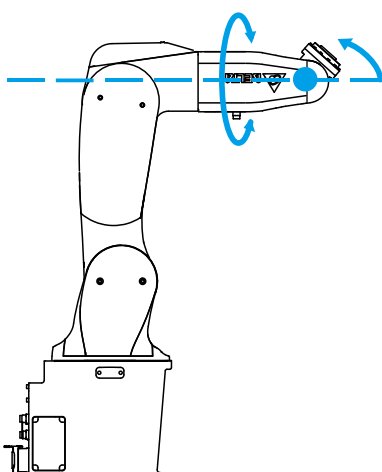


2

- F indicates the wrist condition of the robot. There are two conditions.
Determined based on the angle of J5 (the blue dots in the following figures). After the robot returns to the origin with J5 at the degree of greater than 0°, it is in the no-flip condition (F: 0); when J5 is at the degree of smaller than 0°, the robot is in the flip condition (F: 1).

Wrist no-flip, F: 0 J4 axis is at 0° 	Wrist flip, F: 1 J4 axis is at 0° 
Wrist no-flip, F: 0 J4 axis rotates more than ±180° 	Wrist flip, F: 1 J4 axis rotates more than ±180° 