





- At all stairs: suggest adding painted 1x6 trim to 'hide' misalignment of drywall and CMU.



- Fill in with drywall to make less chunky and hodgepodge.




- Inspector might flag this. Codewise, this dimension has to be at least 7'-6".

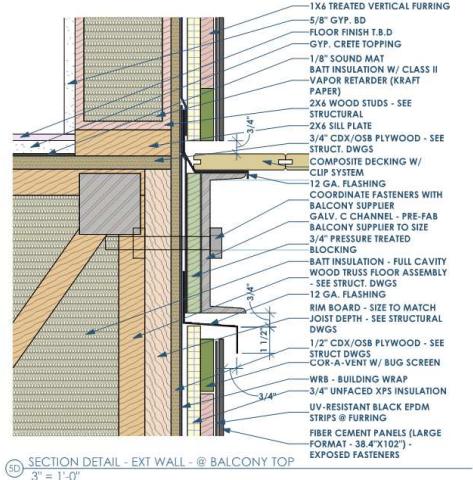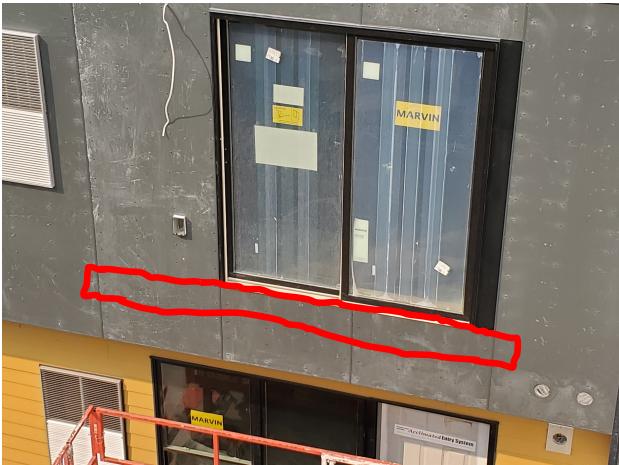



- Concerned that if the ledger of the balcony is lagged tightly against the fiber cement, that the fiber cement will crack. Recommend providing a detail like 5D/A501 to assure horizontal loads from the balcony bypass the fiber cement and rigid insulation.





Recommend centering the light fixture on the vanity and mirror. Occurs in multiple rooms.

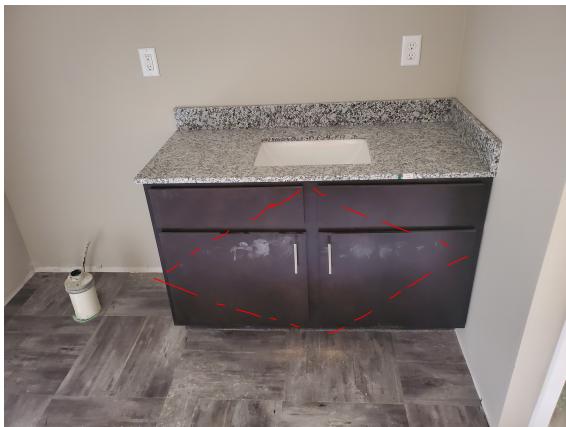

- In Room 208 (a Type A unit), the cabinets below both the kitchen sink and vanity sink need to be removeable per detail 6D and 5D/A480
- The kitchen in room 208 needs a work area with a min. clearances as outlined in 6D and 5D/A480

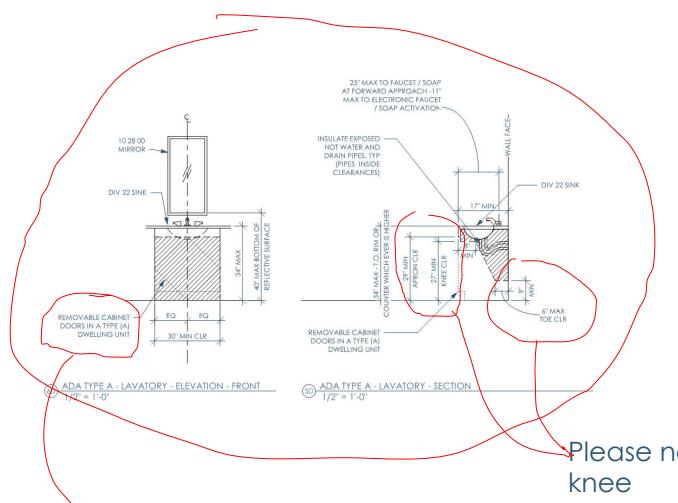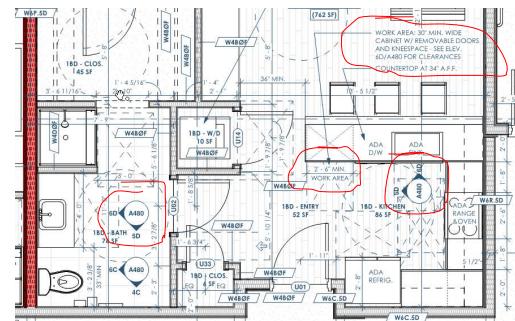

Please note  
knee  
clearances

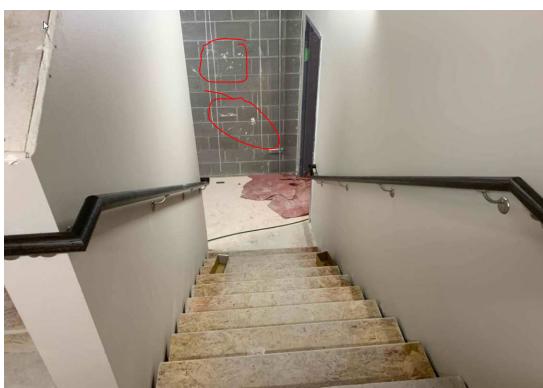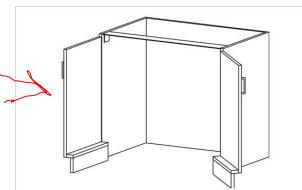

- Clean all paint/drywall from exposed CMU at all stairs and elevator