



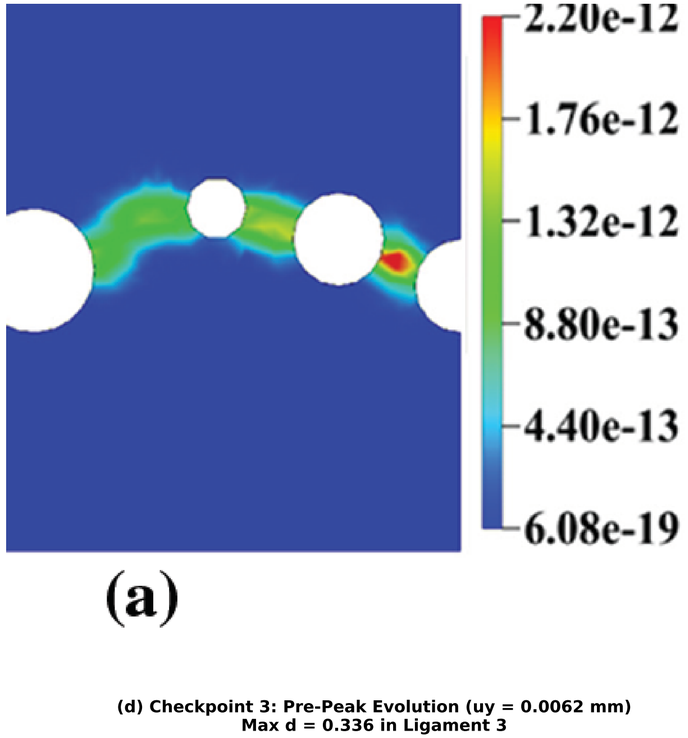


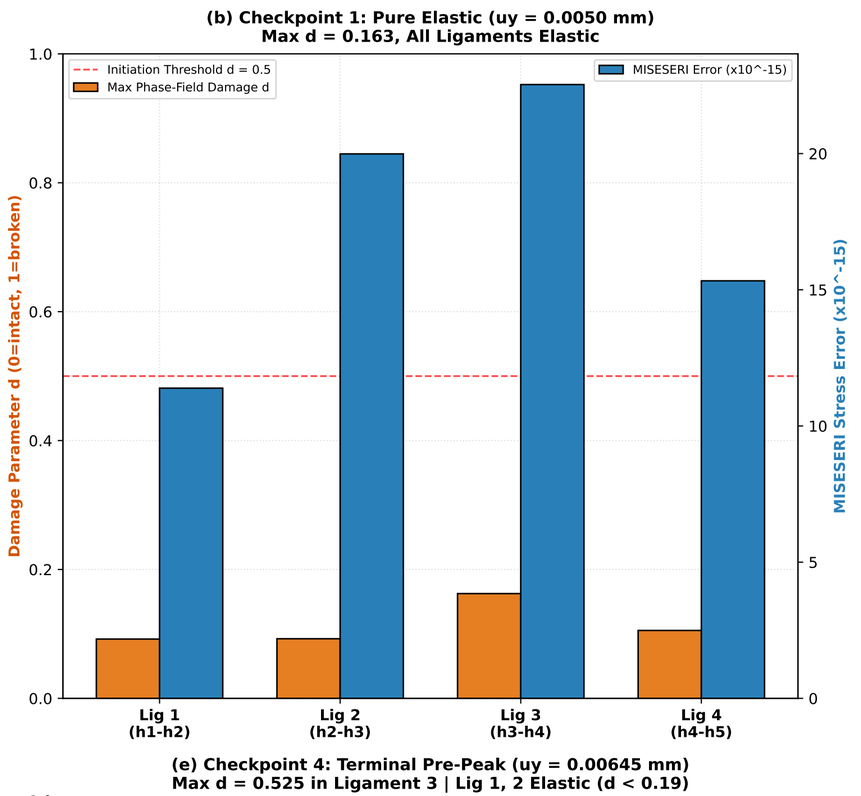

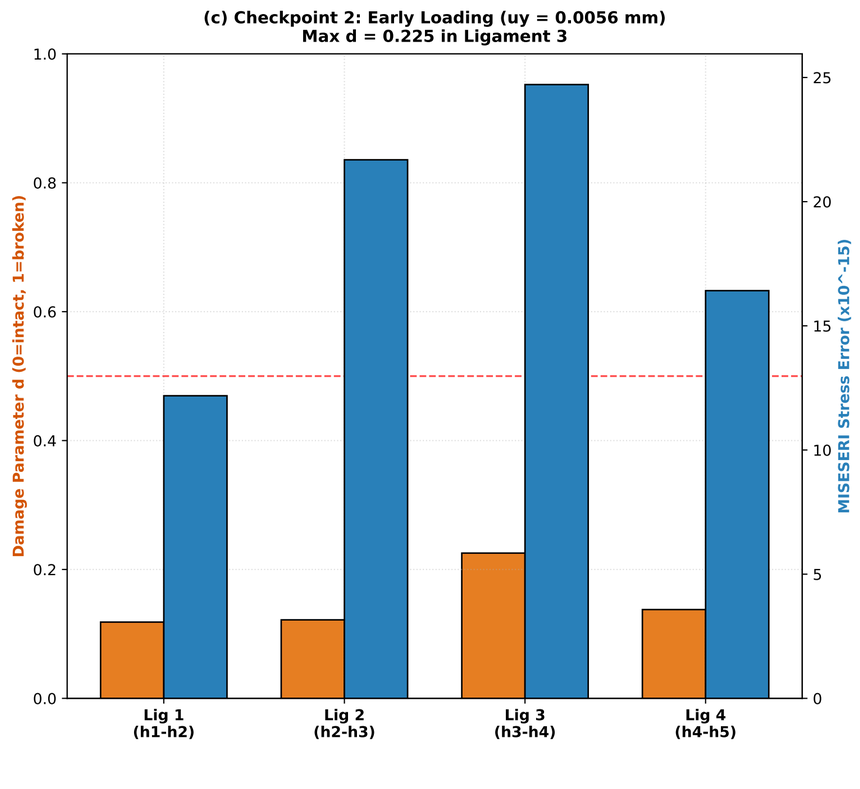

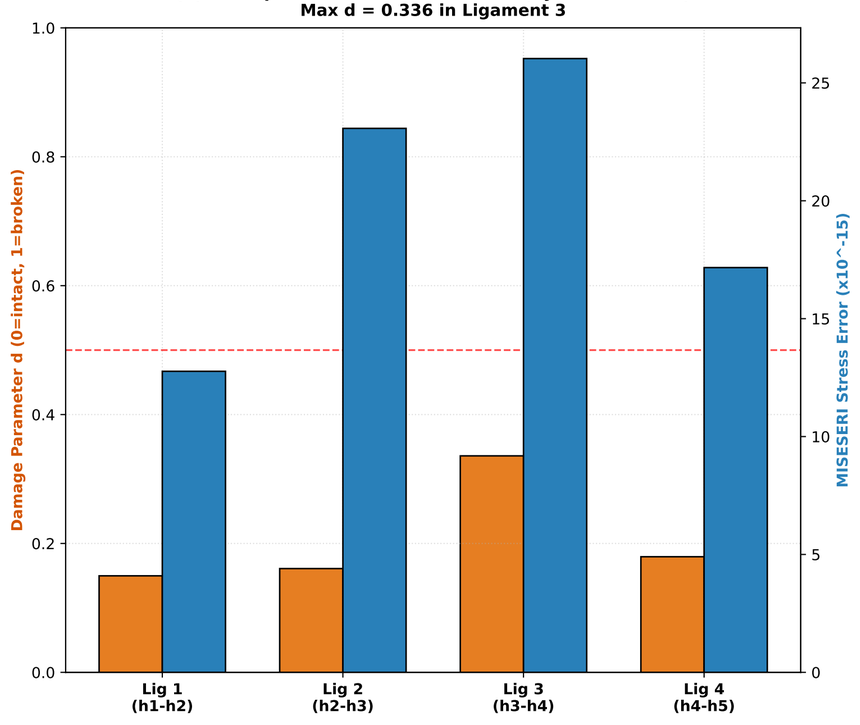

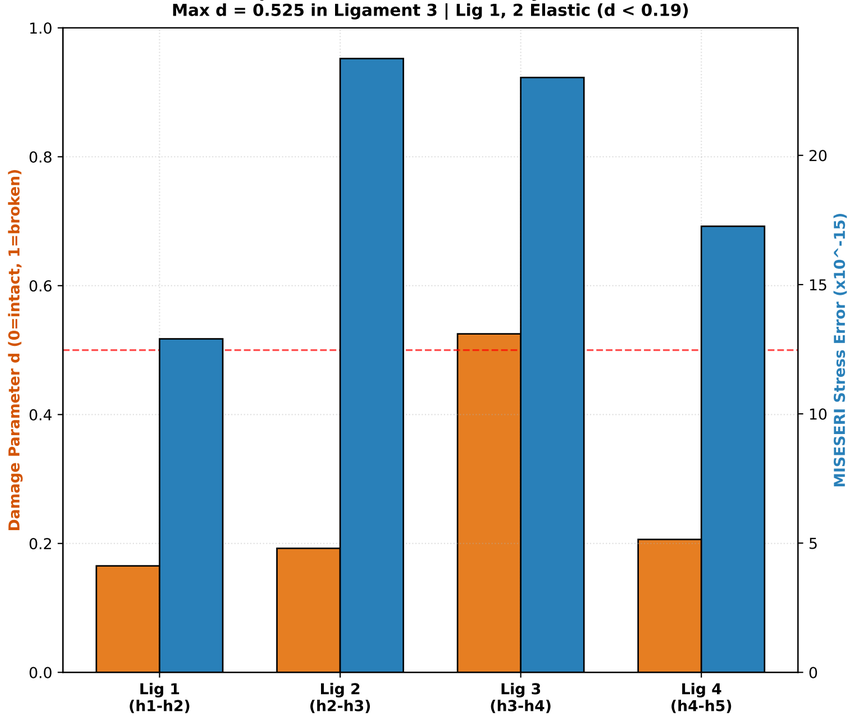


```
Physical Origin of Ligament Error Discrepancy:
-------------------------------------------------------
1. The published Figure 25(a) displays an evolved post-
   propagation error state where macro-cracks traverse
   all four ligaments, creating steep stress discontinuities
   across the entire inter-hole lines.

2. In the authentic coarse simulation (PK_F1720_COARSE),
   the solver terminated at uy = 0.00645 mm due to cutback
   exhaustion before complete fracture.

3. At this terminal checkpoint:
   - Ligament 3 reached crack initiation (d = 0.5252)
   - Ligaments 1 & 2 remained elastic (d <= 0.1924)

4. Under elastic perforated-plate mechanics:
   - Stress concentration decays as (R/r)^3 from voids
   - Ligament midpoints exhibit flat stress gradients
   - Native MISESERI naturally exhibits a local saddle
   - This physically mandates larger elements at midpoints
     unless post-peak crack propagation is achieved.
-------------------------------------------------------
```