

2016.0 RANGE ROVER (LG), 501-12

INSTRUMENT PANEL AND CONSOLE - LONG WHEEL BASE

REAR FLOOR CONSOLE - AUTOBIOGRAPHY BLACK

[G1716296]

REMOVAL AND INSTALLATION


REMOVAL

NOTES:

- Some variation in the illustrations may occur, but the essential information is always correct.
- Removal steps in this procedure may contain installation details.
- Low strength loctite must be used during the installation steps.

1. Refer to: Rear Floor Console Table (501-12A, Removal and Installation).
2. Refer to: Rear Floor Console Upper Trim (501-12B, Removal and Installation).
3. Refer to: Rear Floor Console Table Motor Assembly (501-12A, Removal and Installation).


4.

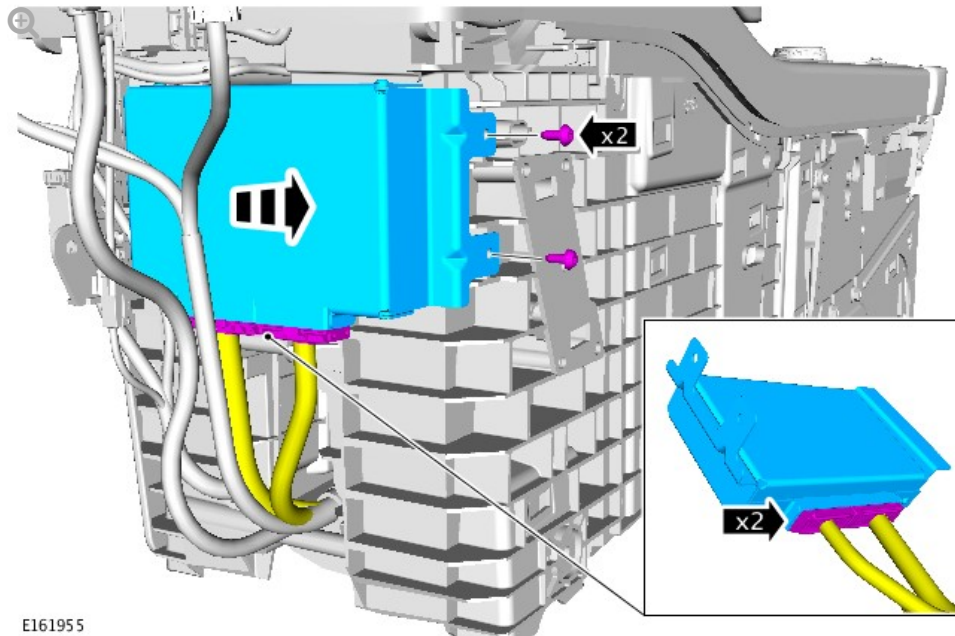

E161955


Torque: 2.2 Nm

5.

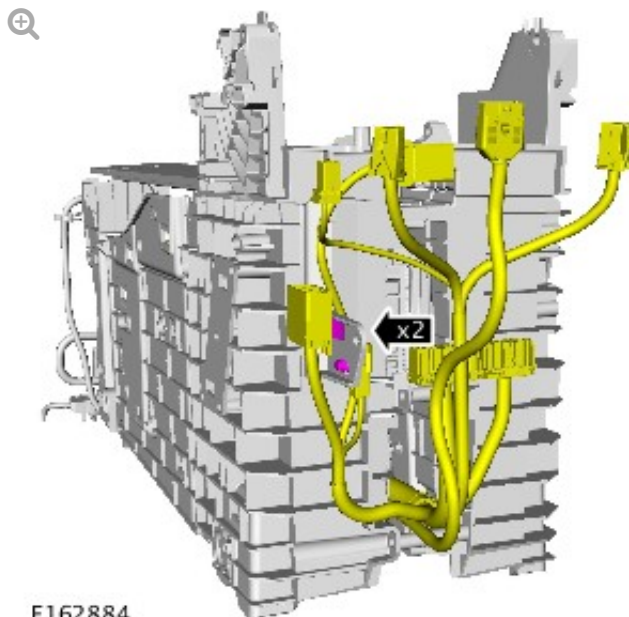


E162884

6.

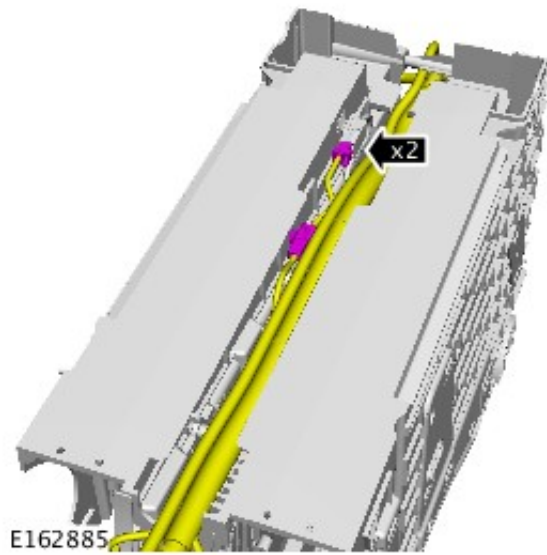


7.

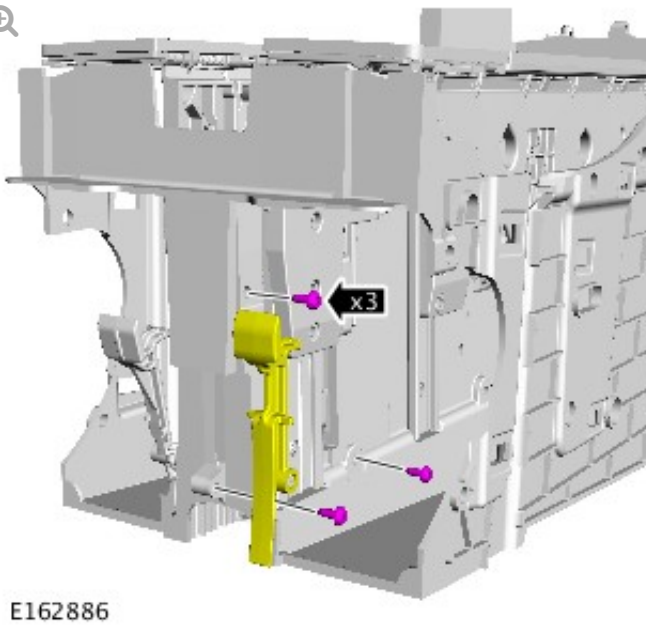

Torque: 2.2 Nm


8.

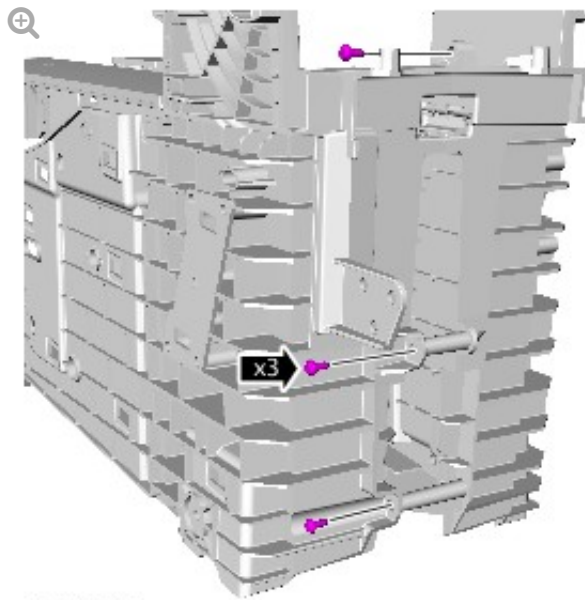

E162887

Torque: 2.2 Nm

9.

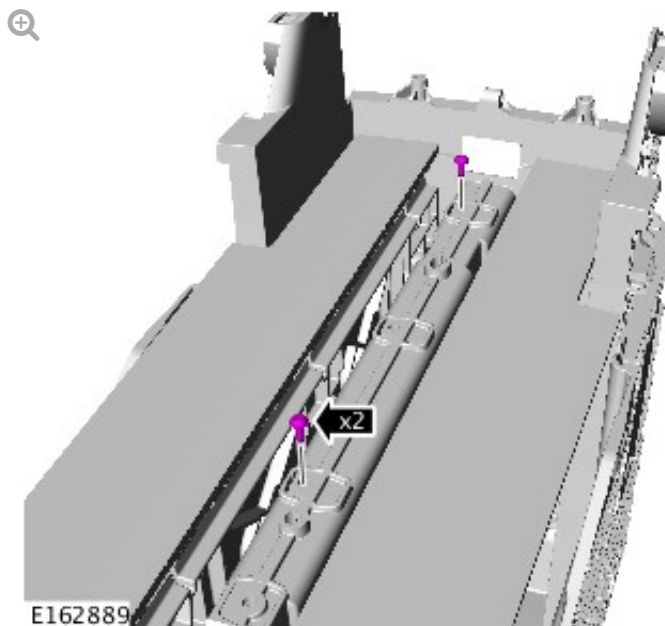

E162889

Torque: 2.2 Nm

10.



Repeat procedure for the other side.

Torque: 2.2 Nm

11.




Torque: 2 Nm


12.

NOTES:


- Right hand shown, left hand similar.
- Do not disassemble further if the component is removed for access only.

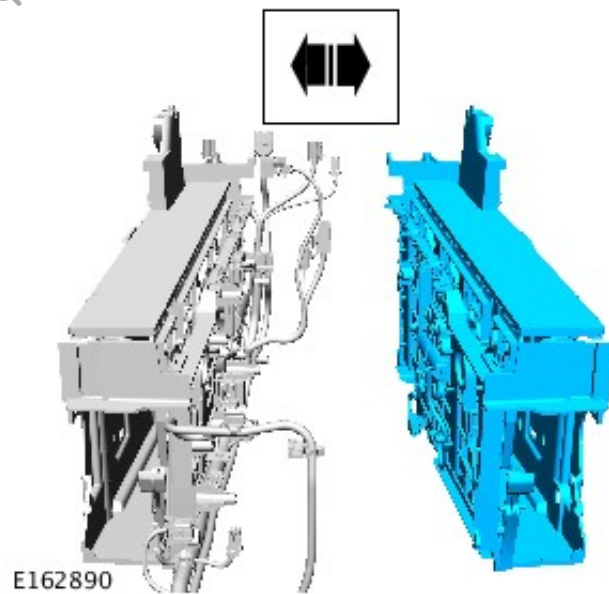

13.

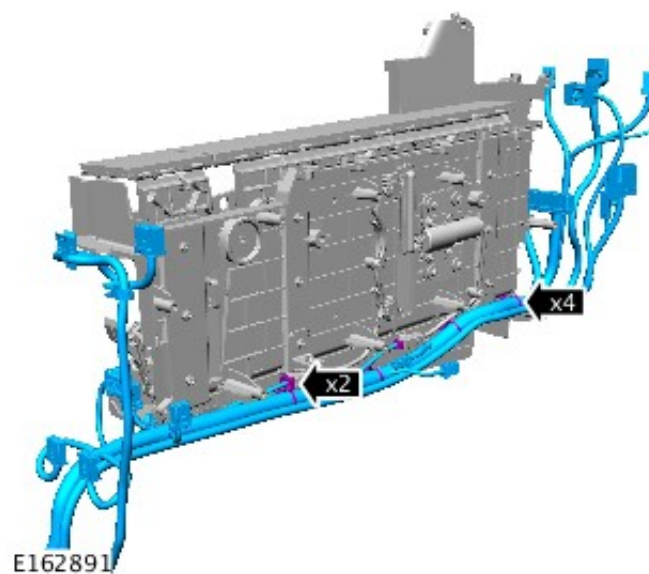


14.

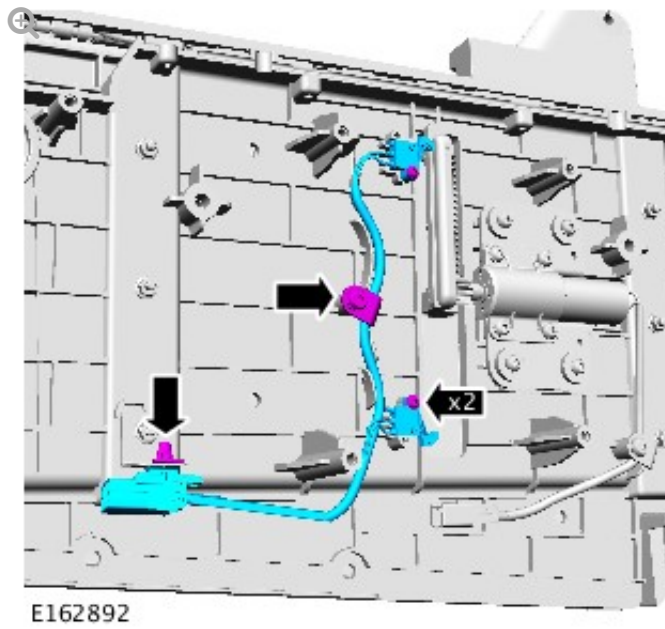


Torque: 1 Nm

15.

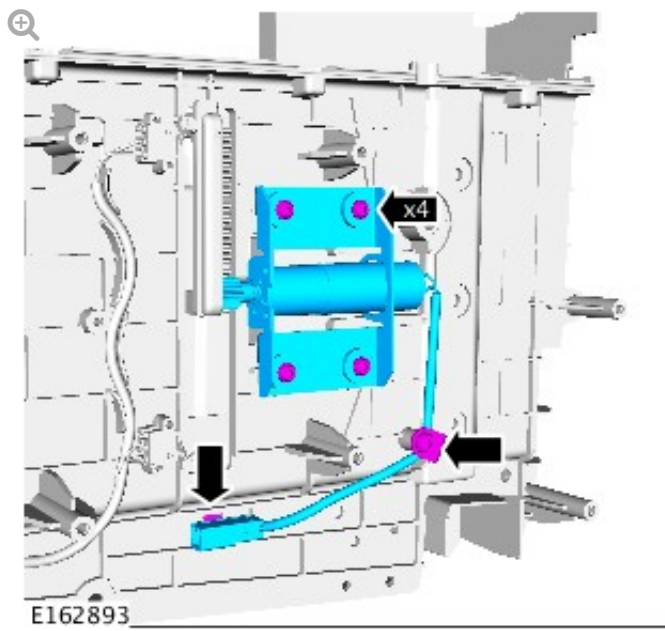


Torque: 1 Nm

16.

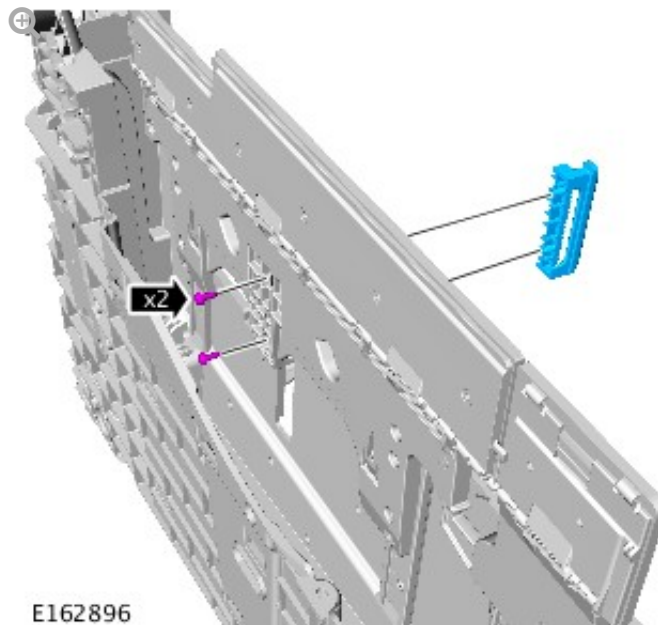


Torque: 1 Nm

17.

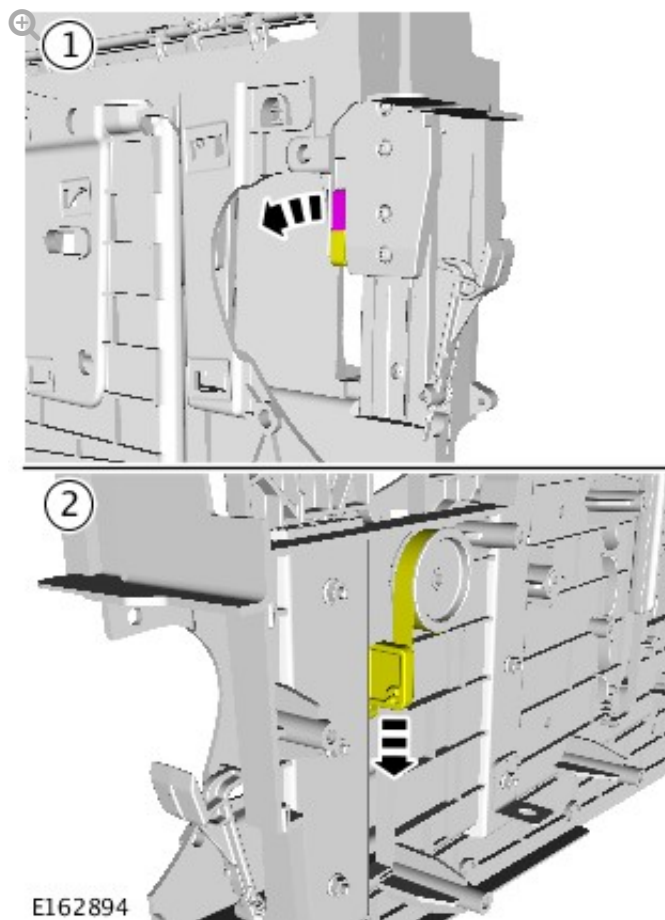


18.

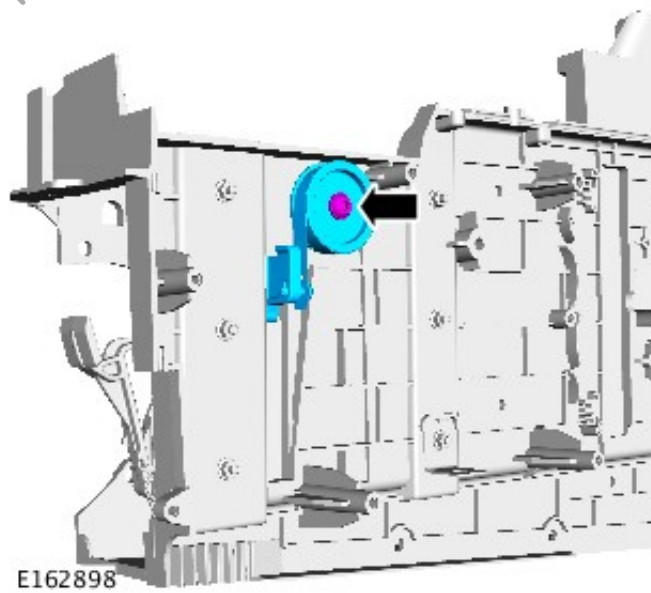


Torque: 2.2 Nm

19.

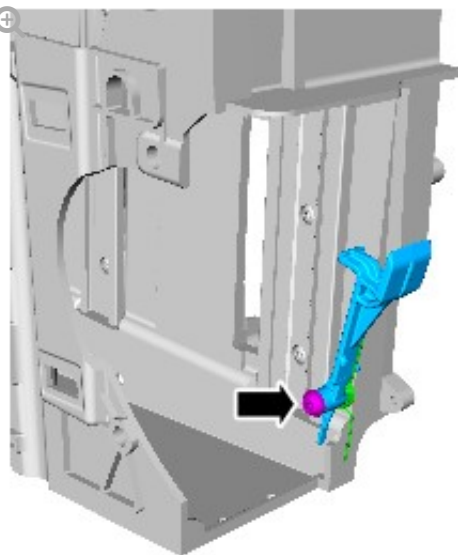


Torque: 2.2 Nm

20.

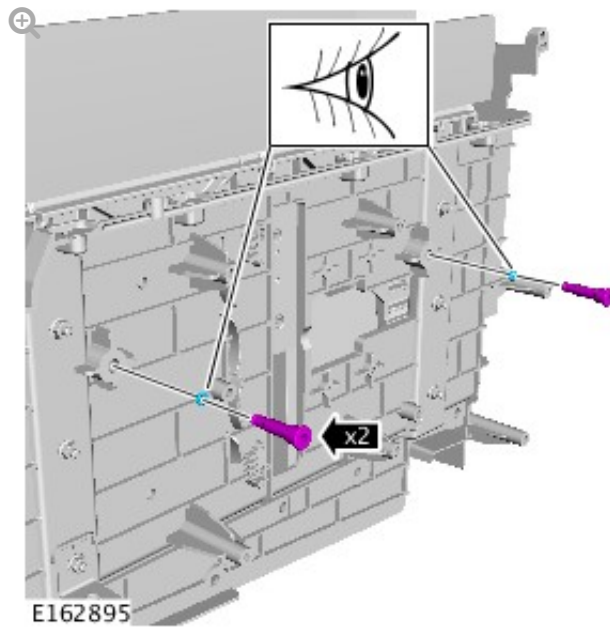


Torque: 2.2 Nm

21.

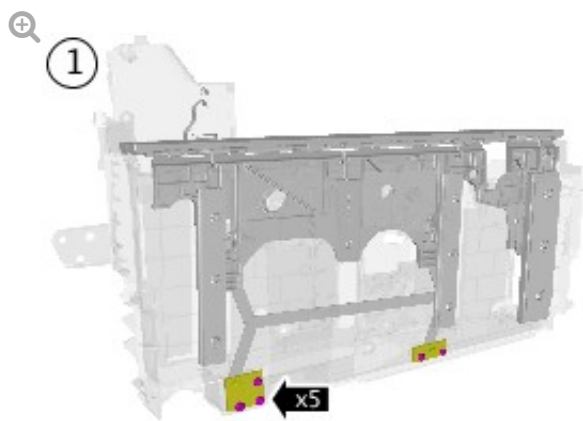


②

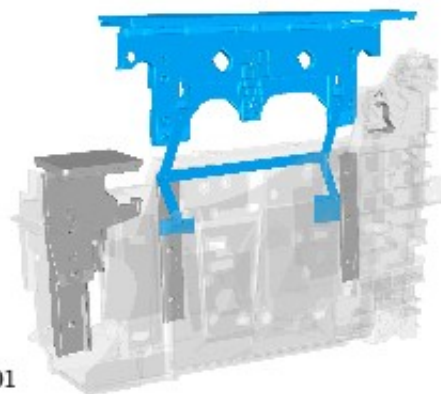

Repeat procedure for the other side.

Torque: 1 Nm

22.

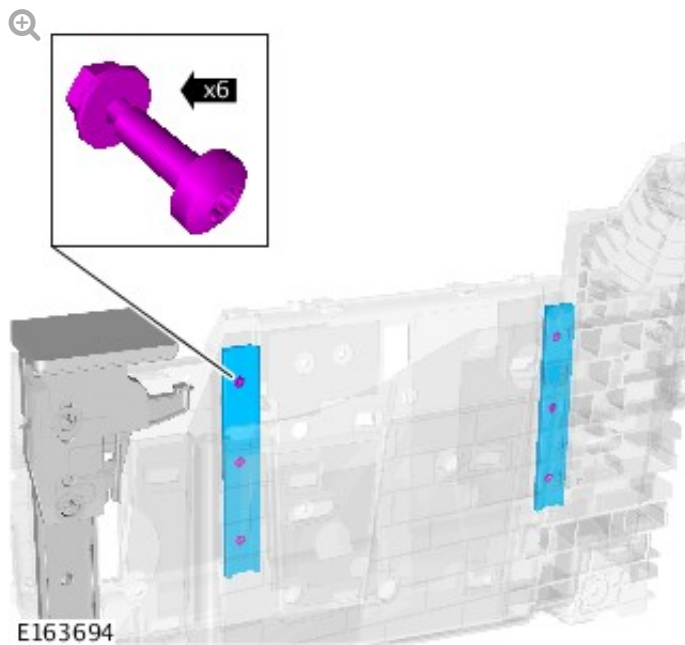

Repeat procedure for the other side.

Torque: 2.2 Nm

23.

WARNING:

Make sure the slider is not separated from the track to prevent the bearings falling out.




Repeat procedure for the other side.

Torque: 2.2 Nm

24.

WARNING:

Make sure the slider is not separated from the track to prevent the bearings falling out.

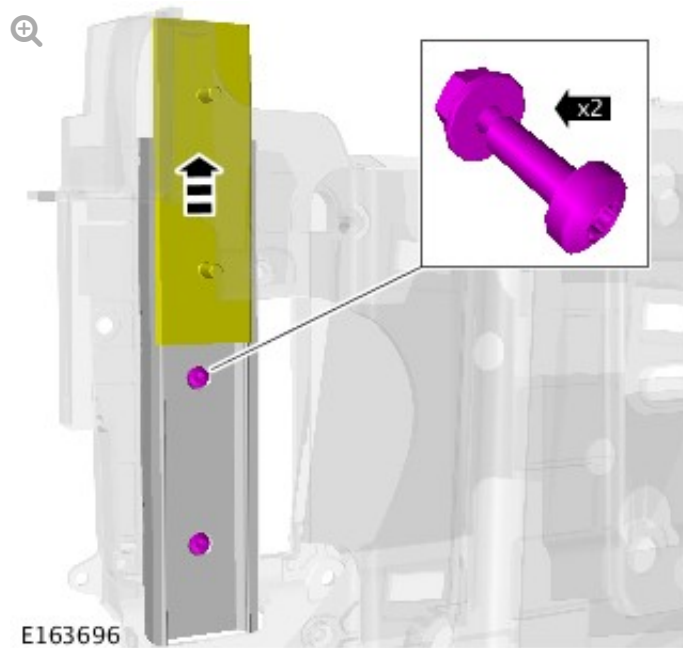


Repeat procedure for the other side.

Torque: 2.2 Nm

25.

WARNING:

Make sure the slider is not separated from the track to prevent the bearings falling out.

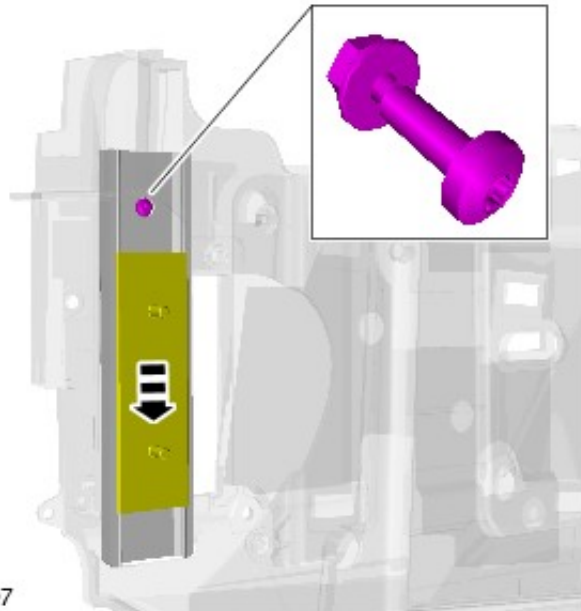

E163697


Repeat procedure for the other side.

Torque: 2.2 Nm

26.

WARNING:

Make sure the slider is not separated from the track to prevent the bearings falling out.

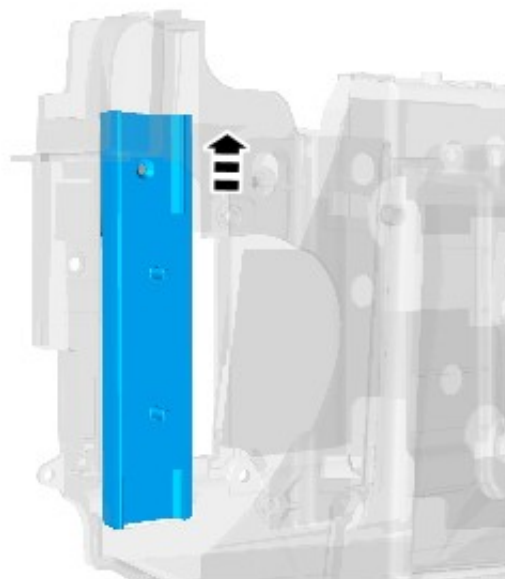

E163698

Repeat procedure for the other side.

INSTALLATION

1.

NOTE:

Install the trim retaining clips in the moulding prior to installing the components.



E149095

2. To install, reverse the removal procedure.