

2016.0 RANGE ROVER (LG), 501-05

INTERIOR TRIM AND ORNAMENTATION

SUN VISOR (G1531976)

REMOVAL AND INSTALLATION

REMOVAL


CAUTION:

Take extra care not to damage the edges of the component.


NOTES:

- Removal steps in this procedure may contain installation details.
- LH illustration shown, RH is similar.

1.

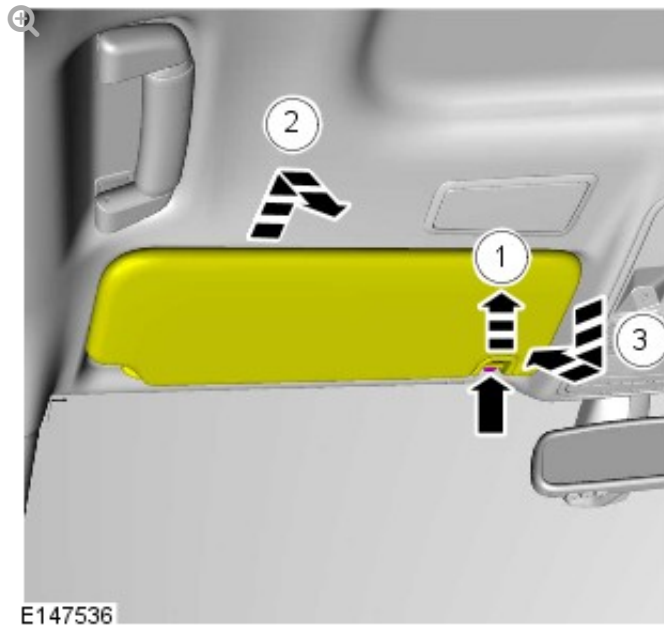



2.

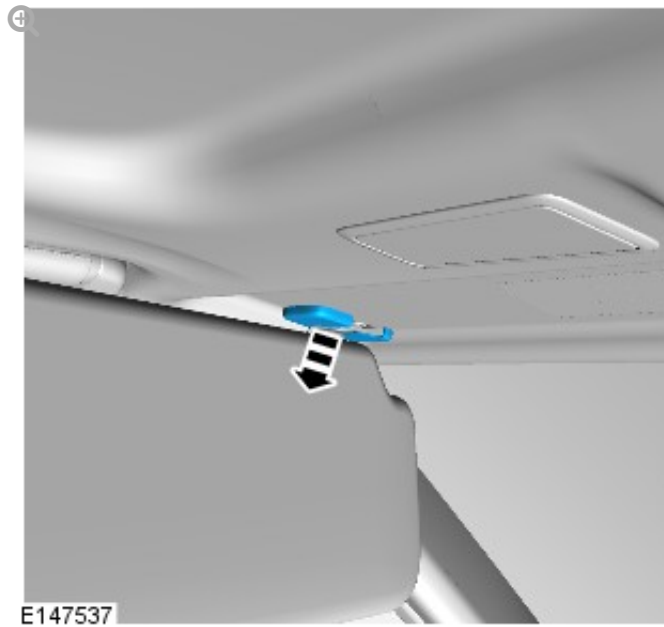

3.

CAUTION:

Make sure the wiring harness and electrical connectors are not damaged during this operation.

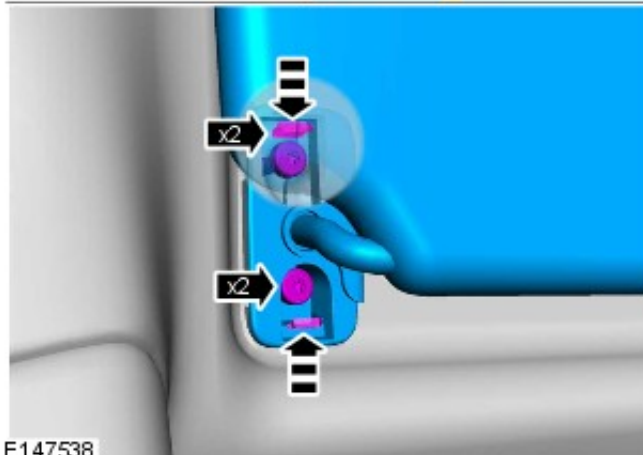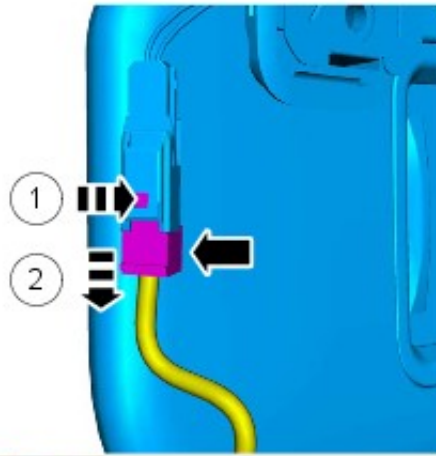

E147538

Torque: 6 Nm

INSTALLATION

1. To install reverse the removal procedure.