

2016.0 RANGE ROVER (LG), 303-14

ELECTRONIC ENGINE CONTROLS - TDV6 3.0L DIESEL

CRANKSHAFT POSITION SENSOR (G1509552)

REMOVAL AND INSTALLATION

18.30.12	SENSOR - CRANKSHAFT POSITION (CKP) - RENEW	3000 CC, TDV6	1.8	USED WITHINS	+
----------	--	------------------	-----	-----------------	---

PART(S)

STEP	REPLACE PART / RENEW PART	PART NAME
Removal Step 6	Renew Part	Turbocharger oil return pipe to turbocharger gasket

REMOVAL

NOTE:

Removal steps in this procedure may contain installation details.

1. Refer to: [Engine Cover - TDV6 3.0L Diesel](#) (501-05 Interior Trim and Ornamentation, Removal and Installation).

2.

WARNING:

Make sure to support the vehicle with axle stands.


Raise and support the vehicle.

3. Remove the left-hand front wheel and tire.

Refer to: [Wheel and Tire - GTDi 2.0L Petrol/TDV6 3.0L Diesel /TDV8 4.4L Diesel/V6 S/C 3.0L Petrol /V8 N/A 5.0L Petrol/V8 S/C 5.0L Petrol](#) (204-04 Wheels and Tires, Removal and Installation).

4. Refer to: [Engine Undershield](#) (501-02 Front End Body Panels, Removal and Installation).


5.

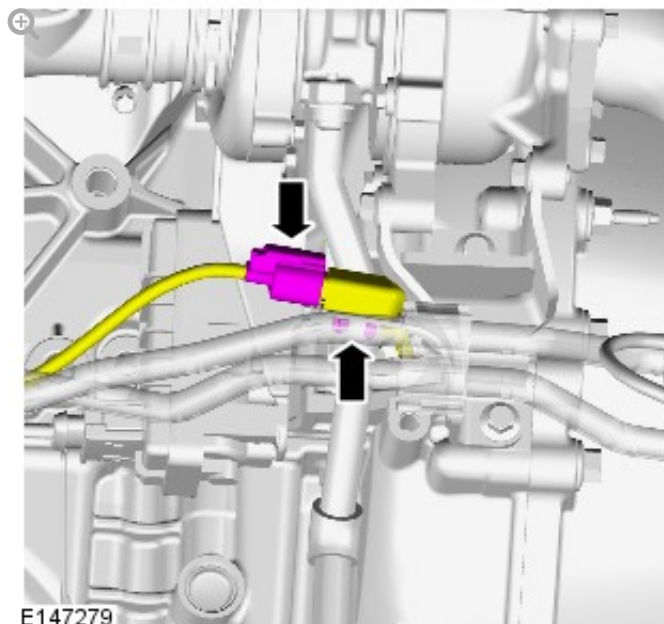

6.

NOTE:

Remove and discard the gasket.

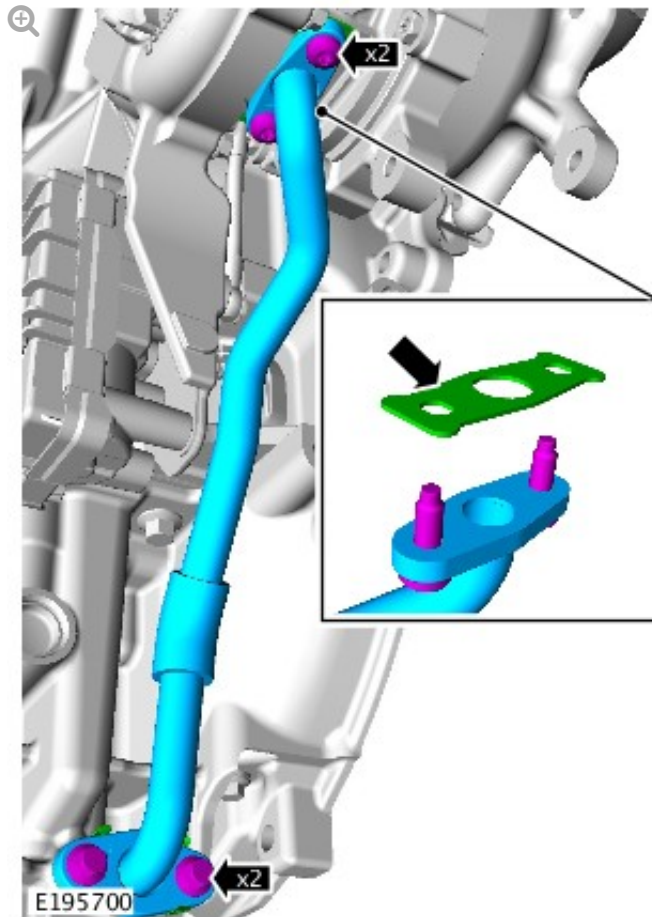


Renew Part: *Turbocharger oil return pipe to turbocharger gasket.*

Torque: 10 Nm

7.


NOTE:

Make sure to clean the threads prior to installation.

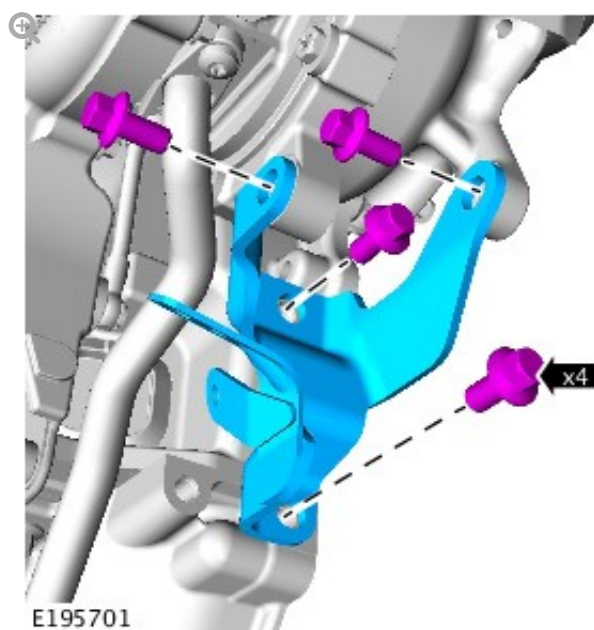

Torque: 32 Nm

8.

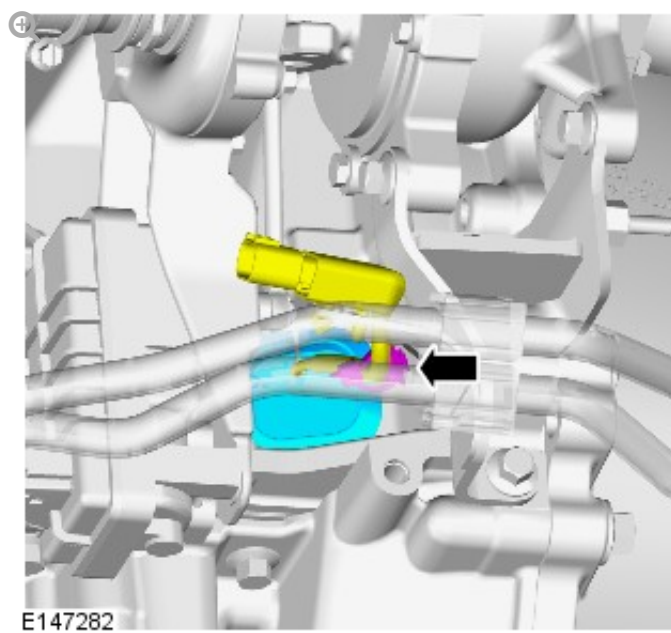


CAUTIONS:

- Install the CKP sensor correctly into the housing. Failure to follow this instruction may result in damage to the CKP sensor.
- Before the disconnection or removal of any components, make sure the area around joint faces and connections are clean. Plug any open connections to prevent contamination.

NOTES:


- Engine shown removed for clarity.
- The CKP sensor retaining bolt should not be removed from the CKP sensor.

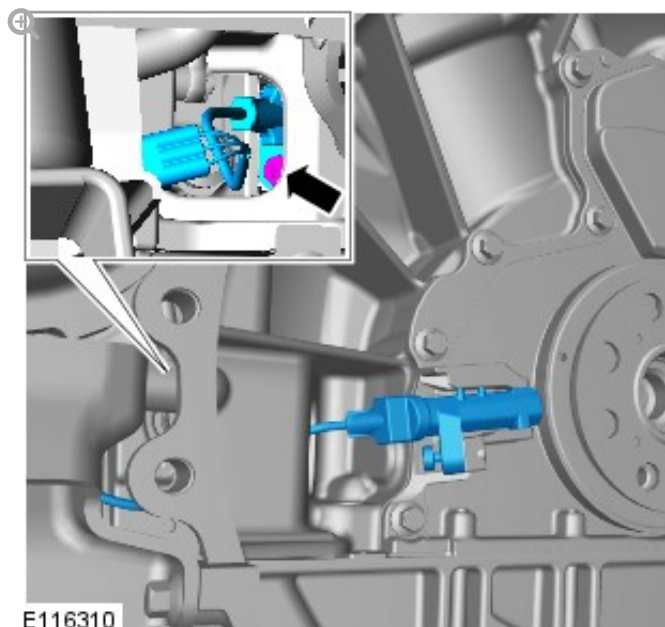

- *Torque: 5 Nm*

CAUTION:

Install the CKP sensor correctly into the housing. Failure to follow this instruction may result in damage to the CKP sensor.

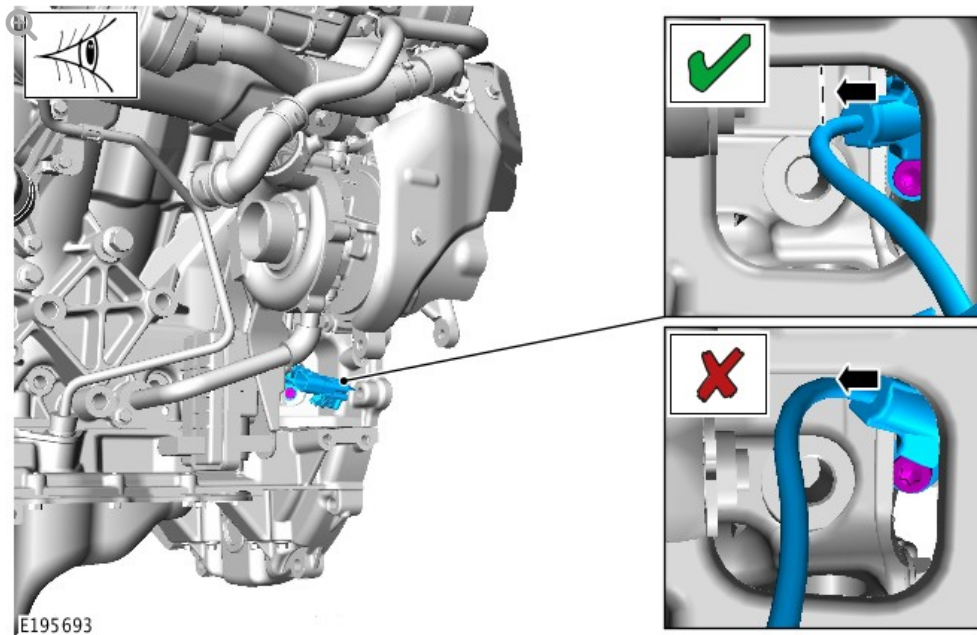

Using the illustration, check the installed position of the CKP sensor as seen through the cylinder block opening. The CKP sensor wiring must point towards the 9 o'clock position and not contact the cylinder block as shown. If the position is not correct repeat the process from step 9 of the removal procedure.

INSTALLATION

1. To install, reverse the removal procedure.