

PUBLISHED: 11-MAY-2011
2015.0 RANGE ROVER (LG), 303-00


ENGINE SYSTEM - GENERAL INFORMATION

CYLINDER BORE OUT-OF-ROUND (G61243)

1.

**NOTE:**

The main bearing caps or lower crankcase must be in place and tightened to the specified torque; however, the bearing shells should not be installed.

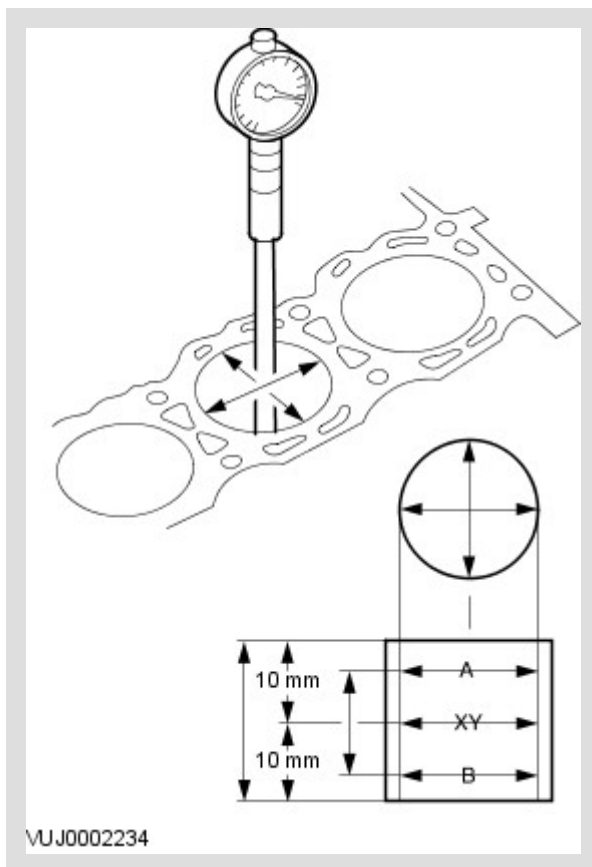

VUJ0002234

Measure the cylinder bore with an internal micrometer.

Carry out the measurements in different directions and at different heights to determine if there is any out-of-roundness or tapering.

If the measurement is out of the specified range, hone out the cylinder block or install a new block.

