

PUBLISHED: 25-JAN-2017
2015.0 RANGE ROVER (LG), 303-12

INTAKE AIR DISTRIBUTION AND FILTERING - TDV8 4.4L DIESEL

CHARGE AIR COOLER (G1514985)

REMOVAL AND INSTALLATION

PART(S)

STEP	REPLACE PART / RENEW PART	PART NAME	
Installation Step 5	Renew Part	Retaining clip	1
Installation Step 9	Renew Part	Retaining clip	1

REMOVAL



CAUTION:

LH illustration shown, RH is similar.




NOTES:


- Some variation in the illustrations may occur, but the essential information is always correct.
- Removal steps in this procedure may contain installation details.

1. Refer to: [Front Bumper Cover](#) (501-19 Bumpers, Removal and Installation).


2.

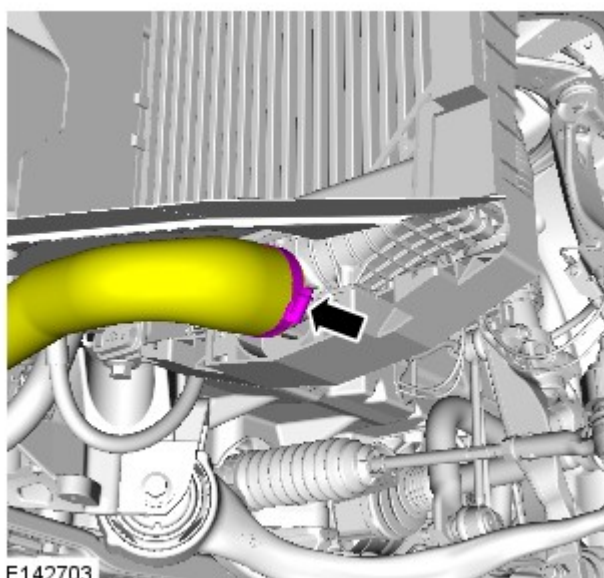


3.

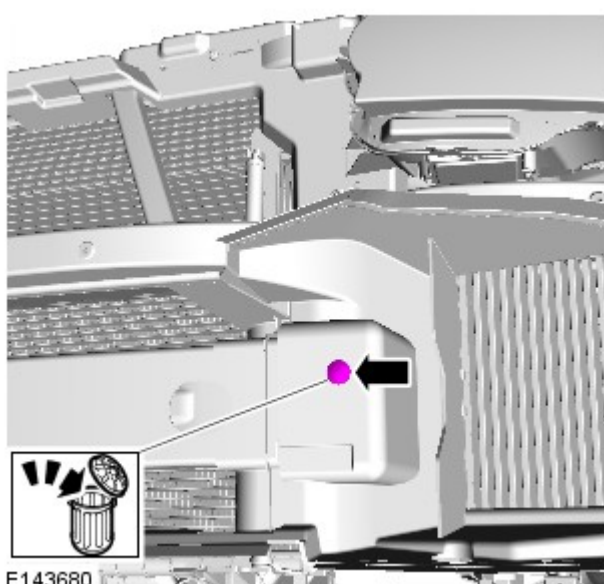


4.

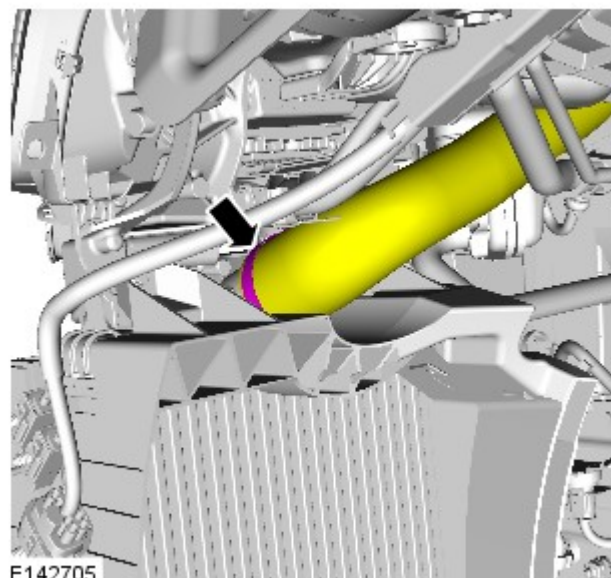


5.

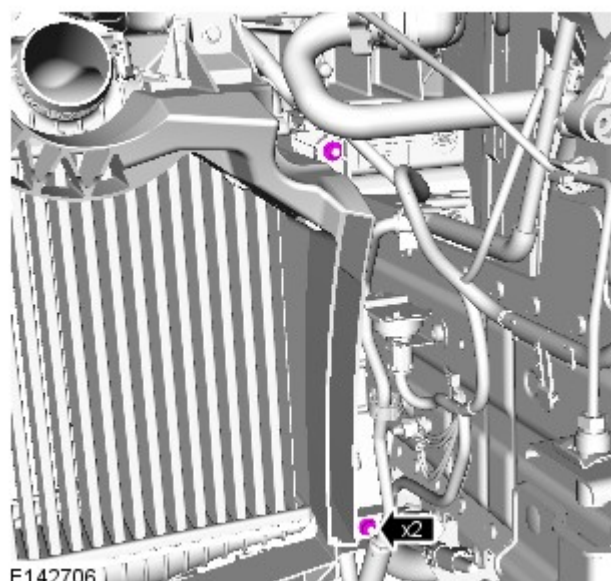

6.

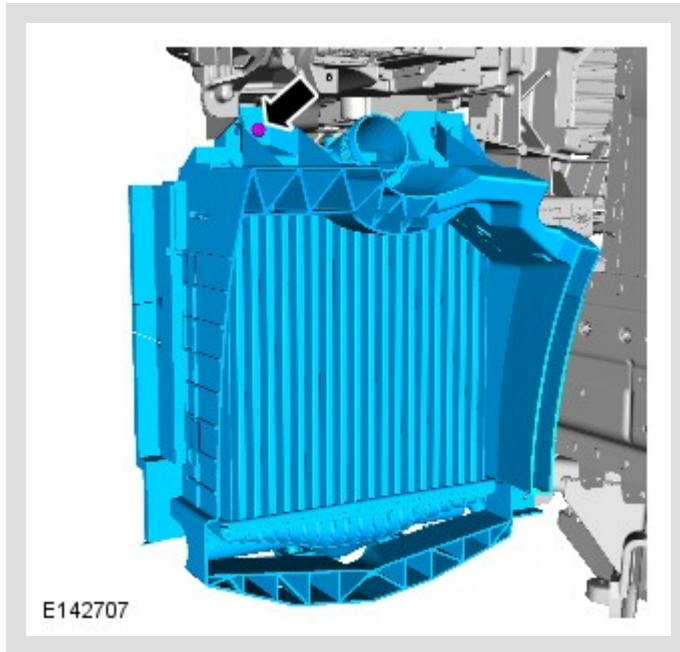

7.

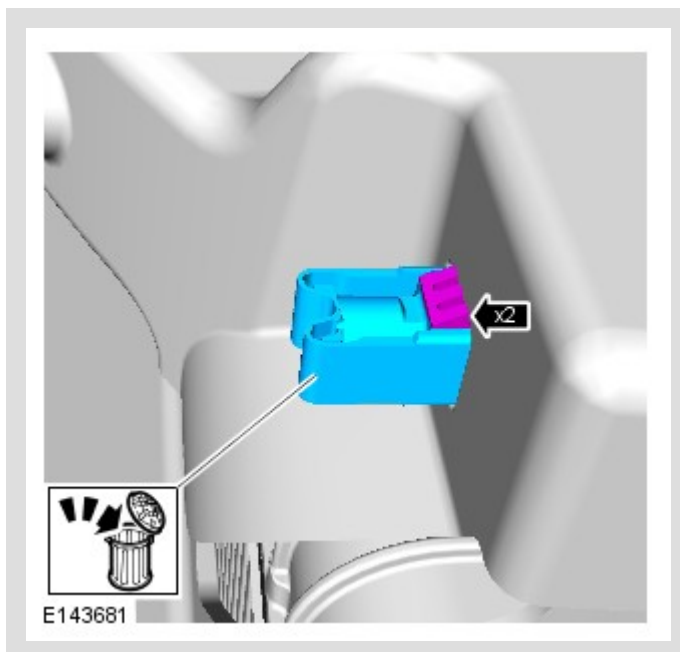



8.




NOTE:

Do not disassemble further if the component is removed for access only.

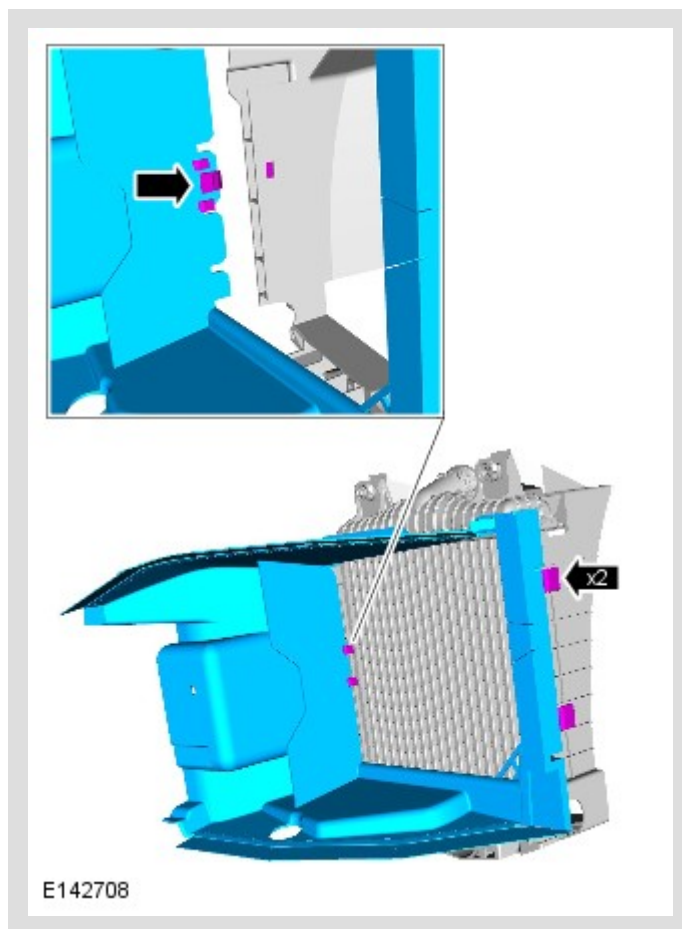

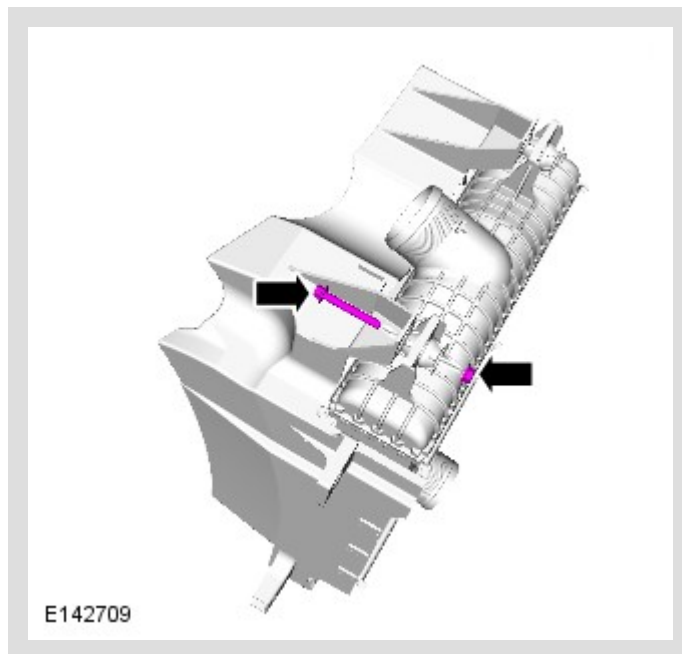


10.

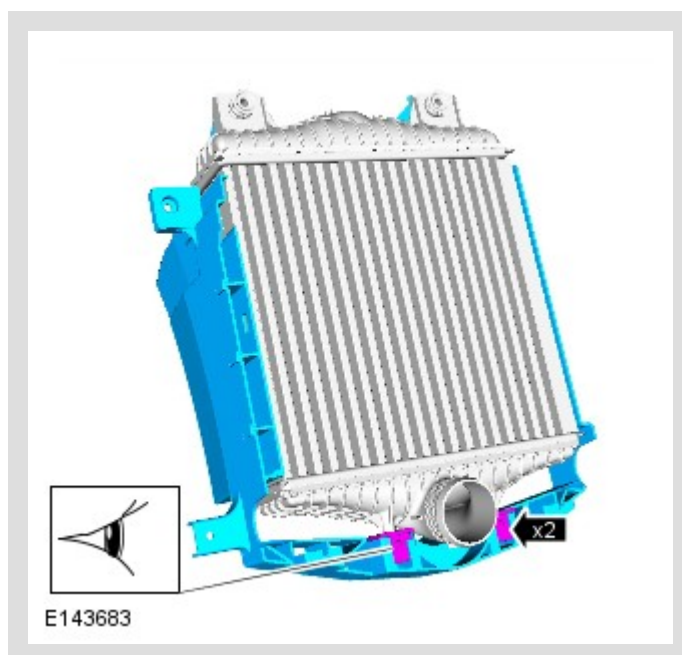


Inspect the components and renew if damaged or worn.

11.

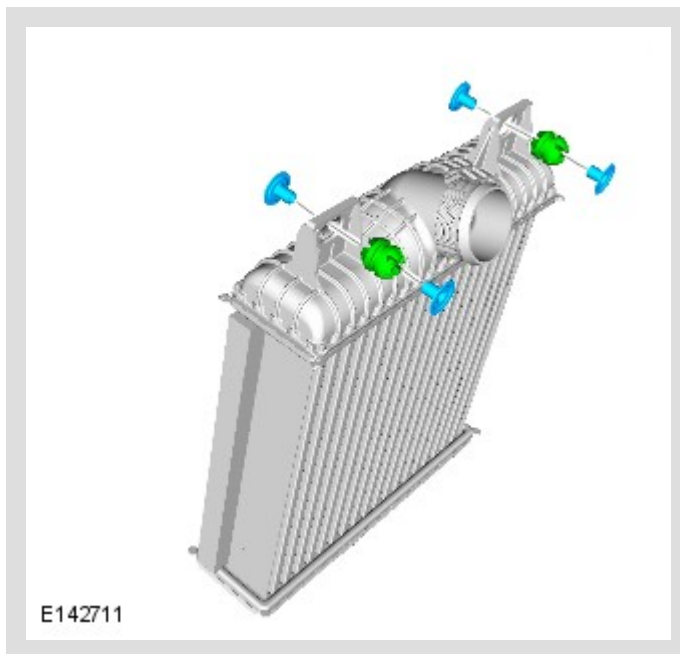

INSTALLATION


1.

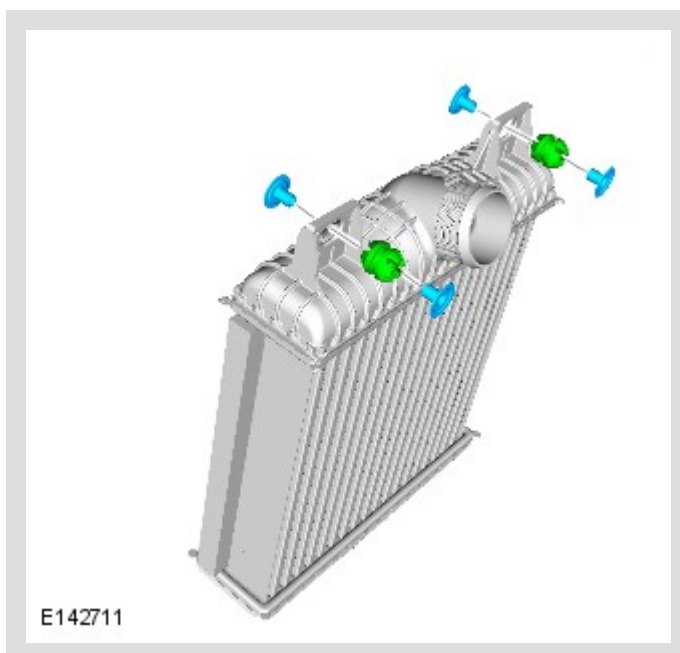

2.




3.

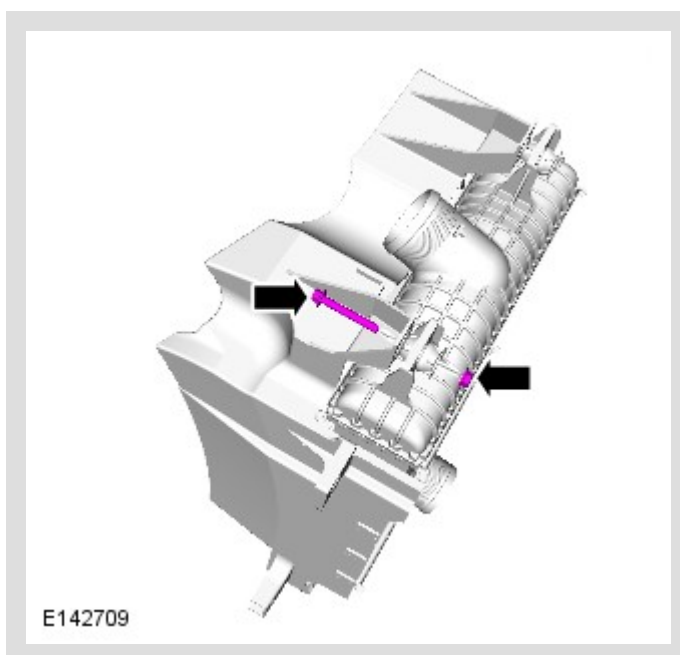

Torque: 9 Nm

4.

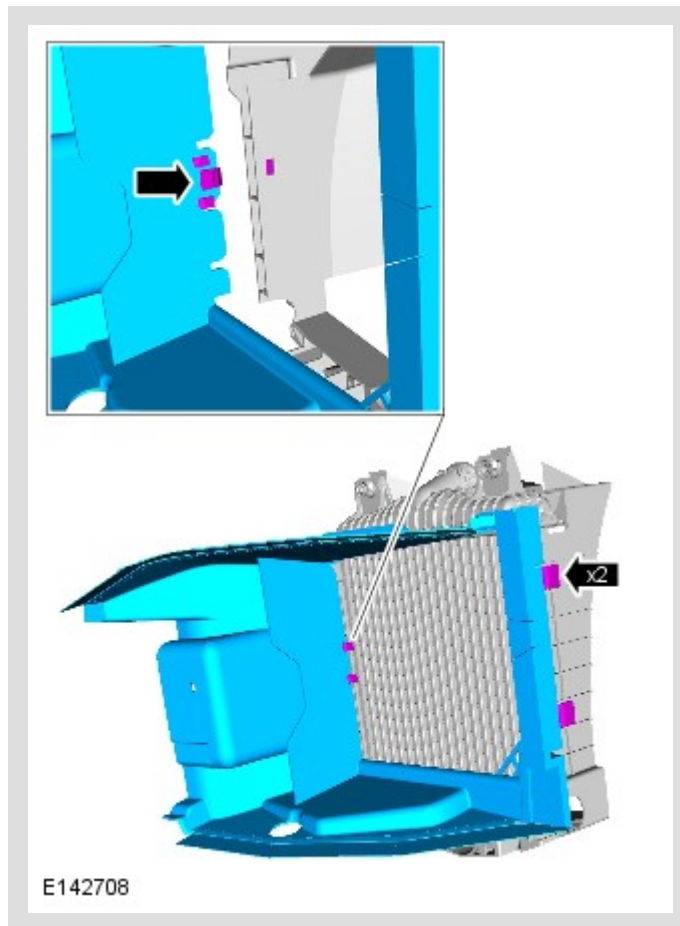


5.




NOTES:

- Make sure that the locking tangs are installed correctly.
- Make sure that new components are installed.

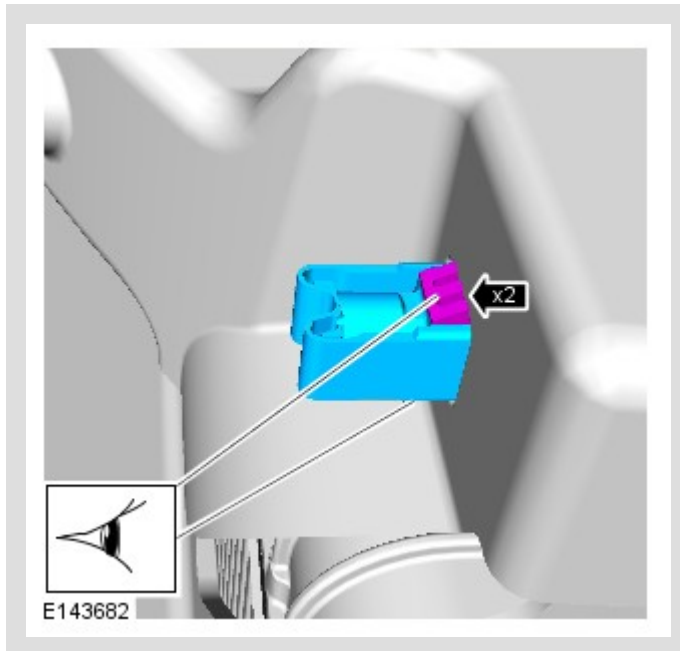


Renew Part: *Retaining clip* : 1 .

6.

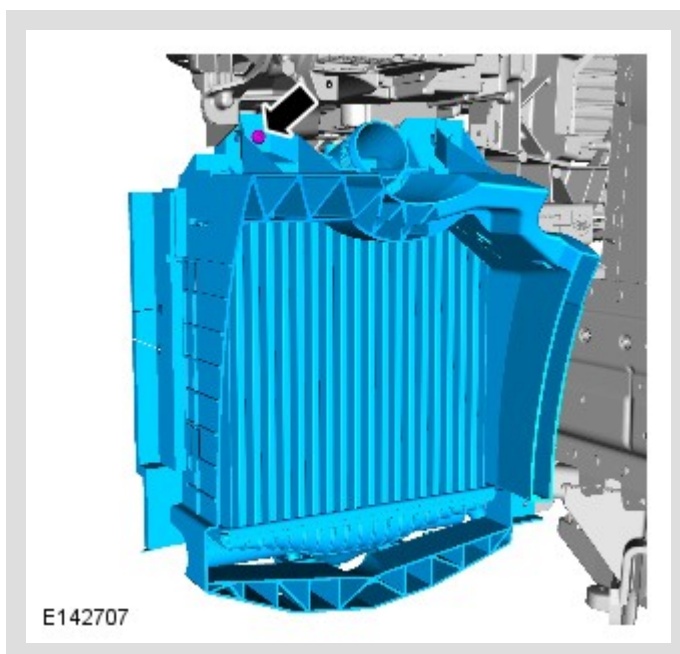

Torque: 5 Nm

7.

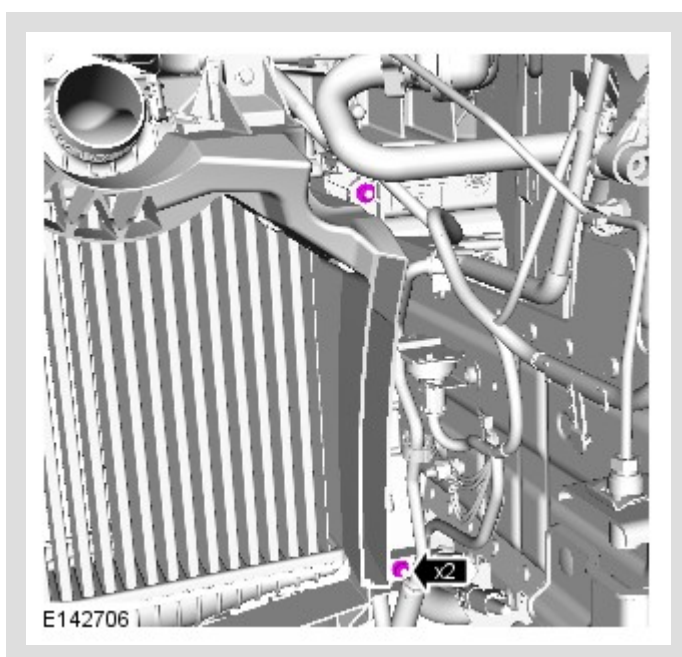


Torque: 9 Nm

8.



NOTE:

Make sure the retaining clip is correctly installed and tightened.

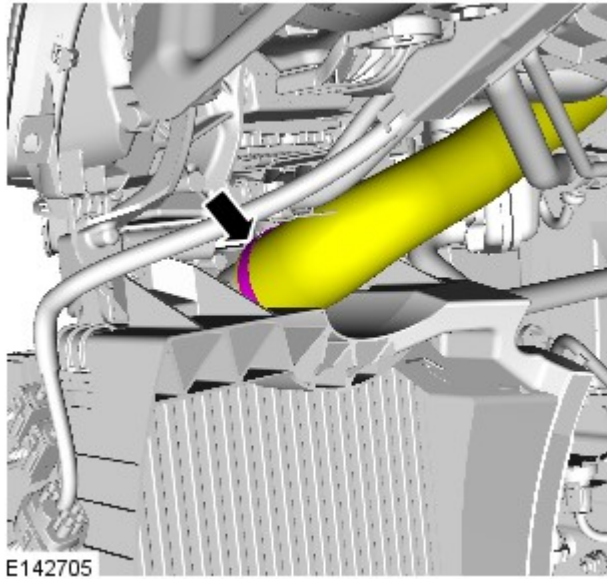


Torque: 5 Nm

9.



NOTE:

Make sure that new components are installed.

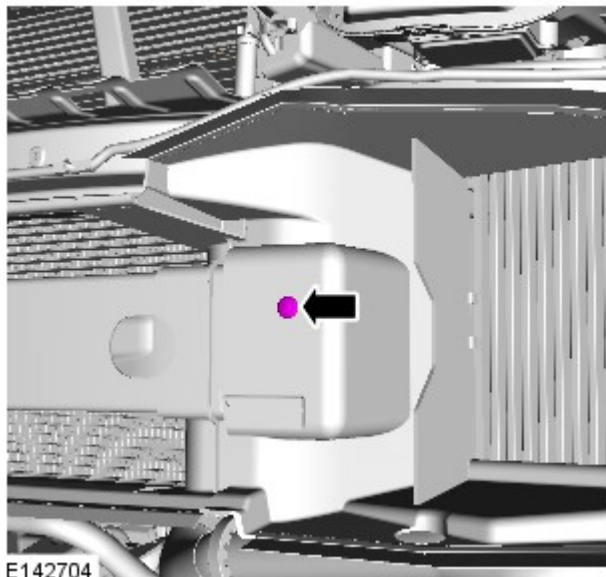


Renew Part: *Retaining clip* : 1 .

10.



NOTE:

Make sure the retaining clip is correctly installed and tightened.

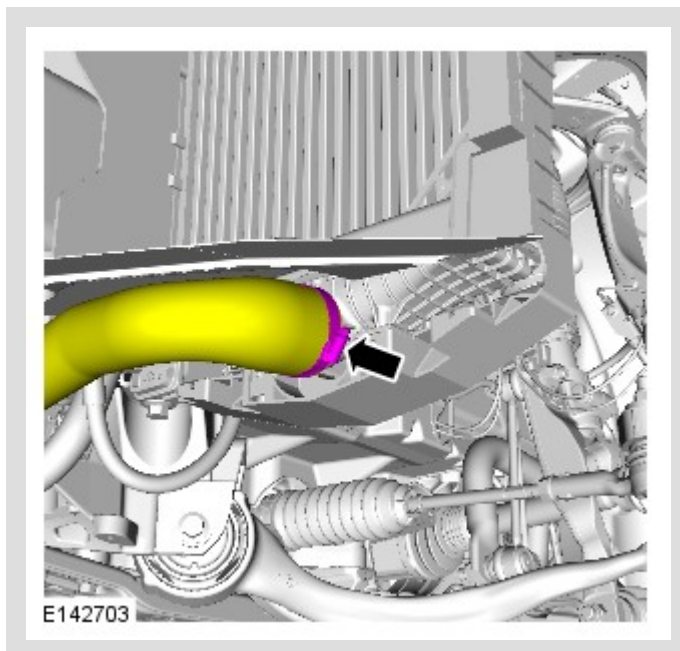

Torque: 5 Nm

-
11. Refer to: [Front Bumper Cover](#) (501-19 Bumpers, Removal and Installation).