



## Field Service Action FSA 26B05

15 April 2026

### NEW VEHICLE RECOMMENDED DEMONSTRATION / DELIVERY HOLD Customer Satisfaction Program 26B05 Certain 2026 Model Year Everest Tremor - Nameplate Replacement

To: All Ford Dealerships  
Attention: Ford Dealer Principal  
Ford Dealer Service, Parts, Sales & Pre-Delivery Managers  
Ford Dealer Stock Controllers & Campaign Coordinators

#### OWNER-NOTIFIED SERVICE PROGRAM

**SUBJECT: 26B05 - Certain 2026 Model Year Everest Tremor - Nameplate Replacement**

**Special Attention: The Dealer Field Service Action Co-ordinator has overall responsibility for implementing this action within your Dealership and Branches.**

#### Introduction

In some of the affected vehicles, the Tremor nameplate badges may exhibit paint or material cracking due to an incompatible primer used in production of the badge.

#### Service Action

Before demonstrating or delivering any new in-stock vehicles involved in this program, dealers are to replace the three Tremor nameplates on both front doors and liftgate. This service must be performed on all affected vehicles at no charge to the vehicle owner.

#### Program Terms

This program will be in effect through 31 March 2029. There is no mileage limit for this program.

#### Owner Notification Mailing Schedule

Owner notification will be communicated. Dealers should repair any affected vehicles that arrive at their dealerships, whether or not the customer has received a letter.

#### Xtime FSA/ Recall Integration

For Service appointments Xtime will reflect an FSA time of 0.7hrs preloaded in line with the PDR code. For Dealers who wish to adjust the time, please firstly create the corresponding operation code in your DMS using your preferred choice of prefix and the new field service action number of 26B05: e.g. 99FOFSA26B05. The operation code that you create in your DMS can allow for labour time and/or parts required to complete this FSA. Please contact Xtime support on 03 8585 3000 if you are unsure of the operation code format prior to the creation.

**Models Affected:** A total of 389 vehicles are affected in Australia.

| Vehicle        | Model Year | Assembly Plant | Build Dates                                 |
|----------------|------------|----------------|---------------------------------------------|
| Everest Tremor | 2026       | AAT- RAYONG    | November 28, 2025 through February 16, 2026 |



**NOTE:** Affected vehicles may be held in Dealer new/used car stock or be present at the Dealership for service-related purposes. **All** vehicles should be checked on PTS for Field Service Action eligibility and **any** outstanding Field Service Actions completed **prior** to vehicle departure in accordance with the Warranty & Policy Manual, Section E 3.4 and I 3.

**NOTE:** All Dealers can obtain a copy of the Campaign (which includes a sample copy of the Customer Letter) via the FMC Dealer or PTS websites.

**NOTE:** Dealers can obtain a list of eligible vehicles from the PTS Website [www.proservicetech.com](http://www.proservicetech.com) by selecting Quick Links and then FSA VINs.

### **Parts Requirements**

| Part Number    | Claim Qty | Package Order Qty | No. in Package | Description               |
|----------------|-----------|-------------------|----------------|---------------------------|
| R1VZ-16228-A   | 1         | 1                 | 1              | Nameplate Right-Hand Door |
| R1VZ-16228-B   | 1         | 1                 | 1              | Nameplate Left-Hand Door  |
| R1VZ-7842528-A | 1         | 1                 | 1              | Nameplate Liftgate        |

### **Additional Repair (Labor Time And/Or Parts)**

Additional repairs identified as necessary to complete the FSA should be managed as follows:

- For vehicles within new vehicle bumper-to-bumper warranty coverage, follow existing warranty and policy guidelines for related damage claims. No approval is required for these vehicles.
- For vehicles outside new vehicle bumper-to-bumper warranty coverage, please send a request for prior approval to the Prior Approval team.

### **Claims Preparation And Submission**

**Related Damage/Additional labor and/or parts:** Must be claimed as Related Damage on a separate repair line from the FSA with the same claim type and subcode as described in Claim Entry above.

**IMPORTANT:** Click the Related Damage Indicator radio button.

### **Labor Allowances**

| Description                                                                               | Labor Operation | Labor Time |
|-------------------------------------------------------------------------------------------|-----------------|------------|
| Replace three Tremor nameplate badges<br><b>This labor operation code closes the FSA.</b> | 26B05B          | 0.7 Hours  |
| Mobile Service:<br>Can be used when the repair takes place away from the dealership       | 26B05MM         | 0.5 Hours  |
| PDR Description                                                                           | PDR No.         | Labor Time |
| Replace three Tremor nameplate badges                                                     | FSA26B051       | 0.7 Hours  |

**NOTE:** Where Mobile Repair was used, Dealers should also use an additional line on the same repair order and on the same day to ensure the additional 0.5 hours labor operation code is captured.

### **Mobile Repair**

This FSA is suitable for Mobile Repairs.

### **Displaced Parts**

All displaced parts must be handled in accordance with the Warranty and Policy Manual (Section G, Attachment G).

### **Completion Date**

It is estimated that this campaign will be completed by 30 April 2027. If, however, the campaign remains outstanding after this date, affected vehicles identified on the Vehicle Inquiry Screen in PTS must continue to be completed and claimed.

**TIM NETHERCOTE**

**Service Engineering Manager AUS/NZL - FCSD**

**(\* +61 3 8301 2903)**

**Matthew Price**

**Service Operations Manager AUS/NZL - FCSD**

**[mprice63@ford.com](mailto:mprice63@ford.com)**

FORD MOTOR COMPANY OF AUSTRALIA PTY LTD – ACN 004 116 223 – Registered Office: Suite 2.02, 600 Victoria Street, Richmond, Victoria 3121 CONFIDENTIAL:

This Dealer Confidential Bulletin is for internal purposes only and must not be disclosed to any person outside the Ford Dealer Network.

**NEW VEHICLE RECOMMENDED DEMONSTRATION / DELIVERY HOLD****Customer Satisfaction Program 26B05**

Certain 2026 Model Year Everest Tremor

Nameplate Replacement

**Thoroughly read and understand rework instructions prior to rework.****OVERVIEW**

In some of the affected vehicles, the Tremor nameplate badges may exhibit paint or material cracking due to an incompatible primer used in production of the badge.

**SERVICE PROCEDURE**

**NOTE:** Before beginning any service procedure refer to the Workshop Manual (WSM) Section 100-00 General Information - Health and Safety Precautions. Failure to follow this instruction may result in serious personal injury.

1. Remove backing foam from new nameplate packaging and align to match the original badge. (Figure 1)

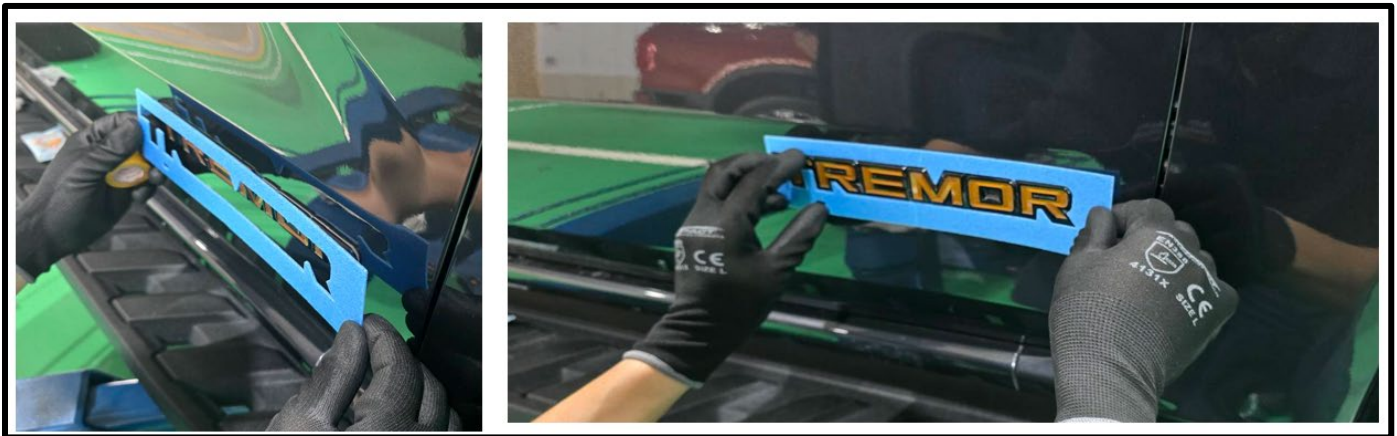


Figure 1

2. Attach tape at four positions (Figure 2)



Figure 2

3. Use masking tape to outline the backing foam position (Figure 3)



Figure 3


4. Remove the backing foam (Figure 4)



Figure 4

5. Remove the Tremor Nameplate. (Figure 5)

Use General Equipment: Plastic Tool such as a Trim Removal Tool



Gently push the plastic tool under one corner of the badge and pull the badge off.  
Use gloves and shop rags to prevent damage to the body.

**NOTE:** Take **EXTREME** care **NOT** to scratch or dent the vehicle paint/panel during the badge removal.

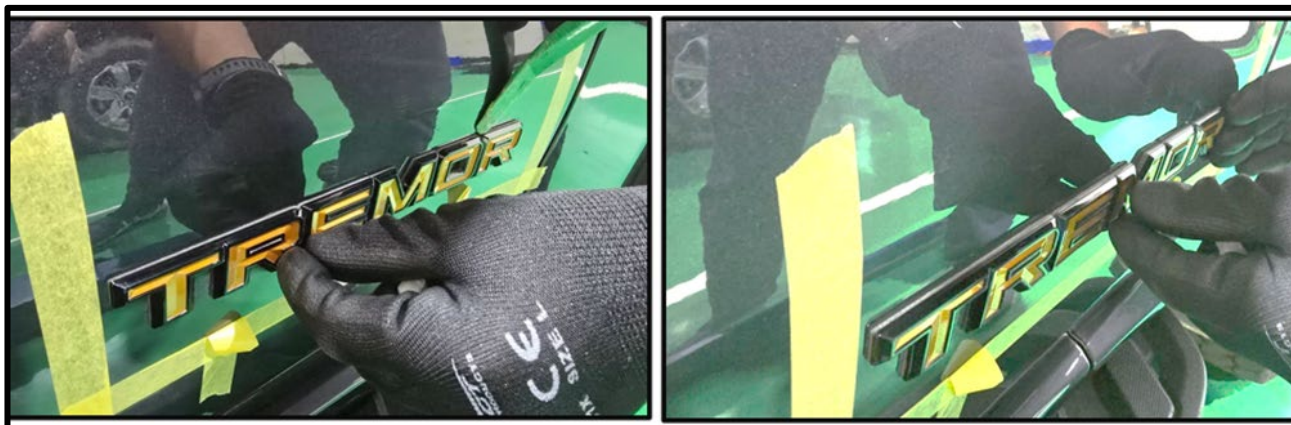


Figure 5



6. Clean the body panel surface where the nameplate was removed. (Figure 6)  
Use the General Equipment: Lint-free Towel, Isopropyl Alcohol (min 90%).

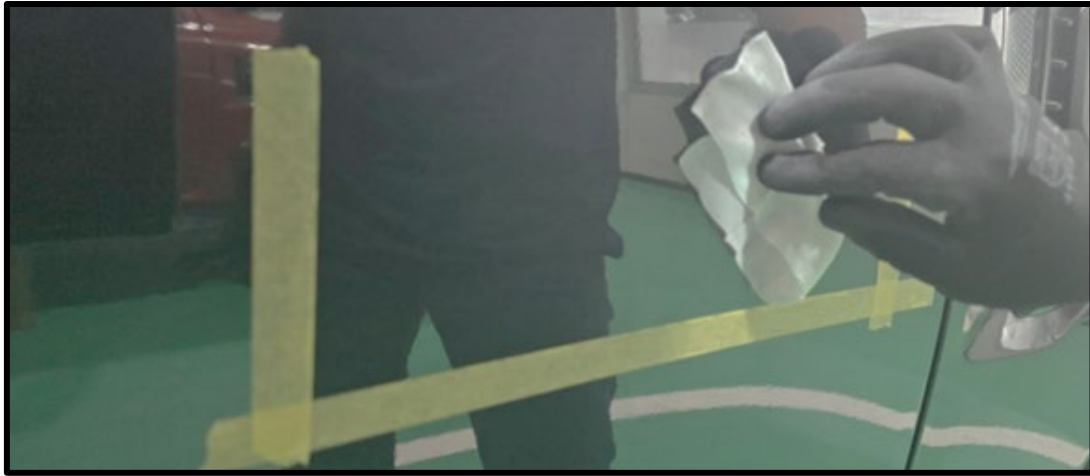


Figure 6

7. Align the new badge using tape line and template. (Figure 7)



Figure 7

8. Attach the badge to the body panel and peel off the backing foam and the masking tape.
9. Repeat procedure to replace all three Tremor nameplates.

**[END]**



## SAMPLE LETTER ONLY

xxxxxxx, 2026

VIN NUMBER / 26B05M1

Name

Organisation

Address1

Address2

Address3

**Service Program 26B05**

**Your Vehicle Identification Number:** VIN NUMBER

**Registration Number:** REGNUMBER

At Ford Motor Company, we are committed not only to building high-quality, dependable products but also to building a community of happy, satisfied customers. To demonstrate that commitment, we are providing a no-charge Customer Satisfaction Program for your vehicle with the VIN shown above.

**What is the issue?**

On your vehicle, it may be possible that the paint used on the Tremor nameplate badge is not fully adhered.

**What is the effect?**

This may result in cracking of the paint on the Tremor nameplate badge.

**What will Ford and your dealer do?**

**Parts are now available to repair your vehicle.**

In the interest of customer satisfaction, Ford Motor Company has authorized your dealer to replace the three Tremor nameplate badges on your vehicle free of charge (parts and labor) under the terms of this program.

This Customer Satisfaction Program will be in effect until March 31, 2029 regardless of mileage. Coverage is automatically transferred to subsequent owners.

**How long will it take?**

The time needed for this repair is less than one-half day. However, due to service scheduling requirements, your dealer may need your vehicle for a longer period of time.

**What should you do?**

Please call your dealer without delay to schedule a service appointment for Customer Satisfaction Program 26B05. Provide the dealer with your VIN, which is printed near your name at the beginning of this letter.

If you do not already have a servicing dealer, you can access [www.ford.com.au](http://www.ford.com.au) for dealer addresses, maps, and driving instructions.

Ford wants you to have this service action completed on your vehicle. The vehicle owner is responsible for making arrangements to have the work completed, therefore please have this service action performed as soon as possible.

NOTE: If available in your market, you can receive information about Recalls and Customer Satisfaction Programs through our FordPass App. The app can be downloaded through the App Store or Google Play. In addition, there are other features such as reserving parking in certain locations and controlling certain



functions on your vehicle (lock or unlock doors, remote start) if it is equipped to allow control.

**Mobile Service**

Ford Mobile Service may be offered by your dealer, contact your dealer for details.

**What if you no longer own this vehicle?**

You have received this notice because our records indicate that you are the current owner of the vehicle described at the start of this letter. If you are no longer the owner of this vehicle, please complete the owner details change advice (following page).

**Can we assist you further?**

If you still have concerns, please call us on 13 FORD (13 3673) and one of our Customer Relationship representatives will be happy to help you.

**Yours faithfully,**  
TIM NETHERCOTE  
Service Engineering Manager  
Ford Motor Company of Australia Pty Ltd



## CHANGE OF DETAILS NOTIFICATION

V.I.N.

VIN NUMBER

### Owner Details

If you still own the vehicle but your details have changed, would you please complete the section below with your new details and then return this complete letter in the pre-addressed/pre-paid envelope. **Please also refer to Privacy Collection Statement below.**

State

New Registration Number (if applicable)

New Name

New Address

New Suburb

New Postcode

New Phone Number

New Mobile Number

New Email Address

### Primary Driver Details

If you are the registered owner, but not primary driver, and would like Ford to make contact with the primary driver of this vehicle, please ask the primary driver to complete their details below and we will organise for a recall notice to be sent to that address. **Primary driver, please refer to Privacy Collection Statement below.**

Driver Name

Driver Address

Driver Suburb

Driver Postcode

Driver Phone Number

Driver Mobile Number

Driver Email Address

## OTHER CHANGES

Please tick (✓) the appropriate box and sign:

☐ I no longer own this vehicle

Print Name: \_\_\_\_\_

☐ This vehicle has been written off.

☐ This vehicle has been stolen

Signature: \_\_\_\_\_





VIN NUMBER