

AMENDMENT NO. 1 SEPTEMBER 1987

TO

IS : 9206-1979 DIMENSIONS OF CAPS FOR
TUNGSTEN FILAMENT GENERAL
SERVICE ELECTRIC LAMPS

(Page 4, clause 2.1) — Add the following new clause after 2.1:

‘2.2 Caps shall be checked by the use of gauges for checking the dimension: controlling interchangeability in accordance with the following tables:

- | | |
|---|--|
| a) ‘No Go’ gauge for caps B22 on finished lamps | Table 4 |
| b) ‘Go’ gauge for caps B22 on finished lamps | Table 5 |
| c) ‘Go’ gauge for E40 caps on finished lamps | Table 2 of
IS : 9900 (Part 4)-1981* |
| d) ‘Go’ gauge for E27 caps on finished lamps | Table 3 of
IS : 9900 (Part 4)-1981* |
| e) ‘No Go’ gauge for E40 caps on finished lamps | Table 4 of
IS : 9900 (Part 4)-1981* |
| f) ‘No Go’ gauge for E27 caps on finished lamps | Table 5 of
IS : 9900 (Part 4)-1981* |

(Page 4, foot-note) — Add the following foot-note in the end:


‘*High pressure mercury vapour lamps : Part 4 ‘Go’ and ‘No Go’ gauges of lar caps.’

(Page 9, Table 3) — Add the following tables after Table 3:

TABLE 4 'NO GO' GAUGE FOR CAPS B22 ON FINISHED LAMPS

(Clause 2.2)

The drawing is intended only to illustrate the essential dimensions of the gauges.

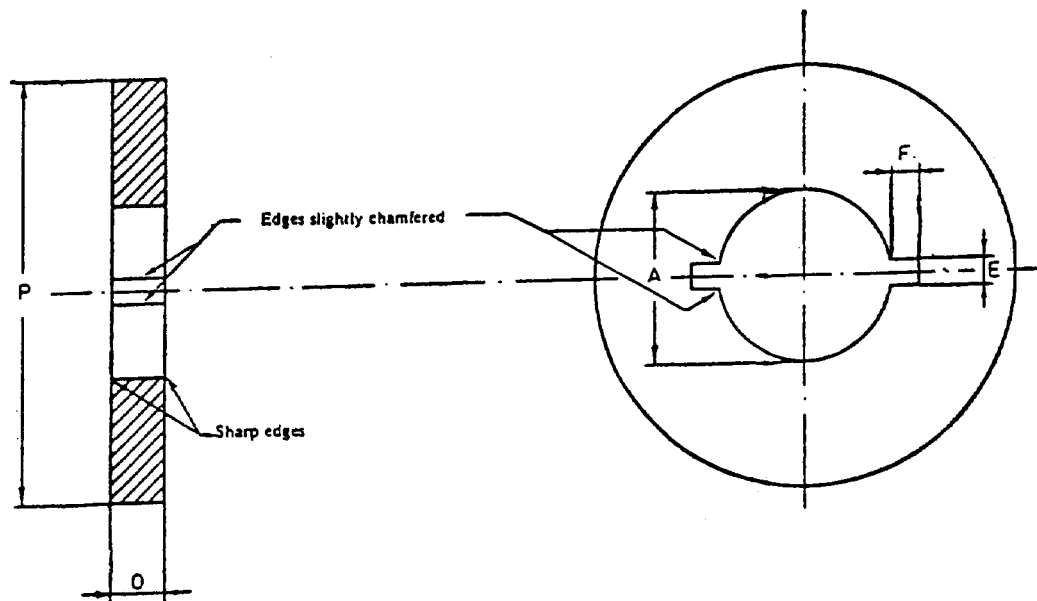

All dimensions in millimetres.

MATERIAL : STEEL

DIMENSION	B 22	TOLERANCE
A	21.75	+ 0.0 - 0.01
E	3.5	+ 0.5 - 0.5
F	3.5	+ 0.5 + 0.5
O	7	$\pm$ 0.1 - 0.1
P	53	Approx



Purpose : For the control of dimension A Min.

Testing : Caps on finished lamps shall be assumed to be correct if the gauge does not pass over the caps by its own weight.

TABLE 5 'GO' GAUGES FOR CAPS B22 ON FINISHED LAMPS

(Clause 2.2)

The drawing is intended only to illustrate the essential dimensions of the gauges.

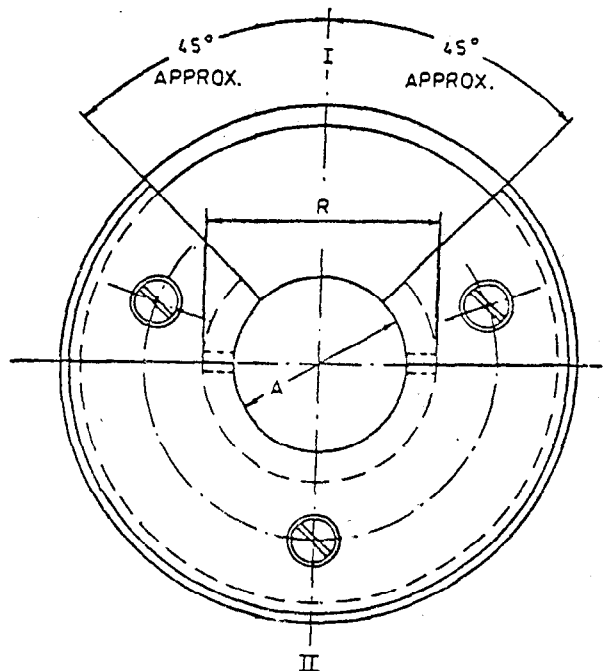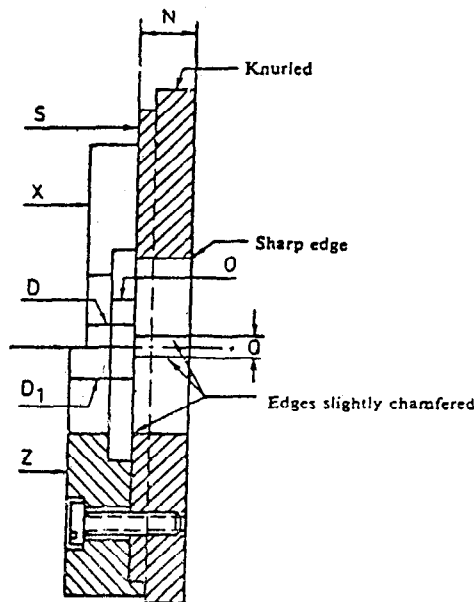

All dimensions in millimetres.

MATERIAL : STEEL

DIMENSION	B 22	TOLERANCE	DIMENSION	B 22	TOLERANCE
A	22.15	+ 0.01 - 0.0	O	3.05	+ 0.0 - 0.05
D	6.0	+ 0.0 - 0.01	Q	2.5	+ 0.0 - 0.04
D ₁	8.0	+ 0.02 - 0.0	R	29.5	+ 0.0 - 1.0
N(1)	6.7	+ 0.0 - 0.01			

Purpose : For the control of dimensions *A Max*, *N Min*, *D Min*, *D₁ Max* and the diametrical position of the pins.

Testing : The cap shall enter the gauge until the pins have passed through the slots *Q*. The cap is then turned through a small angle and is pressed so that the pins are in close contact with surface *S*. In this position, the contact making surface shall not be below surface *X* or shall it project beyond the surface *Z*. Dimension *N* of the gauge tests the diameter of the cap for a sufficient length to ensure interchangeability of the caps in the holders.