Callahan Auto & Diesel
255 W Main St.
Mesa AZ - 85201
Phone# (480) 969-3332

Flat Bay Inspection
Invoice No# 13103
Report Date: 10/24/2025
by Autoflow

2010 Jeep Liberty

Report URL: Click here

Customer Name	Jeremy G	Phone No.	(xxx)-xxx-x012,(xxx)-xxx-x519,(xxx)-xxx-x603
Submodel	Sport	Engine Size	3.7L
2WD or 4WD	4WD	VIN	1J4PN2GK4AW139317
License	ATB1202	Mileage	219839
ABS	4WABS	Transmission	4 speed auto
Est/Invoice#	13103	Oil Filters	POF2500
Notes			

Reason vehicle is here

#	Type	Details	Notes	Acknowledged
1	Concern	Oil change and check engine light		✓
2	Concern	DVI		✓

Flat Bay Inspection

✓ 0 Requires Urgent Attention

#	Insp Item	Notes

✓ 36 Good Items

#	Insp Item	Notes
✓	Windshield Wipers/Washers	Working as intended
✓	Horn Operation	Working as intended
✓	Lube Sticker	New Sticker Due for next service at
✓	Parking Brake	Working as intended
✓	Brake Operation	Working as intended
✓	Drain Plug Condition	Good

✓	Headlights High/Low	Working as intended
✓	Taillights/Back Up Lights	Working as intended
✓	Turn Signals/Emergency Flashers	Working as intended
✓	Engine Air Filter	Good condition
✓	Cabin Air Filter	Good condition
✓	Battery Test	Battery CCA 800 Tested CCA 675 Pass
✓	Battery Condition/Cables	Good condition
✓	Washer Fluid	Full
✓	Belts	Good condition
✓	Hoses	Good condition
✓	Power Steering Fluid	Good condition
✓	Fuel System	Good condition

✓	Transfer Case	Good condition
✓	Front Differential	Good condition
✓	Rear Differential	Good condition
✓	Oil/Fluid Leaks	No leaks seen
✓	Maintenance Service Due	
✓	Other	
✓	Calipers/Wheel Cylinders	Working as intended
✓	Brake Lines	In good condition
✓	Other	
✓	Alignment Check	Yes
✓	Alignment	Alignment good
✓	Wheel Bearings	No play or noise found
✓	Steering	Working as intended
✓	Suspension	Working as intended
✓	Front Struts/Shocks	Working as intended
✓	Rear Struts/Shocks	Working as intended
✓	Drive Axle/Boots	Working as intended
✓	Other	

✓ 9 Requires Future Attention

#	Insp Item	Notes
!	Dash/Instrument Light	PCM - p0420 B1catalyst efficiency, Airbag - B1C1A - passenger active headrest control circuit open, Cluster - P0853 - Overdrive/Tow switch input circuit stuck WCM/TPMS - C0077 - low pressure, C1504 - Pressure sensor 4 internal failure, HVAC - B1058 - Recirc. door performance or incorrect operation, B1050 - Recirc door travel too large B11CB - Main/left temp door control - perf. or incorrect operation.

!	Engine Oil Level Before Oil Change	Dirty, dark
!	Oil Condition	Dirty due for service
!	Coolant Condition	Low, needs topped off

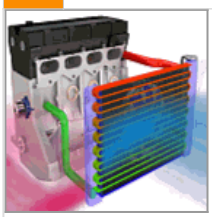

!	Brake Fluid	Low needs topped off, Dirty recommend service Cap is damaged, recommend replacing

!	Front Brake Pads	Brake pads at 3mm recommended to be replaced

!	Front Brake Rotors	Grooving recommend to be replaced

!	Rear Brake Pads	2mm recommended to be replaced Brake pads

!	Rear Brake Rotors/Drums	Grooving, recommend replacement

This report was signed off on 10/24/2025 03:56 pm

Service Writer: Drew Mize

Technician: Joshua Roberts