Claim Number: 4708928

Full Report Assessment Number: A0083789 User Status: Quoted

Printed: 03/06/2024 09:36 **Version: BSRAND01/3**

Addresses

Insured

Name: SAMKELO SIYABONGA NGUBO

Address:

62 BEACON ROAD FLORIDA NORTH FLORIDA 1709

Post Code:

Home Tel: 0813885562 Business Tel: 0813885562

Email Address: SAMKE704@GMAIL.COM

Engineer

Name: RENEW-IT RANDBURG

Address: **CHRISTO** Post Code:

Business Tel: 0117922350 Mobile Tel: 0828044268

Email Address: christo.p@renew-it.co.za

Repairer

Name: RENEW-IT RANDBURG

Address:

CNR HAMMER & GERHARDUS RD

STRYDOMPARK **RANDBURG GAUTENG** Post Code: 2194

Business Tel: 0117922350

Email Address: randburgauthorisations@bluespec.co.za

Assessor

Name: Aneshen Govender

Address: Post Code:

Business Tel: 066-486-6306 Other Tel: 011 501 5696

Email Address: aneshen.govender@absa.africa

Insurer

Name: ABSA Insurance Company Limited

Address: Post Code:

Business Tel: 0860 20 21 22

Vehicle Location

Name: RENEW-IT RANDBURG

Address:

CNR HAMMER & GERHARDUS RD

STRYDOMPARK RANDBURG GAUTENG Post Code: 2194

Business Tel: 0117922350

Email Address: randburgauthorisations@bluespec.co.za

12/05/2024

0.0

Total Loss: Code2

Summary Information

Claim

Printed by: Aneshen Govender Third Party: No

Supplementary Authorisation Status: Date of Accident: Work Provider: ABSA I DIRECT Repair Start Date:

47/08928 Policy Number: Repair End Date:

Other Reference: CP-2438583 Estimated Repair Time: Repairer Type: Approved Actual Repair Time: Insured Amount: R649,900.00 Parts Ordered: Parts Ordered Date: Est repair cost: R0.00

Able to Authorise Repairs: Hire Car Start Date: TBA Hire Car End Date: Repairs Authorised: **TBA**

Under Warranty: Yes

Warranty Expiry:

Vehicle Details

Claim Number: 4708928

Full Report Assessment Number: A0083789 User Status: Quoted

Printed: 03/06/2024 09:36 **Version: BSRAND01/3**

Vehicle

Manufacturer: *JAC *JAC/*JAC Model/Sub Model: Model Sheet Number: GWCN 10 Engine Number: P4136195 Registration Number: LN64WHGP

VIN Number: LJ11PABE8RC084347

Registration Month: December Registration Year: 2024 Odometer: Not Known Odometer Reading Type: Unknown Colour: Black

Paint Code:

VIN search performed: No **Model Specs**

FROM MODEL 2023 FRONT BUMPER TYPE A

FOG LAMP

RR PARK CONTROL 1967CCM 140KW 8-SPEED AUTO G-BOX FOUR WHEEL DRIVE PASSENGER AIRBAG DRIVER AIRBAG DOUBLE CAB FENDER EXTENSION

2 COAT METALLIC PRE PAINT OFF VEHIC WATER BASED PAINT

Severity of Impact:

Date of Inspection:

Vehicle Status on Inspection: Dismantled

Vehicle Condition

Vehicle Status

Pre-Accident Condition: Good

Steering: Satisfactory Brakes Pedal Travel: Satisfactory Place of Inspection: Repairer Pre-Accident Damage: good


Tyres Condition: Good

Tyres - Tread Depth (MM):

Left Tyre Right Tyre

Axles Depth Depth LHF 0 6.0 6.0 **RHF** LHR 1 6.0 6.0 **RHR**

Damage Areas:

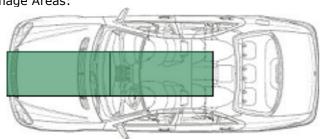

Direction of Impact:

Major Structural Repairs

27/05/2024

Claim Number: 4708928

Full Report Assessment Number: A0083789 User Status: Quoted

Printed: 03/06/2024 09:36 **Version: BSRAND01/3**

Cost Summary

Repair Cost Excl VAT R363,078.41 **VAT 15 %** R54,461.76 Repair Cost Incl VAT R417,540.17 Deduction for Excess* TBA R417,540.17 Repair Cost After Deductions Waste Collection Total R145.36

GWCN

M+M Valuation

M+M Modifiers

M+M Guide Valuation Amount Retail Market

Trade

R649,900.00 R649,900.00

Year Mileage Condition

Model Number

Repair Information

PARTS Price Valid: 17/05/2024

G.No.	Description	Part Number	Bet.	Supplier Name	Price
257	FRONT NUMBER PLATE	KNPL3			R125.00 F
258	FRT NO PLATE REINF	KNPL0			R75.00 F
281	FRONT BUMPER	2803148XPW01A			R7,280.35 F
282	FRT CTR BUMPER TRIM	2803102XPW13A			R2,031.84 F
287	L/F BUMPER	2803116XPW04A			R1,387.44 F
288	R/F BUMPER	2803117XPW04A			R1,387.44 F
317	L/F BUMPER BRACKET	2803122XPW01A			R174.69 F
318	R/F BUMPER BRACKET	2803123XPW01A			R174.69 F
340	FRT BUMPER CARRIER	2803108XPW01A			R977.41 F
341	L/LWR BUMPER BRACKET	2803114XPW01A			R134.90 F
342	R/LWR BUMPER BRACKET	2803114XPW01A			R134.90 F
345	ROD HOLDER BONNET	8402132XPW01B			R265.00 F
347	L/F CTR BUMPER BRKT	2803112XPW01A			R170.83 F
348	R/F CTR BUMPER BRKT	2803113XPW01A			R170.83 F
410	RADIATOR GRILLE	5509119XPW01A			R4,562.79 F
411	INN RAD GRILLE COVER	5509103XPW01A			R864.14 F
431	RAD GRILLE EMBLEM	3921102XPW01A			R440.15 F
561	L/F HEADLAMP CPL	4121100XPW03A			R9,126.94 F
562	R/F HEADLAMP CPL	4121101XPW03A			R15,376.94 F
633	L/BUMPER TRIM GRILLE	2803103XPW13A			R142.76 F
634	R/BUMPER TRIM GRILLE	2803104XPW13A			R142.76 F
637	L/F FOG LAMP CPL	4116102XPW01A			R2,171.81 F

Claim Number: 4708928 Full Report

Assessment Number: A0083789 User Status: Quoted Version: BSRAND01/3 Printed: 03/06/2024 09:36

638	R/F FOG LAMP CPL	4116103XPW01A	R2,171.81 F
841	L/FRT FENDERLINER	5512102XPW01A	R982.50 F
842	R/FRT FENDERLINER	5512103XPW01B	R982.50 F
1001	LWR OUT AIR DEFLECT	5514107XPW03B	R391.25 F
1003	L/AIR DEFLECTOR	5514130XPW13A	R390.00 F
1003	R/AIR DEFLECTOR	5514140XPW13A	R578.75 F
1005	L/AIR DEFLECTOR	5514112XPW01A	R168.36 F
1005	R/AIR DEFLECTOR	5514114XPW01A	R168.36 F
1009	FRONT PANEL	8400100XPW01A	R6,690.69 F
1117	L/F WHEELHOUSE CPL	8400136XPW01A	R10,309.11 F
1118	R/FRT WHEELHOUSE CPL	8400142XPW01A	R10,309.11 F
1401	WINDSCREEN	5206100XPT12A	R8,417.50 F
1440	OUTER TEMP SENSOR	8105300XK90XA	R216.81 F
3059	BRKT ABSORBER FRT L	2803131XPW01A	R1,055.24 F
3060	BRKT ABSORBER FRT R	2803131XPW01A	R1,055.24 F
3061	FRT BUMPER ABSORBER	2803134XPW01A	R3,237.46 F
4325	PASSENGER AIRBAG	5820101XPW01A	R9,055.18 F
4331	UPP INSTRUMENT PANEL	5306101XPW03A	R35,677.50 F
4455	AIR COND COMPRESSOR	8103100XPW01A	R8,123.33 F
4465	CONDENSOR	8105100XPW01A	R4,598.19 F
4661	L/F SEAT BELT	5811110XPW01A	R2,665.00 F
4662	R/F SEAT BELT	5811120XPW01A	R2,665.00 F
6962	FASTENING CLIPS	JOITIZONI WOIA	R187.50 F
7227	L/F TYRE	245/70 R17	R4,375.00 F
7421	COMBI SWITCH CPL	3774100XPW01A	R4,780.00 F
7440	AIRBAG CONTROL UNIT	3658110XPW05A	R7,601.50 F
7446	DRIVER AIRBAG	5820100XPW01A	R10,293.75 F
7447	L/AIRBAG SENSOR	3658300XKZ1DA	R731.45 F
7448	R/AIRBAG SENSOR	3658300XKZ1DA	R731.45 F
7751	L/LWR RUBBER BEARING	1301103XPW01A	R47.16 F
7752	R/LWR RUBBER BEARING	1301103XPW01A	R47.16 F
7753	L/UPP RUBBER BEARING	1302012-P00	R31.46 F
7754	R/UPP RUBBER BEARING	1302012-P00	R31.46 F
7761	RADIATOR	1301100XPW01A	R4,960.61 F
7763	OIL COOLER	1503100XPW01B	R5,276.25 F
7764	HOSE OIL COOLER	1503101APW01A	R4,374.71 F
7767	BLOWER	1308100XPW01A	R7,753.08 F
7769	L/UPP RADIATOR BRKT	1301101XPW01A	R36.14 F
7770	R/UPP RADIATOR BRKT	1301101XPW01A	R36.14 F
7771	ELECTRIC WATER PUMP	1307114XGW02A	R11,082.76 F
7772	ELECTRIC WATER PUMP	2127131BKU47B	R11,054.04 F
7780	RADIATOR INTAKE HOSE	1303103XPW01A	R945.81 F
7781	RADIATOR OUTLET HOSE	1303051XPW01A	R401.25 F
7840	FAN BELT TENSIONER	1025100XEC01	R2,064.71 F
7841	BELT PULLEY	3701600AED01	R0.00 F
7855	FAN BELT	1025011XEC51	R531.25 F
8020	WATER PUMP BELT	1307012AEC01	R300.94 F
8041	OIL FILTER	1017100AEC01	R0.00 F

Claim Number: 4708928 Full Report

Assessment Number: A0083789 User Status: Quoted Version: BSRAND01/3 Printed: 03/06/2024 09:36

8067	LOWER SUMP	1009300XEC51	R957.29 F
8780	STEERING COVER	2802100XPW04A	R899.80 F
8781	COVER PANEL LOWER	2802101XPW06A	R2,191.51 F
8785	R W/MOTOR COVER	2802101XPW01C	R390.00 F
9645	HIGH TONE HOOTER	3721101XPW06A	R483.53 F
9646	LOW TONE HOOTER	3721100XPW06A	R483.53 F
9670	CONTROL UNIT	3600101XPW06A	R5,524.51 F
9974	POWER STEERING OIL		R375.00 F
9984	ENGINE OIL		R687.50 F
9986	REFRIGERANT AIR CON		R937.50 F
9987	COOLANT/ANTIFREEZE		R187.50 F
9988	BRAKE FLUID		R250.00 F
9989	GEARBOX OIL		R687.50 F
1000	AIRCON PIPE UPPER		R3,426.50 F
1000	AIRCON PIPE LOWER		R2,677.75 F
1000	R/F LOWER LIGHT		R2,695.00 F
1000	L/F LOWER LIGHT		R2,695.00 F

I: Ident PartSub TotalR260,452.50U: Used OEM PartsSundry Parts (Fixed Maximum Amount)R750.00C: Contract SupplierTotal PartsR261,202.50

A: Alternative Parts
O: Other Parts
S: Salvage Parts
F: Final costing

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/trIM - PART NUMBERS MAY DIFFER

RRP +25.00 %

Claim Number: 4708928 Full Report
Assessment Number: A0083789 User Status: Quoted

Assessment Number: A0083789 User Status: Quoted Version: BSRAND01/3 Printed: 03/06/2024 09:36

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = R414.00/HR Price/CL 5 = R414.00/HR

Repair / Guide Num	ber Repair Details	CL	wu	Uplift	Cost Price	
NN	DISS/ASS LEFT FRONT AXLE HALF	1	15.0		R621.00	
NN	DISS/ASS RIGHT FRONT AXLE HALF	1	15.0	R621.0		
NN	ENGINE REMOVE-/REFIT	1	70.0		R2,898.00	
	INCLUDES: BONNET, LOWER ENGINE				,	
	PROTECT,					
	EXHAUST SYSTEM AND ENGINE					
	MOUNTINGS					
	REMOVE-/REFIT ALL HOSES AND					
	WIRING LOOSTEN-TIGHTEN					
	FUEL SYSTEM DRAIN AND REFILL					
NN	DIS+ASSEMBLE ENGINE	1	279.0		R11,550.60	
NN	RENEW FRONT BUMPER	1	11.0		R455.40	
	INCLUDES: R + R FRONT BUMPER,					
	RADIATOR					
	GRILLE AND NECESSARY ATTACHED PARTS					
NN	R + R LEFT HEADLAMP	1	2.0		R82.80	
NN	R + R RIGHT HEADLAMP	1	2.0		R82.80	
NN	ADJUST HEADLAMP	1	2.0		R82.80	
NN	R + R LEFT FRONT FENDER LINER	1	2.0		R82.80	
NN	R + R RIGHT FRONT FENDER LINER	1	2.0		R82.80	
NN	R + R L/F FENDER MOULDING	1	2.0		R82.80	
NN	R + R RIGHT FRONT FENDER BEADING	1	2.0		R82.80	
NN	R + R BONNET HINGE/S	1	1.0		R41.40	
NN	R + R WINDSCREEN	1	23.0		R952.20	
	INCLUDES: R + R WIPER ARMS, COWL GRILLE,					
	A-PILLAR TRIMS, INSIDE MIRROR AND					
	ALL NECESSARY ATTACHED PARTS					
NN	RENEW FRONT PANEL CPL	1	36.0		R1,490.40	
NN	REPLACE L/FRT WHEELHOUSE	1	19.0		R786.60	
NN	REPLACE R/FRT WHEELHOUSE	1	19.0		R786.60	
NN	R + R OUTER FRONT WALL COVERING	1	10.0		R414.00	
NN	R + R L/F INNER CHANNEL SEAL	1	2.0		R82.80	
NN	R + R LEFT MIRROR	1	1.0		R41.40	
	(DOOR TRIM REMOVED)	_				
NN	R + R LEFT FRONT DOOR WINDOW	1	2.0		R82.80	
	(DOOR TRIM REMOVED)					
NN	R + R LEFT REAR DOOR PANEL	1	3.0		R124.20	
NN	R + R LEFT REAR DOOR WINDOW	1	2.0		R82.80	
	(DOOR TRIM PANEL REMOVED)					

Claim Number: 4708928 Full Report
Assessment Number: A0083789 User Status: Quoted

Version: BSRAND01/3 Printed: 03/06/2024 09:36

NN	R + R LEFT REAR OUTER DOOR HANDLE	1	1.0	R41.40
	(DOOR TRIM REMOVED)	_		
NN	R + R L/R INN ELBOW BEAD	1	1.0	R41.40
NN	R + R FRONT BUMPER ABSORBER	1	10.0	R414.00
NN	R + R LEFT LOWER B-PILLAR TRIM	1	1.0	R41.40
NN	R + R RIGHT LOWER B-PILLAR TRIM	1	1.0	R41.40
NN	R + R LEFT FRONT SAFETY BELT	1	2.0	R82.80
NN	R + R RIGHT FRONT SAFETY BELT	1	2.0	R82.80
NN	R + R LOWER INSTRUMENT PANEL	1	20.0	R828.00
NN	R + R CENTRE CONSOLE	1	3.0	R124.20
NN	R + R FRONT WIPER MOTOR	1	1.0	R41.40
NN	R + R AIRBAG CONTROL UNIT	1	1.0	R41.40
NN	RENEW FRONT FLLOR PANEL	1	15.0	R621.00
NN	REPLACE RADIATOR	1	10.0	R414.00
	INCLUDES: BLEED COOLING SYSTEM	_		1112 1100
NN	R + R CONDENSER	1	10.0	R414.00
NN	DRAIN AND REFILL AIR CONDITIONING	1	3.0	R124.20
NN	R + R LEFT FRONT WHEEL	1	2.0	R82.80
NN	R & R LEFT FRONT TYRE	1	3.0	R124.20
NN	R + R STEERING COLUMN TRIM	1	2.0	R82.80
NN	R + R WIPER SWITCH	1	1.0	R41.40
NN	FASTENING CLIPS R + R / NEW PARTS	1	1.0*	R41.40
NN	POWER STEERING OIL R + R / NEW	1	3.0*	R124.20
	PARTS			
NN	ENGINE OIL R + R / NEW PARTS	1	3.0*	R124.20
NN	REFRIGERANT AIR CON R + R / NEW PARTS	1	3.0*	R124.20
NN	COOLANT/ANTIFREEZE R + R / NEW PARTS	1	1.0*	R41.40
NN	BRAKE FLUID R + R / NEW PARTS	1	1.0*	R41.40
NN	GEARBOX OIL R + R / NEW PARTS	1	3.0*	R124.20
0245	STRAIGHTEN FRONT	1	10.0*	R414.00
1565	REMOVE + REFIT L/F DOOR OUT HANDLE			R25,000.00*
7900	REMOVE & REFIT ENGINE ASS EXCH		*0.08	R3,312.00
9852	READ OUT FAULT MEM AFTER REP			R1,250.00*
9950	CHASSIS JIG ALL-IN			R120.00*
0741	REPAIR L/FRT FENDER	1	20.0*	R828.00
1321	REPAIR BULKHEAD ASSY	1	30.0*	R1,242.00
1481	REPAIR L/FRT DOOR	1	10.0*	R414.00
5991	REPAIR FRAME COMPLETE	_	20.0	R15,500.00*
7201	REPAIR L/F WHEEL			R2,500.00*
1000	REPAIR WIRING			R1,250.00*
7087	CHECK L/F SHOCK ABSORBER			K1,250.00
7088	CHECK R/F SHOCK ABSORBER			
7300	CHECK POWER STEERING			
7813	CHECK WATER PUMP CPL			
7900	CHECK ENGINE ASS EXCH			
8411	CHECK ALTERNATOR			
9825	CHECK L/FRONT AXLE HALF			

Claim Number: 4708928 Full Report

Assessment Number: A0083789 User Status: Quoted Version: BSRAND01/3 Printed: 03/06/2024 09:36

9900	ALIGNMENT WITH ADJ VEH CPL ALIGNMENT		R550.00*
PAINT W	ORK Time Basis 10	WU = 1 HR. Price =	= R414.00/HR
Guide Nu	mber Description	wu	Cost Price
	- 2 COAT METALLIC		
	- PRE PAINT OFF VEHIC - WATER BASED PAINT		
	- WATER BASED PAINT		
341	L/LWR BUMPER BRACKETSURFACE-/BLEND PAINT	4.0	
342	R/LWR BUMPER BRACKETSURFACE-/BLEND PAINT	4.0	
345	ROD HOLDER BONNET SURFACE-/BLEND PAINT	4.0	
347	L/F CTR BUMPER BRKT SURFACE-/BLEND PAINT	4.0	
348	R/F CTR BUMPER BRKT SURFACE-/BLEND PAINT	4.0	
1009	FRONT PANEL SURFACE-/BLEND PAINT	7.0	
1117	L/F WHEELHOUSE CPL SURFACE-/BLEND PAINT	6.0	
1118	R/FRT WHEELHOUSE CPLSURFACE-/BLEND PAINT	6.0	
3059	BRKT ABSORBER FRT L SURFACE-/BLEND PAINT	4.0	
3060	BRKT ABSORBER FRT R SURFACE-/BLEND PAINT	4.0	
3061	FRT BUMPER ABSORBER SURFACE-/BLEND PAINT	4.0	
8781	COVER PANEL LOWER SURFACE-/BLEND PAINT	5.0	
281	FRONT BUMPER NEW PART PAINT K1G	21.0	
287	L/F BUMPER NEW PART PAINT K1G	5.0	
288	R/F BUMPER NEW PART PAINT K1G	5.0	
410	RADIATOR GRILLE NEW PART PAINT K1G	6.0	
741	L/FRT FENDER REPAIR PAINTING >50%	18.0	
1481	L/FRT DOOR REPAIR PAINTING >50%	28.0	
742	R/FRT FENDER SURFACE-/BLEND PAINT	6.0	
1321	BULKHEAD ASSY SURFACE-/BLEND PAINT	6.0	
1781	L/R DOOR SURFACE-/BLEND PAINT	8.0	
	LABOUR COST - PAINT		Cost Price
	FACTOR R414.00 Price/HR		333311133
	TIME(PAINT)	159.0	
	Preparation Main Work Plastic	8.0	
	Preparation Main Work Metal	25.0	
	Preparation Colour Mixing	3.0	
	Preparation Colour Sample	3.0	
	Preparation Manufacturer Search	1.0	
	Total Work Units (10WU/HR)	199.0	
	Total Paintwork Labour	19.9 HRS.	R8,238.60
	MATERIAL COST - PAINT		Cost Price
	New Park Painting Plantin V4.6		D4 633 04

New Part Painting - Plastic K1G

9826 CHECK R/FRONT AXLE HALF

R4,623.04

Claim Number: 4708928 Full Report

Assessment Number: A0083789 User Status: Quoted Version: BSRAND01/3 Printed: 03/06/2024 09:36

Material-Constant Main Work Metal	R683.02
Surface-/Blend Paint	R5,820.90
Repair Painting	R3,221.15
Material-Const Main Work Plastic	R187.44

Total Excluding Pearlescent Uplift R14,535.55
Pearlescent Uplift @ 0.0% R0.00

Total Paint Material Cost R14,535.55

Final Calculation 03/06/2024

Parts
Sundry Parts (Fixed R260,452.50
R750.00

Claim Number: 4708928 **Full Report**

Assessment Number: A0083789 User Status: Quoted

Printed: 03/06/2024 09:36 **Version: BSRAND01/3**

Maximum Amount

)

Total Parts R261,202.50

Time Basis 10 Labour

WU = 1 HR

Special Labour R250.00 Total CL 1 776 R32,126.40 WU X R414.00/HR

Total Fixed Labour Amount R45,620.00 R550.00

Alignment 0

WU

Total Labour R78,546.40

Additional Costs

Underbody Sealer 2

R80.00 Material

Rustproofing

Material R80.00 Polishing R250.00

Total of Additional Costs R410.00

Paint Work

Labour Costs R8,238.60

Material Costs R14,535.55

Total Paint R22,774.15

Repair Costs Excluding Waste Collection Cost R362,933.05

Waste Collection

Waste Collection Costs (1 R145.36

% of Paint Material)

Waste Collection Total R145.36

Repair Costs Excludes VAT R363,078.41

VAT @ 15 % R54,461.76

Repair Costs Includes VAT R417,540.17

Excess Deduction 0 % of Rep-Cost **TBA**

Claim Number: 4708928 Full Report

Assessment Number: A0083789 User Status: Quoted Version: BSRAND01/3 Printed: 03/06/2024 09:36

Repair After Excess Deductions

R417,540.17

Active Box Codes

2	15.00	Fixed Allowance - VAT Percentage	
7	0.00	Deductions / Excess - Excess Deduction after VAT as %	
23	25.00	Spare Parts RRP - Addition to RRP on Individual Part Prices	
32	250.00	Flat Amounts/Additional Labour - Special Labour	
51	100.00	Paint Materials - AZT/Schwacke Painting	
67	250.00	Fixed Allowance - Polishing	
70	80.00	Fixed Allowance - Rubberise / Underbody Sealant	
72	80.00	Fixed Allowance - Rustproofing Sealant	
78	1.00	Fixed Allowance - Waste Disposal as % of Paint Materials	
93	750.00	Sundry Parts - Set as Upper Liimt	

In-Active Box Codes

8 0

Sundry Parts - % of Labour Total

Assessment Notes

- Incident Description: Insured was driving and insured days the vehicle lost braking system while trying to brake the vehicle didnt brake when going down a steep road and insured lost control and he tried to swerve the vehicle and the steering wheel locked and brakes stopped working and insured hit into a ditch and vehicle lost its power and air bags popped. Police came to the scene and the insureds vehicle was towed away. - Damage Description: Air bags came out Front bumper is damaged Bonnet is damaged Front windscreen is cracked Whole front of the vehicle is damaged - Shell Created by Codeplex

Assessor's recommendation - Code 2 request

This vehicle has been declared uneconomical to repair.

This vehicle in question is however repairable, but the assessor and/or insurer has elected not to repair the vehicle as the repair costs, repair duration, availability of spare parts and the inconvenience to the client was taken into consideration.

Therefore, the vehicle is accordingly NOT PERMANENTLY UNFIT for use as a motor vehicle as contemplated in section 55 of part 111 of the National Road Traffic Regulations in terms of the Road Traffic Act. It is recommended that the vehicle is NOT deregistered