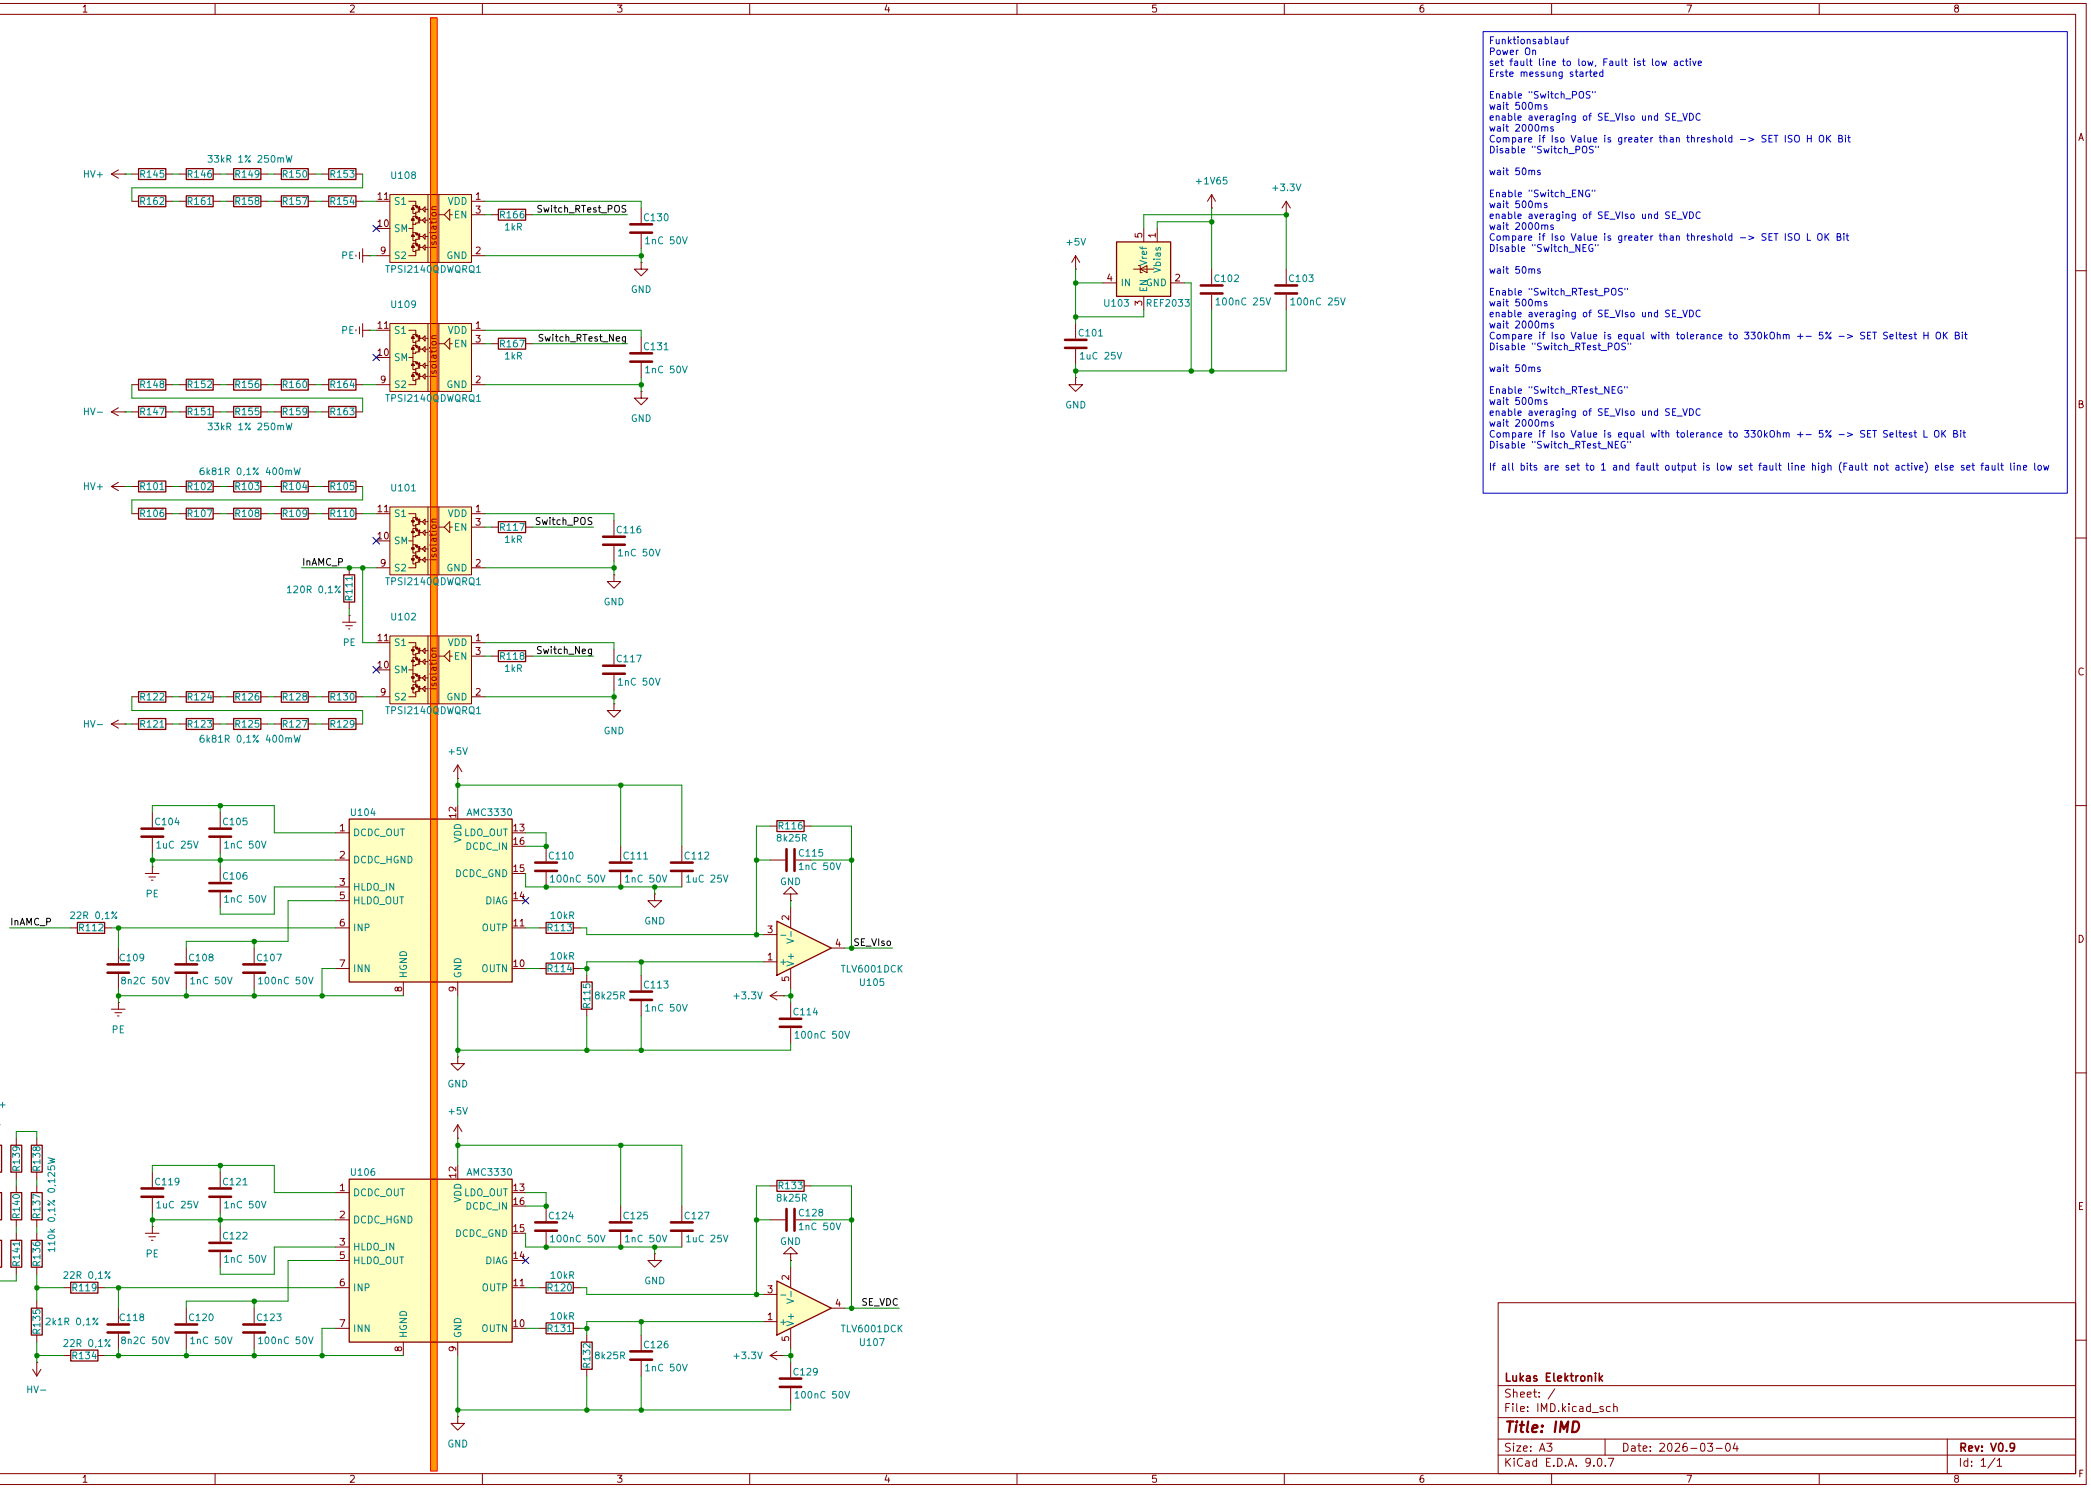


Funktionsablauf
Power On
set fault line to low, Fault ist low active
Erste messung started

Enable "Switch_POS"
wait 500ms
enable averaging of SE_VIso und SE_VDC
wait 2000ms
Compare if Iso Value is greater than threshold -> SET ISO H OK Bit
Disable "Switch_POS"

wait 50ms

Enable "Switch_ENG"
wait 500ms
enable averaging of SE_VIso und SE_VDC
wait 2000ms
Compare if Iso Value is greater than threshold -> SET ISO L OK Bit
Disable "Switch_NEG"

wait 50ms

Enable "Switch_RTest_POS"
wait 500ms
enable averaging of SE_VIso und SE_VDC
wait 2000ms
Compare if Iso Value is equal with tolerance to 330kOhm +- 5% -> SET Seltest H OK Bit
Disable "Switch_RTest_POS"

wait 50ms

Enable "Switch_RTest_NEG"
wait 500ms
enable averaging of SE_VIso und SE_VDC
wait 2000ms
Compare if Iso Value is equal with tolerance to 330kOhm +- 5% -> SET Seltest L OK Bit
Disable "Switch_RTest_NEG"

If all bits are set to 1 and fault output is low set fault line high (Fault not active) else set fault line low

Lukas Elektronik

Sheet: /
File: IMD.kicad_sch

Title: IMD

Size: A3	Date: 2026-03-04	**Rev: V0.9**
KiCad E.D.A. 9.0.7		Id: 1/1