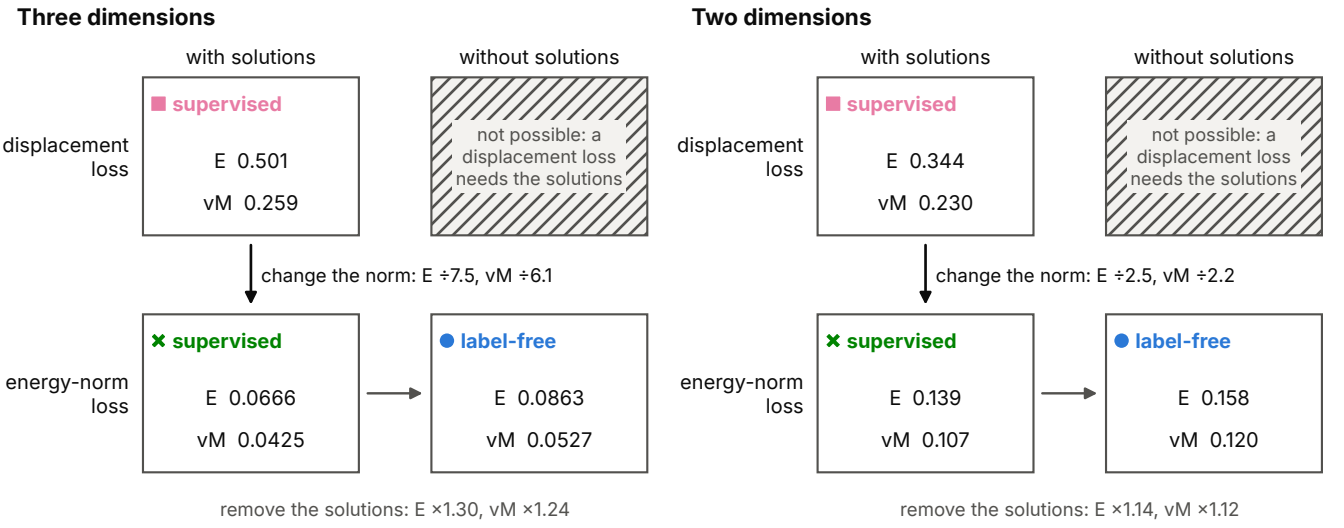
Three dimensions
with solutions
without solutions
displacement loss
supervised
E 0.501
vM 0.259
not possible: a displacement loss needs the solutions
change the norm: E ÷7.5, vM ÷6.1
energy-norm loss
supervised
E 0.0666
vM 0.0425
label-free
E 0.0863
vM 0.0527
remove the solutions: E ×1.30, vM ×1.24
Two dimensions
with solutions
without solutions
displacement loss
supervised
E 0.344
vM 0.230
not possible: a displacement loss needs the solutions
change the norm: E ÷2.5, vM ÷2.2
energy-norm loss
supervised
E 0.139
vM 0.107
label-free
E 0.158
vM 0.120
remove the solutions: E ×1.14, vM ×1.12