Add optional pullups on SDA/SCK to allow reducing resisstance for long wind sensor I2C

40 PIN CONNECTOR

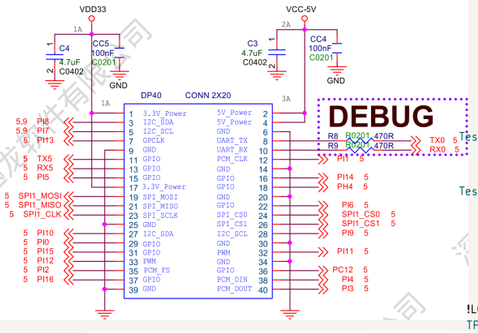

Add RESET and SAFEBOOT GPIO outputs to reset or safe boot

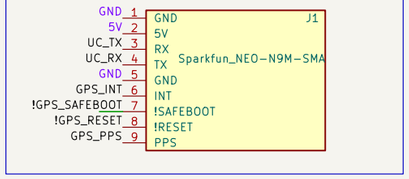

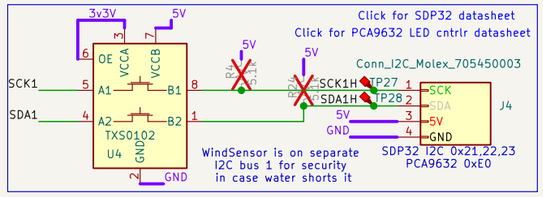

I2C addressses
0x21,0x22,0x23 wind sensor SDP32s
0x2C wind sensor RGBW LED LP5814DLR
0x34 ADC
0x44 humidity
0x48 MP2672 charger (if configured)
0x69 IMU

The MP2672 has two open-drain pins (ACOK and STAT) to indicate the input power and charging status. Table 4 shows the behavior for each of these indications.

Table 4: Indication in Different Cases

Charging State	ACOK	STAT
Charging	Low	Low
Charging complete, charging disabled	Low	Open drain
Charging suspended due to: • Battery OVP • Timer fault • NTC hot fault • NTC cold fault • Battery float	Low	1Hz Blinking
Thermal shutdown	Low	Open drain

To NOT use level shifter, solder R26 & R27 and and pullups R28 & R29

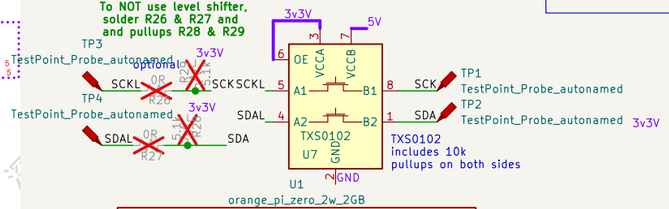

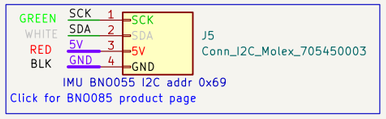

Label on PCB to distinguish I2C bus!

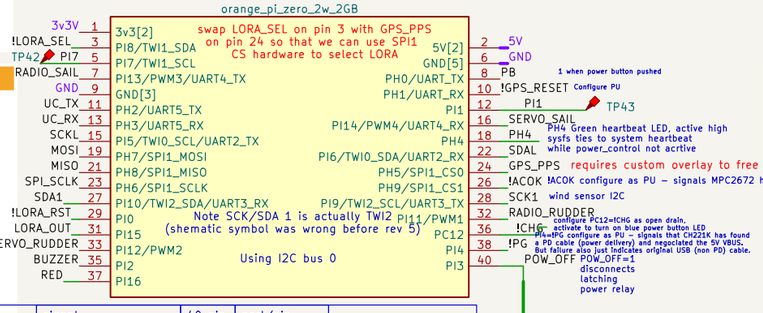

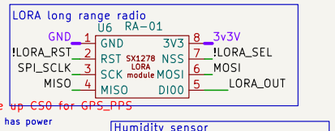

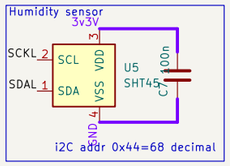

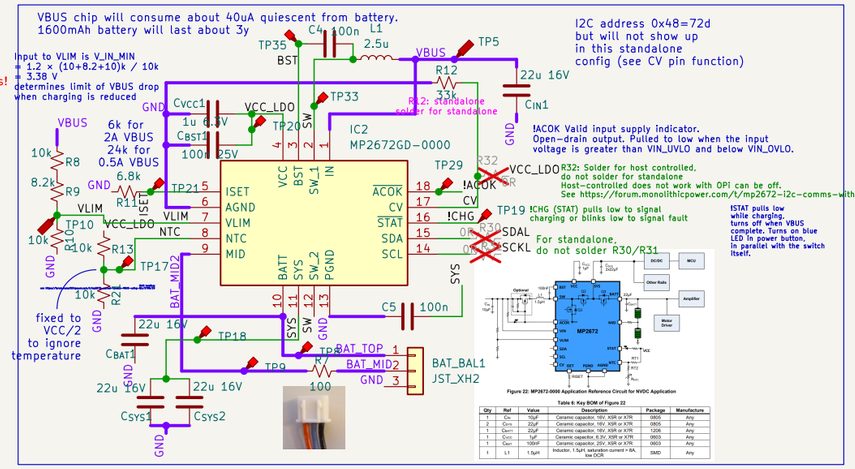

signal	40 pin	port/pin
PWM1_RADIO_RUDDER	32	PI11/PWM1
PWM2_SERVO_RUDDER	33	PI12/PWM2
PWM3_RADIO_SAIL	7	PI13/PWM3
PWM4_SERVO_SAIL	16	PI14/PWM4

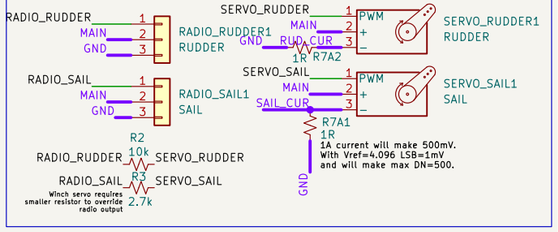

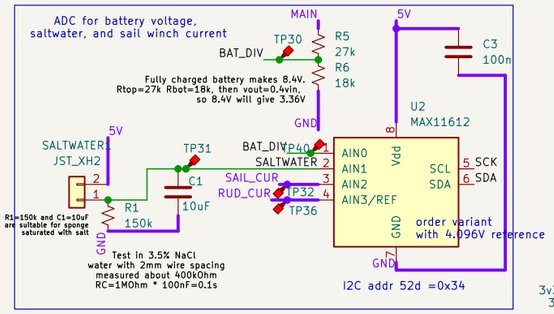

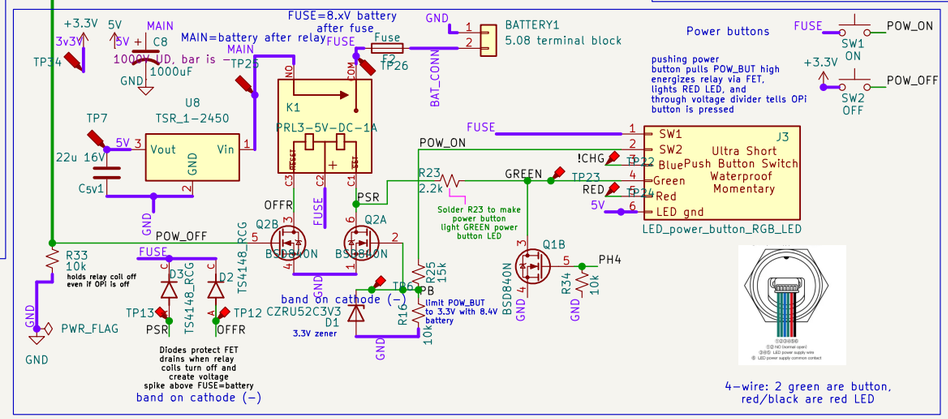

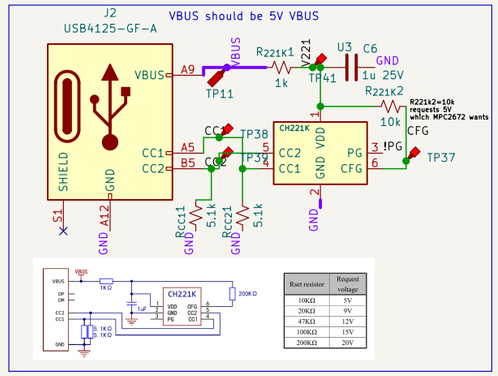
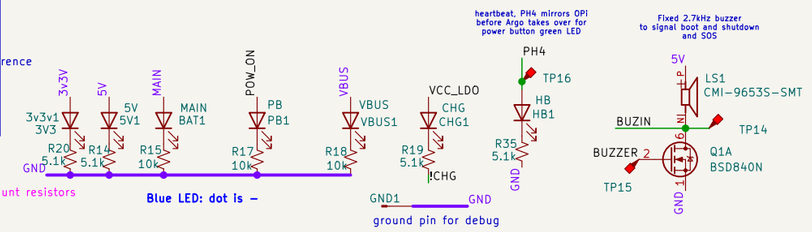
Fix JST headers to be actual size (too large now)