

SURVEY REPORT – <report number>

This is to certify that <survey company> surveyor, at the request of “Requested company” and their principals, visited <survey location> to document the condition of a shipment of “Pharmaceutical Products” shipped in one 40ft refrigerated container TEMU9839275.

Shipment Details:

Container	TEMU9839275
Cargo	37 pallets x Pharmaceutical Products / GW – 9,548.240kgs
BL	HLCUBO12412BIFN9
Carrier	<carries name> (voyage #5101)
Load Port	<load port> on January 6, 2025
Discharge Port	<discharge port> on February 8, 2025
Shipper	<shipper name>
Consignee	<consignee name>
Delivery	<delivery location>
Invoice value	USD 752,700.48

Survey Attendees:

<surveyer attendees>

Background Details/ Survey Details:

- 1) TEMU9839275 was a 01/2021 mfd. 40ft high cube refrigerated container. Container was in location 411-39 at Norfolk International Terminals. Left side panel was heavily pushed inwards over entire length of the container. Left front and rear corner posts were bowed, and left rear bottom corner casting was out of alignment. Bolt seals #HLG6171830 and #KLIK20829087 were on the doors. Reefer unit was operational with set point was +20deg C and return air was +20degC.
- 2) Damaged container was moved to Ocean Container Solutions facility for transload. Repair team cropped the left side door. Seals were broken and right-side door was opened.
- 3) Cargo was stowed in two columns, two tiers high. Air bags were placed between the columns. All pallets shifted to the right side; air bags were crushed and deflated. Majority of the pallets sustained damage. Random master cartons were crushed.
- 4) Merchandise was in master cardboard cartons, consolidated on wooden pallets and poly wrapped. Edge protectors were along all the edges, and cartons were secured to the pallet with three machine fastened nylon bands.
- 5) Crew used a forklift to transload all the pallets.
- 6) All pallets were loaded into replacement container SZLU9644558 on a first out – first in basis per original stow configuration.
- 7) SZLU9644558 was a 02/2013 mfd. 40ft high cube refrigerated container. Empty container was inspected prior to loading and noted to be in satisfactory condition. Reefer unit was operational with set point temperature was originally +23degC and same was changed to +20degC prior to loading the cargo. Upon completion of loading, doors were closed and seal #001155 was applied.

- 8) One loose retail plastic bottle was sighted on pallet. It can be fair to state that the merchandise was not damaged.

Conclusion:

All cargo from damaged container TEMU9839275 was transloaded into replacement container SZLU9644558 at Ocean Container Solutions, Suffolk, Virginia. Most of the pallets were crushed and damaged, some of the master cartons were crushed. It did not appear that any of the merchandise was affected. One loose merchandise bottle was sighted on a pallet.

Photographs:

Damaged container TEMU9839275



Damaged container TEMU9839275 – left side



Damaged container TEMU9839275 – left side




Damaged container TEMU9839275 – front



Damaged container TEMU9839275 – right side



Damaged container TEMU9839275 – temperature display

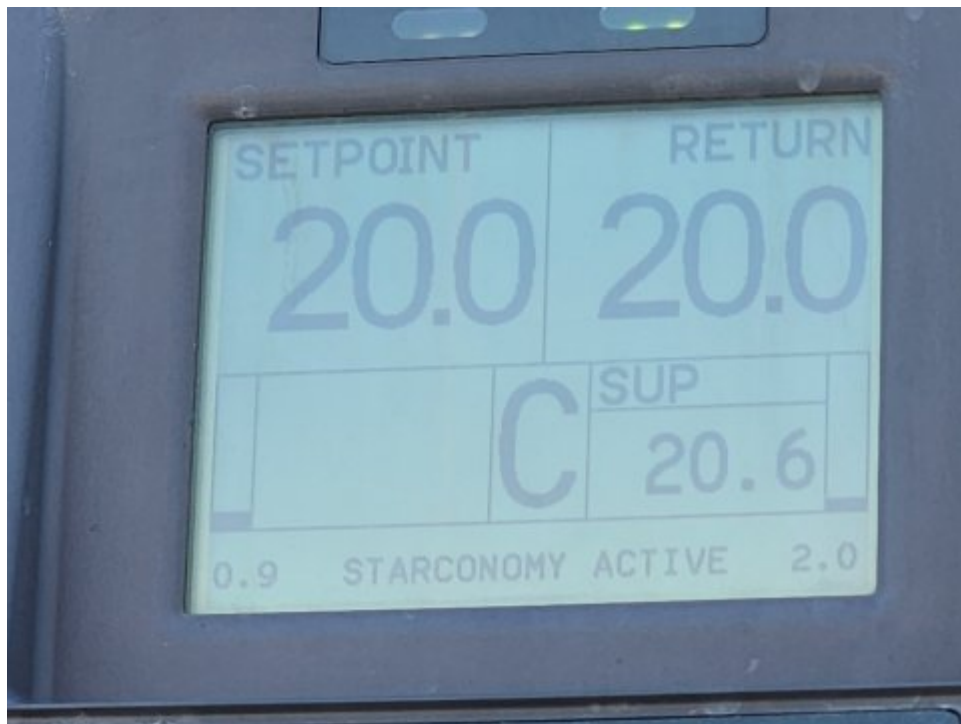

Damaged container TEMU9839275 – seal #HLG6171830



Damaged container TEMU9839275 – seal #KLIK20829087



Damaged container TEMU9839275 at Ocean Container Solutions yard



Left door cropped



Cargo inside damaged container



Cargo inside damaged container



Cargo inside damaged container



Cargo inside damaged container



Cargo inside damaged container



Cargo inside damaged container



Cargo inside damaged container



Empty damaged container



Damaged pallet



Damaged pallet



Damaged pallet



Damaged pallet



Damaged pallet



Damaged pallet



Damaged pallet



Damaged pallet



Damaged pallet



Damaged pallet



Pallets transloaded with forklift



Pallets transloaded with forklift



Typical shipping label



Replacement container SZLU9644558



Replacement container SZLU9644558 – left side



Replacement container SZLU9644558 – right side



Replacement container SZLU9644558 – temperature display



Replacement container SZLU9644558 prior to loading



Cargo inside replacement container



Cargo inside replacement container



Cargo inside replacement container



Cargo inside replacement container



Cargo inside replacement container



Cargo inside replacement container



Loose bottle found on a pallet



Cargo inside replacement container



Cargo inside replacement container



Seal #001155 on replacement container



Temperature display upon completion of loading into replacement container

