

INSTALLATION

This documentation applies to the following device: CN105-2HA

Initial Connection of the Module to Your Wi-Fi Network (AP Mode)

To operate in your environment, this module needs to connect to your Wi-Fi network. However, since it doesn't yet know the name (SSID) or the password, it automatically creates a temporary network (known as AP, for Access Point). You will need to connect to this temporary network to provide your Wi-Fi credentials. Once this step is completed, the module will connect to your network and will automatically connect to your network on subsequent startups.

✂ Steps to Follow

🔌 Plug in the module

Connect it to the **CN105 connector** of your **Mitsubishi** air climatiser.

🖥 Wait for the temporary network to appear

After some seconds to 3 minutes, a new Wi-Fi network named **AP-2HA** should appear :




✅ Connect to this network

Select **AP-2HA**

Press **Connect**

Enter the following password: **abcd1234**

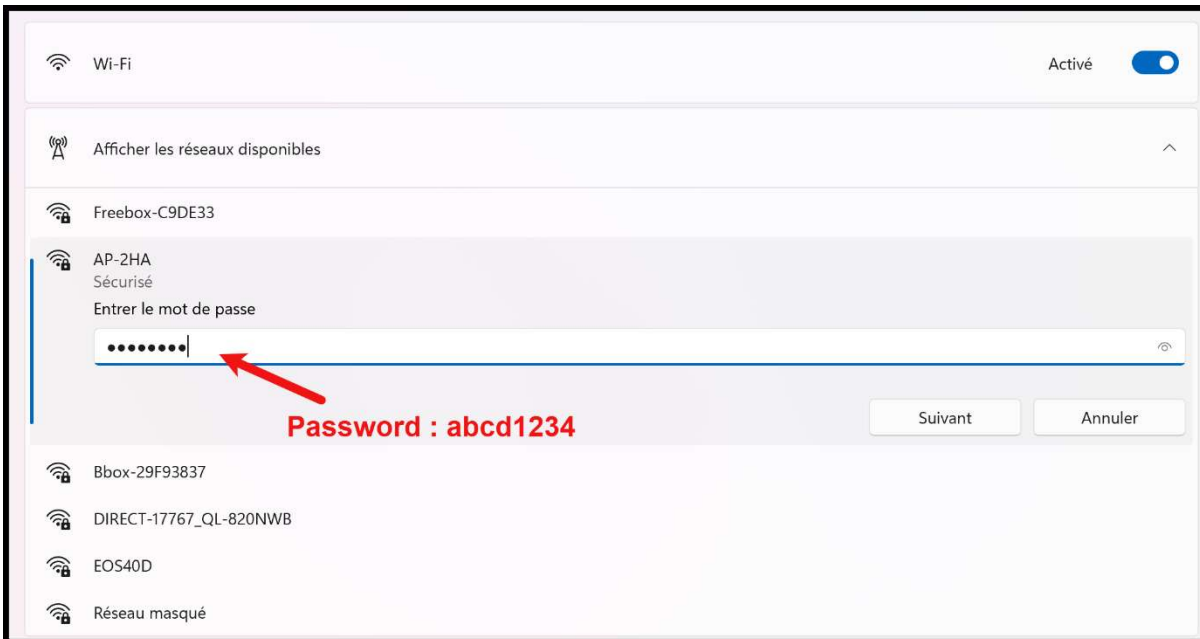

Access the Configuration Interface

Once connected, a page may automatically appear.

If this is not the case :

Open a browser (Chrome, Safari...)

Type this address in the address bar: <http://192.168.4.1> This will be the address in all cases during this initialization phase.

Enter Your Wi-Fi Credentials

This page or something like that should display :

MAC Address: BC:DD:C2:A3:88:19

WiFi Networks: Id2450-5-a38819

The ESP will now try to connect to the network...
Please give it some time to connect.

-  [Freebox-C9DE33](#) 
-  [Bbox-29F93837](#) 
-  [Freebox-C9DE33](#) 
-  [Livebox-95B0](#) 
-  [DIRECT-FD-HP OfficeJet 4650](#) 
-  [CPL wifi 500_958490](#) 

WiFi Settings

SSID	
Password	

Save

OTA Update

Parcourir... Aucun fichier sélectionné.

Update

Enter:

Your SSID (Network Name)

Your WiFi Password

Press **Save**


A message should confirm the successful connection to the Wi-Fi.

⚠ **Important Note** : It may happen that this procedure does not succeed on the first attempt (difficult connection, too long delay...). In this case, it is necessary to repeat: unplug/replug the module, reconnect to the AP-2HA network... until you can enter the network credentials from step 5.


Integration of the Module into HA

Prerequisites : have the **ESPHome** integration installed within **Home Assistant**. Important : it is the **ESPHOME** integration and not **ESPHOME Builder** application !!!


Go to **Parameters - Integrations** and click as indicated below:

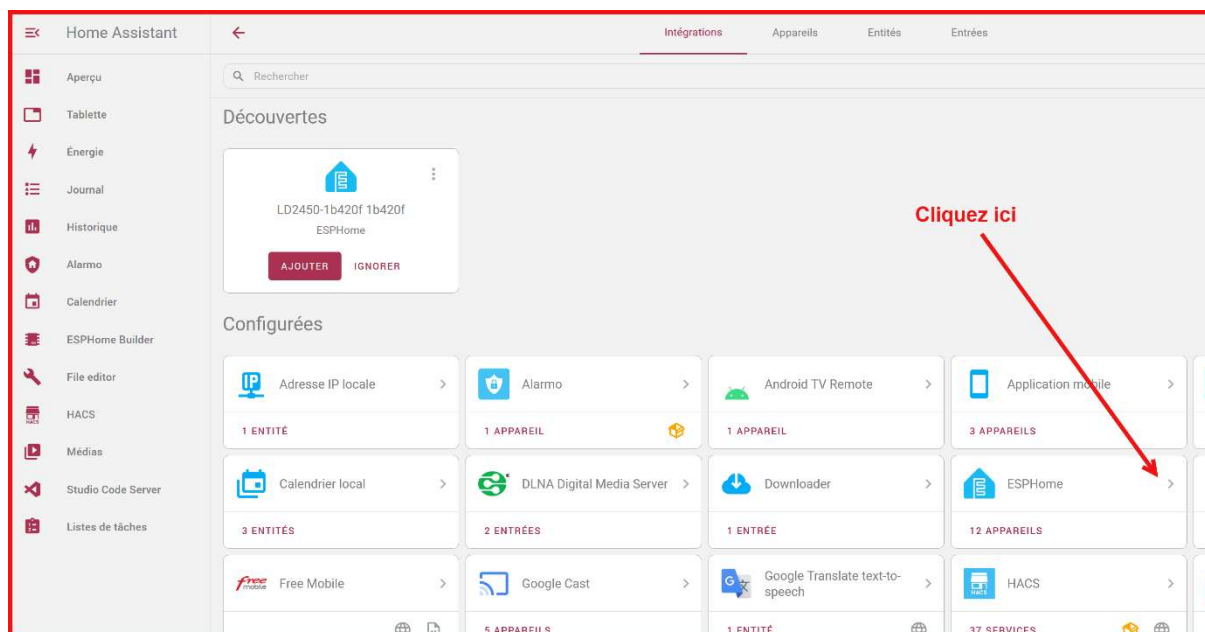

This page should display :

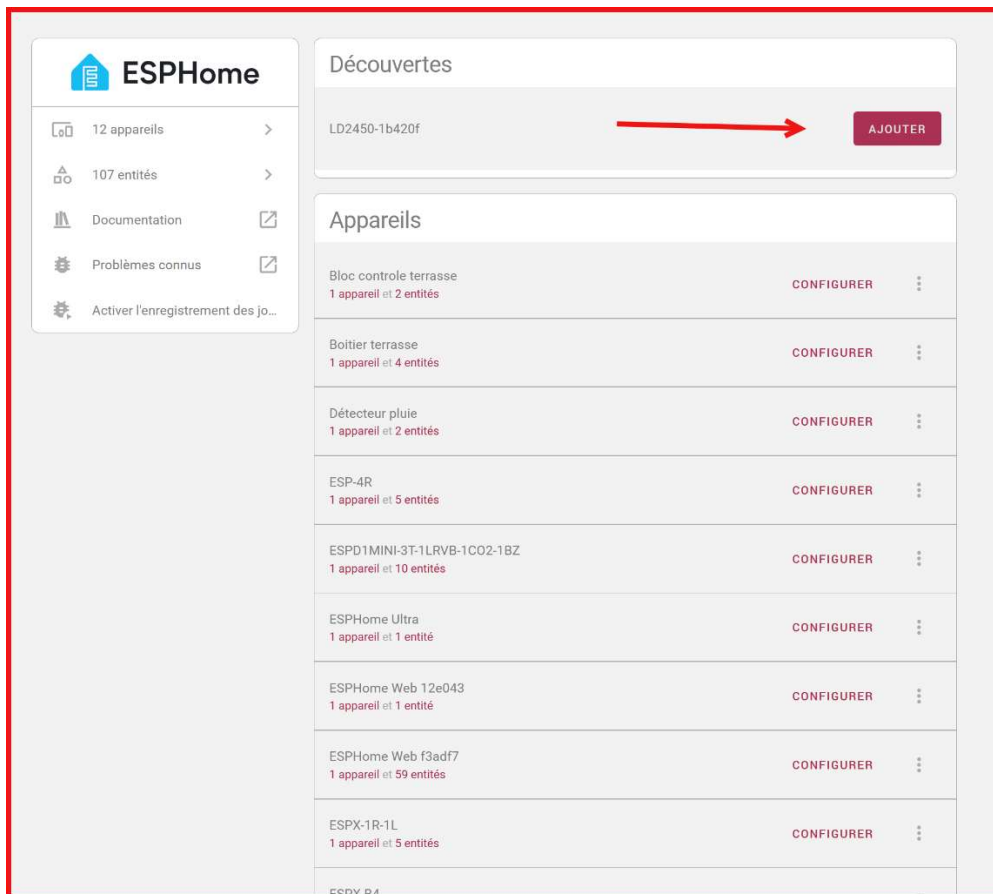


In the **Discoveries** section, you should see your module; if so, press **Add**.

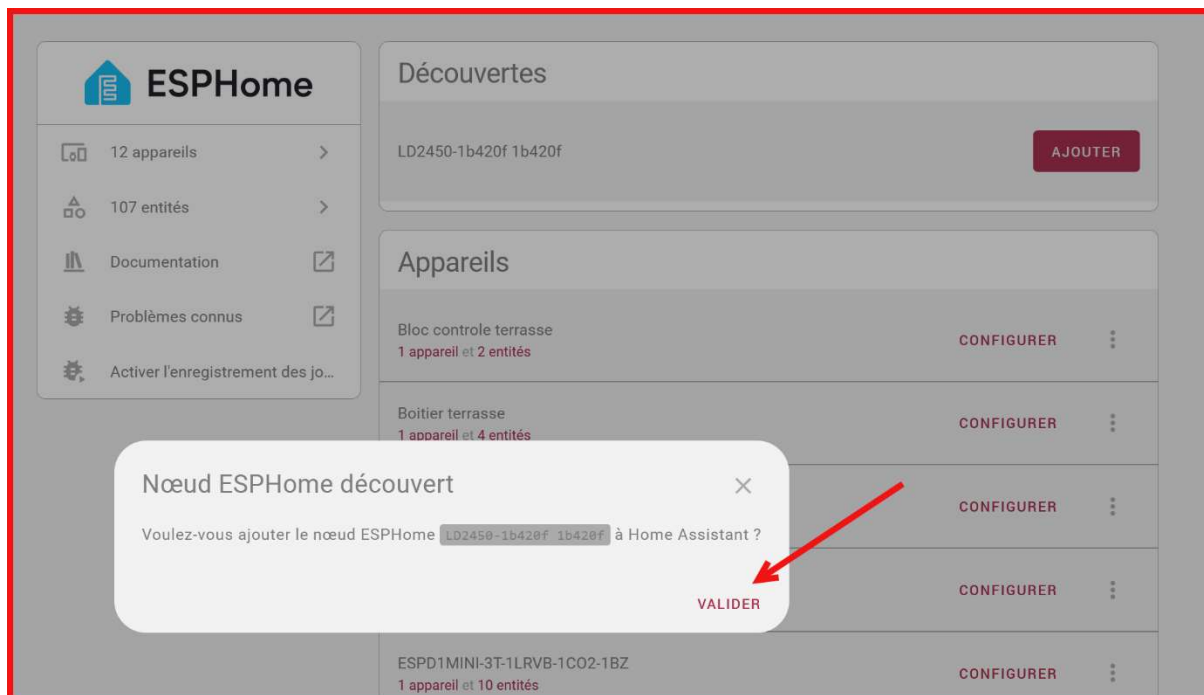

Then click on Validate.

A message will quickly appear, then you can assign a room (living room, bedroom...) to your module.

Then your module should appear in the list of devices :

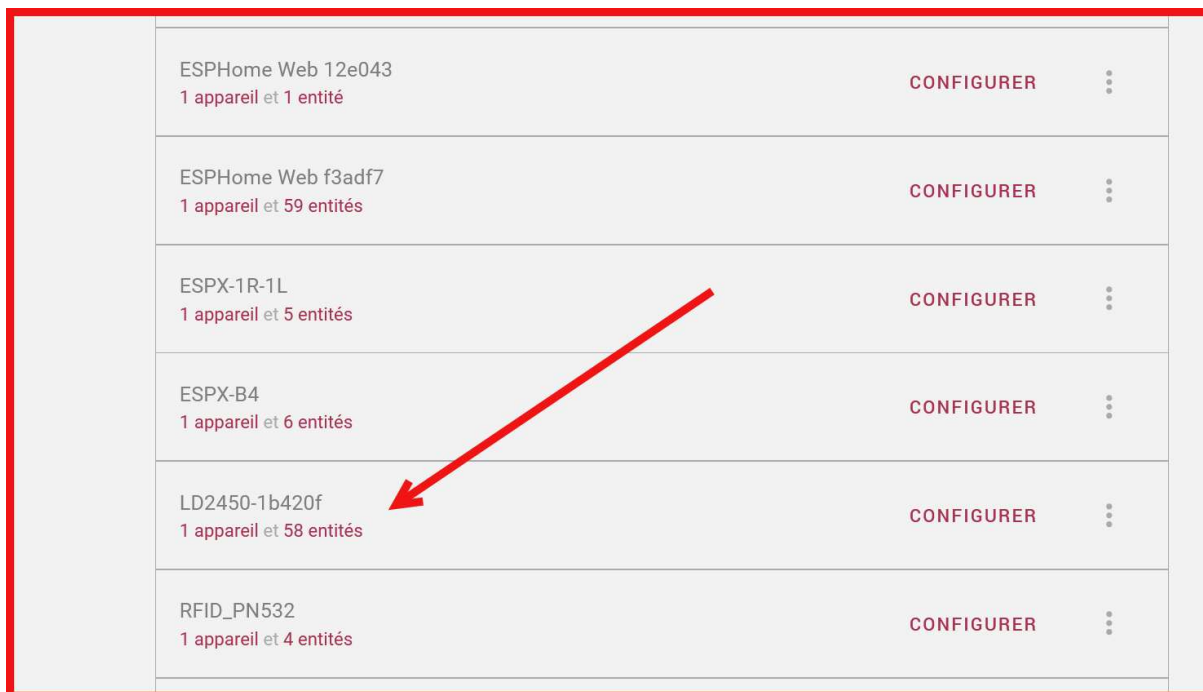

ESPHome Web 12e043 1 appareil et 1 entité	CONFIGURER	⋮
ESPHome Web f3adf7 1 appareil et 59 entités	CONFIGURER	⋮
ESPX-1R-1L 1 appareil et 5 entités	CONFIGURER	⋮
ESPX-B4 1 appareil et 6 entités	CONFIGURER	⋮
LD2450-1b420f 1 appareil et 58 entités	CONFIGURER	⋮
RFID_PN532 1 appareil et 4 entités	CONFIGURER	⋮

Click on **1 device** to see the entities and information of the module:

For the **Mitsubishi Air Conditioner Controller**, you should see :

Dans Chambre

Informations Appareil

esp32dev
par Espressif

Micrologiciel : 2026.2.4 (2026-03-19 18:31:37 +0100)

MAC: [A4:F0:0F:68:FC:88](#)

ESPHome

Visiter

Contrôles

CLIM

Éteint

CLIM_Vertical Vane

+ 1 entité désactivée

Ajouter au tableau de bord

Logbook

21 mars 2026

CLIM CLIM a été éteint
16:56:15 - Il y a 7 secondes

CLIM CLIM_Soft Version a changé en 1.0
16:56:15 - Il y a 7 secondes

CLIM CLIM_Hard Version a changé en 1.0
16:56:15 - Il y a 7 secondes

CLIM CLIM_IP a changé en 192.168.1.206
16:56:15 - Il y a 7 secondes

CLIM CLIM_BSSID a changé en 3A:07:16:CC:7B:90
16:56:15 - Il y a 7 secondes

CLIM CLIM_SSID a changé en Freebox-C9DE33

Automatisations

Aucun automatisations n'a été ajouté(e) utilisant appareil pour le moment. Vous pouvez en ajouter un/une en appuyant sur le bouton + ci-dessus.

Scènes

Aucun scènes n'a été ajouté(e) utilisant appareil pour le moment. Vous pouvez en ajouter un/une en appuyant sur le bouton + ci-dessus.

Scripts

Aucun scripts n'a été ajouté(e) utilisant appareil pour le moment. Vous pouvez en ajouter un/une en appuyant sur le bouton + ci-dessus.

Capteurs

CLIM_Hard Version 1.0

CLIM_Soft Version 1.0

+ 5 entités désactivées

Ajouter au tableau de bord

Configuration

CLIM_Restart

Appuyer

Ajouter au tableau de bord

Diagnostic

CLIM_BSSID 3A:07:16:CC:7B:90

2026.2.4 (config hash 0x97bc7e17, built 2026-03-19 18:31:37 +0100)

CLIM_IP 192.168.1.206

CLIM_SSID Freebox-C9DE33

CLIM_Uptime 3 s

CLIM_WiFi Signal -25 dBm

+ 5 entités désactivées

Important note : several users have told me that at the startup, the **CN105-2HA** module sometimes does not connect properly to the **Mitsubishi** device. The workaround is to trigger the **CN105-2HA** module reset procedure using the entity : **button.clim_x_restart**.

Important note : If you purchase additional CN105-2HA units in the future, please let me know how many you already have so that I can deliver them with the correct indexes (CLIM_2, CLIM_3, CLIM_4, etc.).